



INFORMATIONAL MEMORANDUM

TO: Transportation and Infrastructure Services Committee
FROM: Pete Mayer, Interim Director
BY: David Baus, Transportation Project Manager
CC: Mayor Thomas McLeod
DATE: April 25, 2025
SUBJECT: 2024 Pavement Condition Index (PCI) Study Update
Presentation on the 2024 PCI Study Results
Contract No. 24-072

ISSUE

Provide the Transportation and Infrastructure Services Committee with an update on the condition of the City's roads, presenting findings from the 2024 PCI study and incorporating comparisons to the 2020 PCI Study.

BACKGROUND

PCI studies are essential for evaluating the condition of city roads and identifying pavement issues, such as cracks or potholes. They allow cities to prioritize maintenance, improve safety, and manage infrastructure budgets effectively. By providing a clear understanding of road conditions, PCI studies help cities plan strategic repairs and ensure long-term economic and public safety benefits.

ANALYSIS

The City's average Pavement Condition Index (PCI) score has increased by one point since the 2020 study and now stands at 67, which is above the national average of 60 to 65. Key findings from the study include:

1. Streets rated as "excellent" account for 9.5%, falling short of the target of 15%.
2. The backlog amount is 6%, significantly below the national average of 12%.

Looking ahead, the Capital Improvement Plan (CIP) budget of \$2.5M through 2028 will be slightly below the steady-state funding required to maintain the city's current PCI level.

FISCAL IMPACT

The cost for 2024 PCI Study was \$52,890, which was paid for by an ARPA Grant.


RECOMMENDATION

Although this is a discussion only presentation, we recommend performing a city PCI study every four (4) years with next occurring in year 2028.

Attachments: 2024 PCI Study

Tukwila, WA

Pavement Management Report December 2024

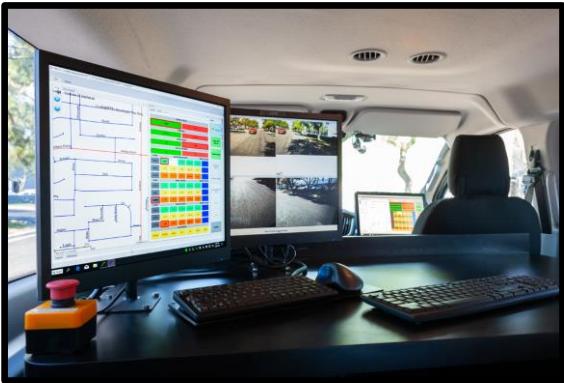

CITY OF
TUKWILA



IMS
POWERED BY ICC

TABLE OF CONTENTS

1.0	EXECUTIVE SUMMARY	1
1.1	PROJECT AND METHODS OVERVIEW	1
1.2	RESULTS OVERVIEW AND RECOMMENDATIONS	2
2.0	PRINCIPLES OF PAVEMENT MANAGEMENT	5
2.1	PAVEMENT MANAGEMENT PRINCIPLES.....	5
3.0	DATA COLLECTION AND ANALYSIS	7
3.1	FIELD SURVEY METHODOLOGY	7
3.2	DATA QUALITY ASSURANCE	8
3.3	PAVEMENT CONDITION SURVEY	9
3.4	ESA PAVEMENT MANAGEMENT SYSTEM.....	17
3.5	ICC INFORM PAVEMENT NETWORK CONDITION VIEWER	20
3.6	SUMMARY.....	20
4.0	PAVEMENT CONDITION SURVEY RESULTS.....	21
4.1	CITY STREET INVENTORY AND CONDITION SUMMARY.....	21
4.2	CITY NETWORK CONDITION IMAGERY.....	22
4.3	CITY NETWORK CONDITION DISTRIBUTION	29
4.4	CONDITION BY FUNCTIONAL CLASSIFICATION	30
4.5	SUMMARY.....	31
5.0	REHABILITATION PLAN & BUDGET DEVELOPMENT	32
5.1	KEY ANALYSIS SET POINTS AND ASSUMPTIONS	32
5.2	NETWORK BUDGET ANALYSIS MODELS	34
5.3	POST REHABILITATION CONDITION	38
5.4	SUMMARY.....	38
6.0	PROJECT RECOMMENDATIONS & COMMENTS.....	39
6.1	PROJECT SUMMARY AND RECOMMENDATIONS.....	39
6.2	CLOSING.....	39

APPENDED REPORTS Following Page 40

Appendix A Street Inventory and Condition Summary by Segment

Appendix B 5-Year Rehab Plan

Appendix C Full-size Maps

APPENDED MAPS

Functional Classification

Current Pavement condition index (PCI)

5 Year Rehabilitation Plan: \$1.4M Annual Budget

5 Year Post Rehabilitation PCI: \$1.4M Annual Budget

1.0 EXECUTIVE SUMMARY

1.1 Project and Methods Overview

In July of 2024, IMS Infrastructure Management Services, LP (IMS) utilized a cutting-edge Integrated Road Information System (IRISpro Pave) (**Figure 1**) to capture continuous, high-resolution pavement images that were used to assess pavement cracking, rutting, and roughness on 82 centerline miles of predominantly asphalt roadways in Tukwila, WA (City). IMS followed the American Society for Testing and Materials (ASTM) D6433 standard to analyze the images and distress data collected by the IRISpro to determine the Pavement Condition Index (PCI) for each segment of the road. PCI values were recorded to provide an indication of the surface conditions and structural integrity of a pavement.

Using the Easy Street Analysis (ESA) pavement management system, IMS developed multi-year pavement maintenance and rehabilitation (M&R) recommendations for the roadways surveyed. The recommendations consider the severity, quantity, and type of pavement distresses, surface type, pavement strength and functional class. By utilizing these recommendations, the City can make informed decisions on how best to allocate their resources to ensure the longevity and safety of their roadways.



Figure 1 - IMS Integrated Road Information System platform (IRISpro Pave)

The PCI method was used in accordance with the ASTM D6433 standards to assess the condition of the City's pavements. This method is considered an objective and repeatable approach to assess pavement condition, which is preferable to alternative methods that rely upon potentially biased human ratings. Based on the PCI results, ESA prioritizes funding using a cost-of-deferral approach, recommending M&R activities that optimize funding by selecting rehabilitation candidates only when they approach the critical point where a heavier maintenance activity will soon be needed to restore the roadway to full service.

The analysis and data presented in this report are based on the inspections performed by IMS in July 2024 on the City's pavement network, using available work history and other assumptions that are elaborated on later in this report.

1.2 Results Overview and Recommendations

PCI values provide an indication of the surface conditions and structural integrity of a pavement. The 0–100 PCI range is commonly divided into categories using descriptive terms: *Very Poor*, *Poor*, *Marginal*, *Fair*, *Good*, *Very Good*, and *Excellent*. Divisions between the terms are not fixed but are meant to reflect common perceptions of pavement conditions. These divisions are discussed in more detail in Section 3.0.

The City's roadways were generally found to be in *Good* condition **with an average PCI of 67**. **Figure 2** provides a visual breakdown of the distribution of pavement area across different PCI categories at the time of analysis. Approximately 49% of the City's roadways were found to be in *Excellent* or *Very Good* condition. If structurally sound, these pavements are often suitable candidates for cost-effective preventive maintenance treatments. On the other hand, pavements with a PCI below 40 (i.e., pavements in *Poor* or *Very Poor* condition) comprise the City's "backlog" of M&R. The **City's backlog was found to be 6%**. These pavements typically require full or partial reconstruction. Pavements falling within the middle categories, such as *Fair* or *Marginal* condition, often benefit from mill and overlay projects. It's important to note that these are general recommendations, and the specific M&R strategy may vary based on factors such as distress types, soil conditions, structural adequacy, and other project-specific details.

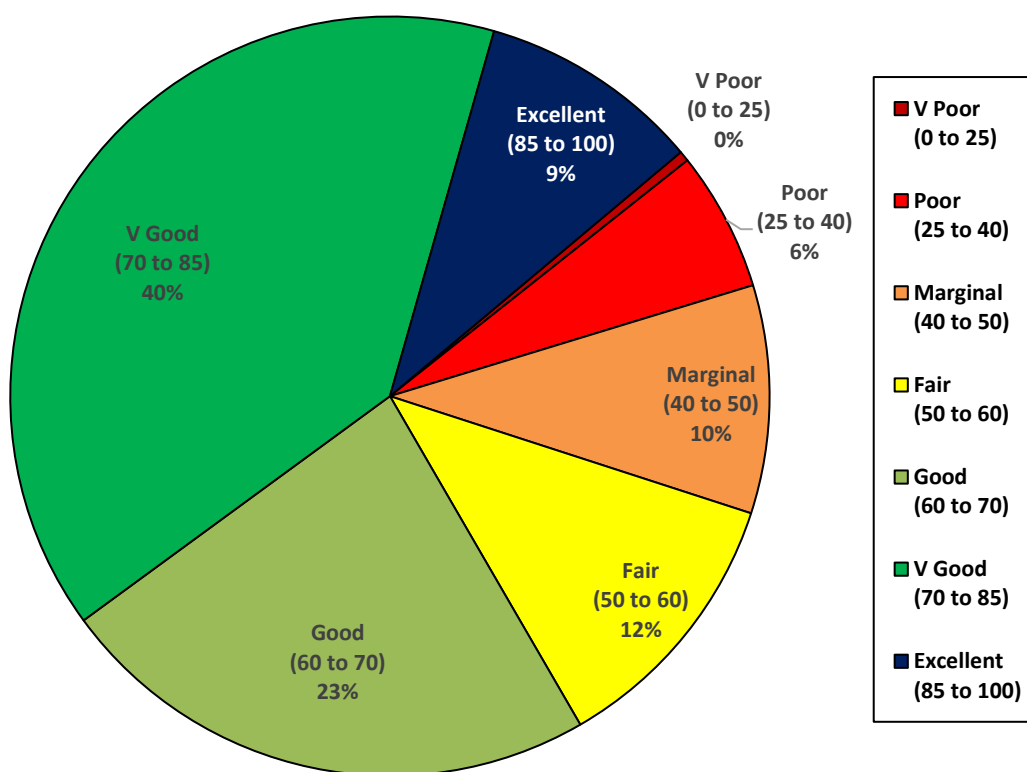


Figure 2 - Distribution of the City's Pavement System on a Condition Scale

Metrics of Health

The following three metrics are frequently used as indicators of overall pavement network health. The pavement analysis uses these metrics as benchmarks when determining budget goals, such as the backlog control, PCI control, and recommended funding levels.

Pavement Condition Index (PCI) – The PCI score is a ranking assessment on the overall health of a pavement segment on a scale of 0 to 100. The network average PCI is a good global indicator of a network's overall health.

Percent of Excellent Roads – Roads with a condition category of Excellent are those that score between a PCI of 85 to 100.

Backlog – Backlog is the Very Poor and Poor roads (between a PCI of 0 and 40) that represent a portion of the network in need of extensive rehabilitation such as full and partial reconstruction. Using sound pavement management and finance principles, a very healthy network will have a backlog of 10% or less.

The City met two out of three of the metrics for evaluating the quality of its roadway network.

- ✓ The network average pavement condition score exceeds the national average currently seen by IMS of 60 to 65, with the City's average scoring a **67**.
- The number of streets rated Excellent is below the minimum recommended target of 15% at **9.5%**
- ✓ The backlog amount is below the average value of 12% at **6%**.

The analysis conducted by IMS using the ESA pavement management system has provided the City with valuable insights into the condition of its roadways. To assess the effect of annual budget on PCI over a five-year period, **Figure 3** has been generated to depict the anticipated PCI in five years relative to different annual budget allocations. The blue line allows the user to assess the effect of a given annual budget on the PCI in five years, serving as a valuable tool for understanding the potential effects of budget decisions on future pavement conditions.

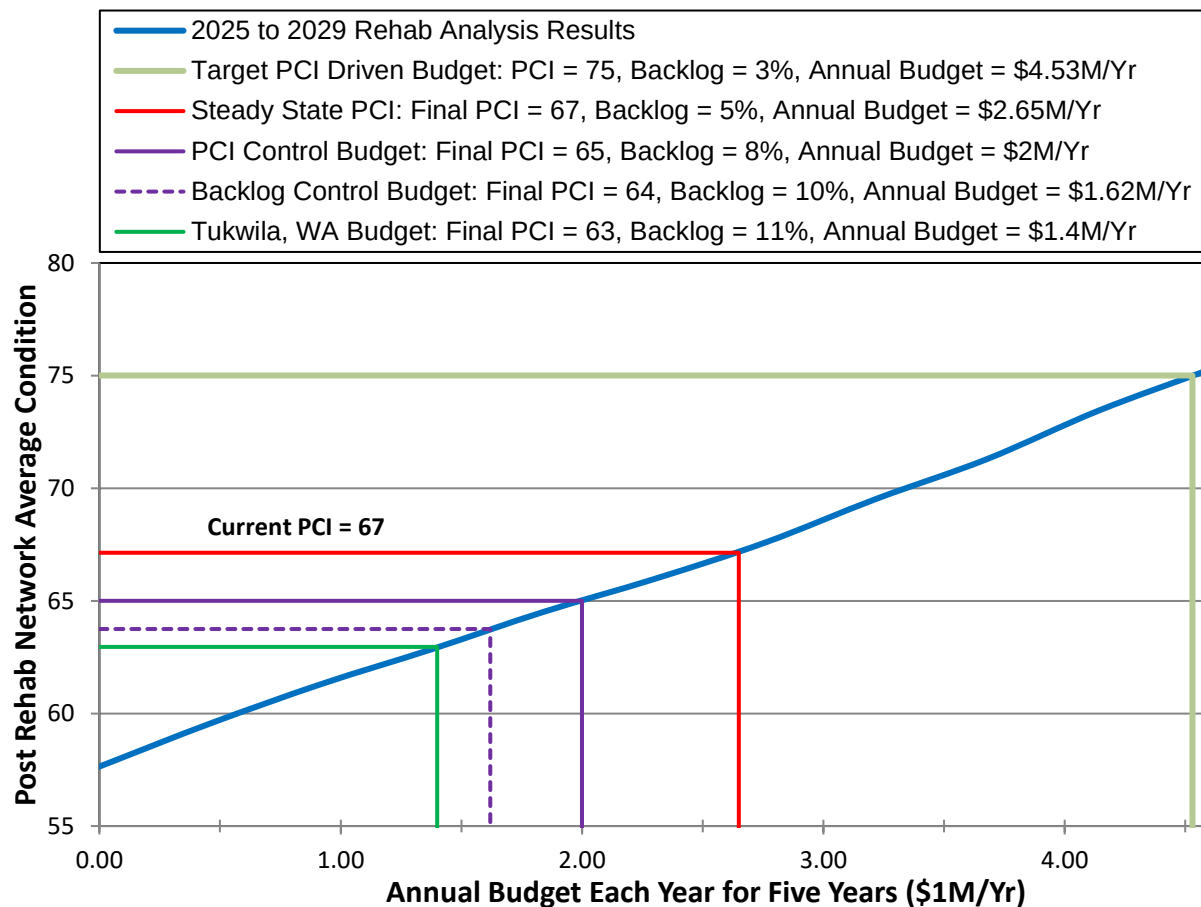


Figure 3 - PCI Based on Five-Year Annual Budget Funding Models

It is important to note that the information presented in the Executive Summary is condensed from various sections of this report. Reviewers are encouraged to familiarize themselves with the detailed information provided in subsequent sections of the report prior to making any specific decisions based on these results. This will ensure that decisions regarding M&R activities are based on a comprehensive understanding of the conditions of the roadways and the recommendations provided in the report.

2.0 PRINCIPLES OF PAVEMENT MANAGEMENT

This section provides an overview of pavement management, including its objectives and the best practices for M&R planning throughout the lifecycle of a pavement. It also highlights the integration of these concepts in the ESA pavement management system, which was used in this report to develop recommendations and analyze the City's pavement network. This context is important for understanding the content and findings of the report.

2.1 Pavement Management Principles

Pavement management is the process of assessing, prioritizing, and preserving or rehabilitating pavements through a logical system that attempts to use available funds in the most cost-effective manner possible. The process is iterative, and as more data becomes available, prediction models are refined to improve accuracy. **Figure 4** illustrates that pavements typically start deteriorating rapidly once they hit a specific threshold. Therefore, it is more cost-effective to invest in cheaper surface treatments during the first 40% of a pavement's lifespan than to defer maintenance until heavier overlays or reconstruction is required just a few years later. Streets that are repaired while in good condition will have an extended lifespan and will cost less to maintain over their lifetime than those left to deteriorate to a poor condition. Without an adequate routine pavement maintenance program, streets will require more frequent reconstruction, thereby requiring significantly greater funding.

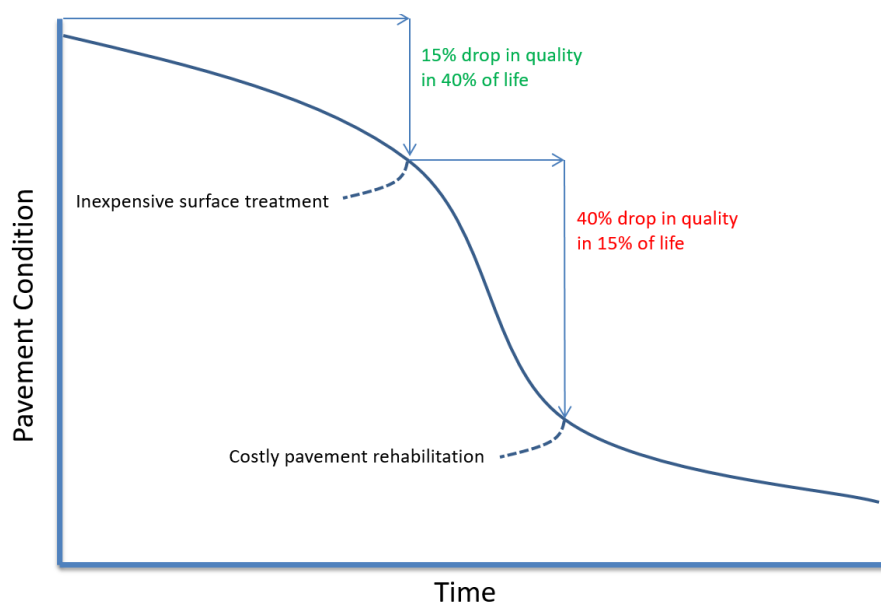


Figure 4 - Pavement Deterioration and Life Cycle Costs

The types of rehabilitation activities that the City chooses to deploy can have a significant effect on the longevity of a pavement. Depending on the PCI zone in which a pavement falls, a detailed rehabilitation strategy needs to be formed. Common rehabilitation types include localized preventive or stop gap activities (e.g. crack sealing, joint sealing, and patching), global preventive maintenance (e.g. fog seals, rejuvenators, slurry seals, microsurfacing, chip seals, cape seals, and thin overlays), major Rehabilitation (e.g. thin or thick mill and overlays), and major Reconstruction

(e.g. surface reconstruction or full reconstruction). Popular examples of cost-effective preventative activities include:

- Crack and Joint Sealing
- Microsurfacing
- Fog Seal and Rejuvenators
- Patching
- Slurry and Chip Seals
- Thin Overlays

A proactive pavement management program focuses on the preventative maintenance category and advocates proper incorporation and application of cost-effective preventative activities. These activities help maintain and repair the surface integrity which can slow deterioration and, depending on the treatment, also extend the life of a pavement. The outcome of this exercise is to increase long-term cost savings and network-level pavement quality over time.

When completed within the target zone for preventative maintenance, a pavement's lifespan can be conveniently extended. The dashed curves in **Figure 5** show the typical lifespan of a pavement that does not undergo any preventative maintenance. Major reconstruction becomes necessary after approximately 20 years. The blue curves show the benefits of preventive maintenance during the first 40% of a pavement's lifespan. Eventually, all pavements will need to undergo reconstruction; however, proactive maintenance and rehabilitation can delay this process for up to an additional 40 years.

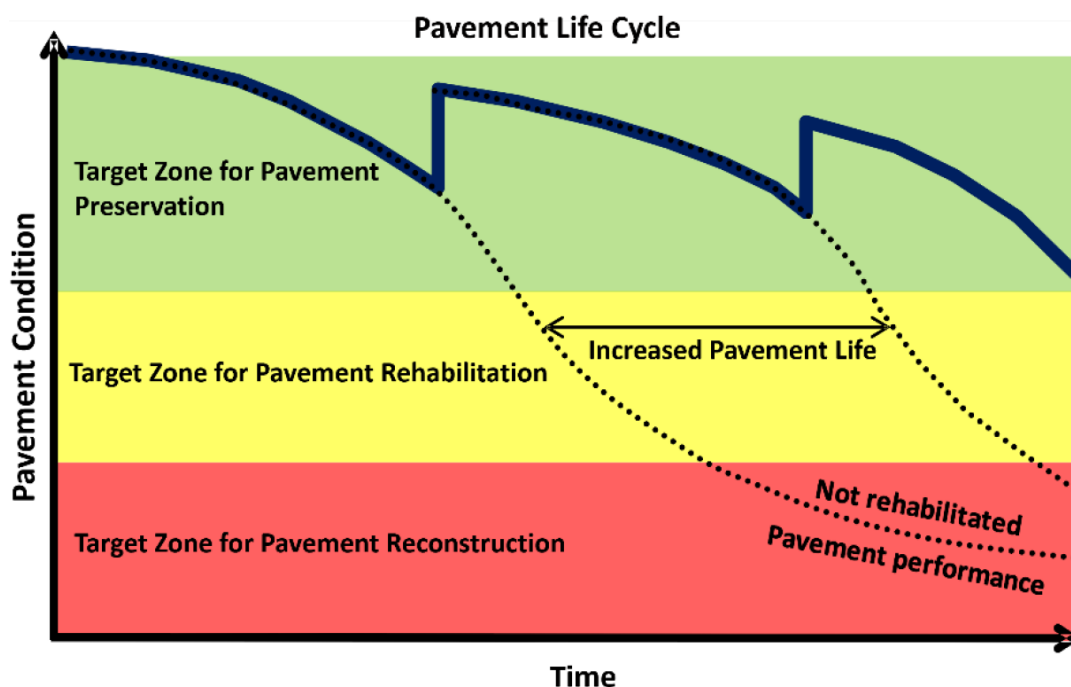


Figure 5 - Pavement Life Cycle Curve

The most effective approach to ensure optimal usage of available funds or to determine the necessary funding to achieve a predetermined level of service is by using a pavement management system. An effective pavement management system can assist agencies in developing an organized catalog of pavement assets, storing periodic condition assessments, and tracking spending and costs. This enables the City to compare trends in data to assess the effectiveness of maintenance activities and new technologies.

3.0 DATA COLLECTION AND ANALYSIS

3.1 Field Survey Methodology

IMS deployed one of its IrisPro Pave Integrated Road Information Systems for data collection. IrisPro Pave integrates industry-leading subsystems, including 3D pavement imaging systems, lasers, accelerometers, right-of-way cameras, GPS antenna, distance measurement instruments, computers and more (**Figure 6**). All collected data is captured with Drive™ data collection software, which is designed to simplify the collection of quality road data with built-in calibration schedules, real-time quality control, GIS maps, section tracking, audible alerts and voice memos, fly-by events, and exception reporting. The custom-designed hardware and software on IrisPro Pave provides sub-millisecond synchronization between all subsystems.

- ✓ **Teledyne FLIR Ladybug 5+**
Captures 360° Imagery at Defined Intervals
- ✓ **ASTM Class 1 IrisPRO Pavement Profiler**
Continuous Right and Left Wheel Path Roughness Measurements
- ✓ **Pavement Distress Imaging**
LCMS-2 Continuous 3D Imaging, 1mm Resolution
- ✓ **Drive™**
Automated Data Collection Paired with Field Observations
- ✓ **GPS Positioning**
GPS with Integrated IMU, Sub Meter Positional Accuracy
- ✓ **Samsara Monitoring**
Real-Time Tracking and Reporting
- ✓ **Texture**
Continuous Surface Texture Measurements
- ✓ **Linear Distance Positioning**
DMI for Precise Linear Distance Measurements
- ✓ **Safety Lighting**
Front and Back Facing Flashing Lights Ensure High Visibility



IrisPRO Pave

Figure 6 – LCMS-2 data collection vehicle

3D Pavement Imaging

The Laser Crack Measurement System (LCMS-2) captures continuous 2D and 3D images at 1 mm resolution in the lane of travel up to 4 m (13 ft) wide at highway speeds, allowing for the visualization and characterization of all features on the road surface. The system allows for collection rates up to 28,000 profiles per second, five times faster than the first edition of LCMS. This allows smaller cracks, especially transverse cracks, to be detected more consistently than in the past. The vertical accuracy has also improved from 0.50 mm to 0.25 mm.

High Quality Imaging

The Ladybug 5+ captures high quality 30MP spherical images using six cameras for a 360-degree view of the roadway and surroundings. The images can be viewed in panoramic mode, 360 mode, or individual directional images can be extracted at any desired camera angle. Both the Pavement imaging and right of way cameras are triggered on a fixed-distance basis, image capture is precisely synchronized to GPSTime and DMI, and cameras are calibrated for asset inventory and geo-referenced image measurements.

3.2 Data Quality Assurance

The collected data is processed in the office using the Connect™ software. Connect provides a perfectly synchronized multi window platform to view and alter all collected data including profile, distress, slope, International Roughness Index (IRI), events, images, and GPS map. **Figure 7** shows some examples of how data can be viewed in Connect. Using Connect, the LCMS-2 3D pavement images are analyzed to identify and classify distresses, and the longitudinal profile of the road is analyzed to determine the IRI and ride quality under the wheel paths according to industry standards. All processed data is matched to the segment ID of the roadway.

To ensure the accurate determination of PCI scores, the field data undergoes a rigorous series of processing phases and quality checks. These checks encompass synchronized assessment of both processed and raw data streams. The automatic distress identification and classification process involves various steps: First, different rules and processing parameters are applied on different pavement types; next, the auto detected lane markings are manually adjusted to exclude non-pavement areas and limit the assessment area for cracking and rutting to between the lane markings and invalidation rules are applied to exclude additional anomalies (e.g. near railroad crossing or bridge decks) from the assessment area. Finally, a team of pavement raters who are well-versed in both the distress standards and the data in its digital format review images and make the necessary corrections on areas with gross under/over detection.

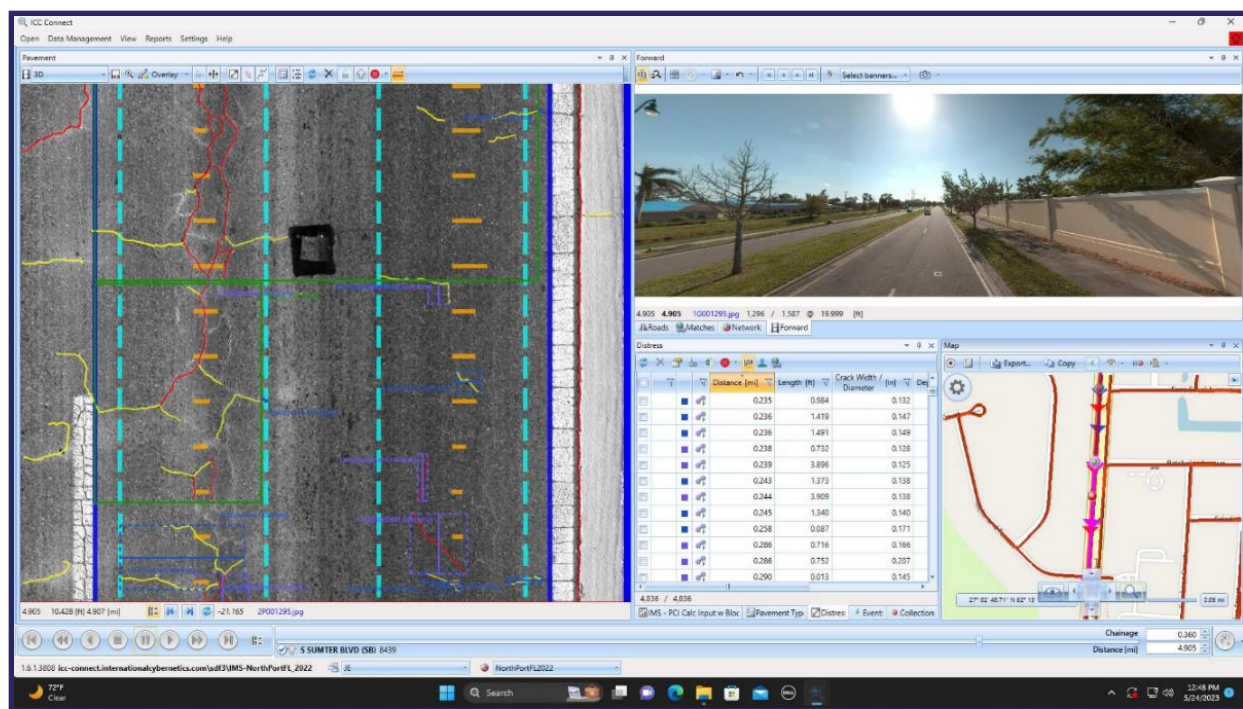


Figure 7 - QC Image from Connect™ Software

To further confirm the accuracy of our condition data, spot checks are conducted on a network-wide basis by both the QC team and engineering staff. These spot checks are carried out on a random selection of road sections across the entire network to verify that the condition data is consistent and accurate. They also help to identify any potential issues that may have been missed during the initial data collection and review process.

Once the QC team and engineering staff have established the integrity of the data, an initial condition spreadsheet with detailed data and summary tables and charts is prepared and submitted for review by the Client. This review process involves a careful examination of the condition data and includes a comprehensive analysis of the data's completeness, accuracy, and consistency before preparing data for import to City's pavement management system.

3.3 Pavement Condition Survey

The goal of the pavement condition survey is to determine an accurate rating for each pavement section. The process of collecting and assessing data involves both automated and manual observations that originate from the data collected with the IrisPro Pave equipped with LCMS-2 downward imaging lasers, an array of 4k cameras, and trained rating personnel.

Within the "Network Analysis" tab in ESA, IMS has populated values for Surface Distresses, Roughness score, and Strength Rating. These three indices form the foundation on which ESA operates. They allow weighing factors to be uniquely specified for PCI calculation.

Surface Distress Index (SDI)

ASTM D6433 provides a method of categorizing surface distress observations for both asphalt and concrete pavements, based on the extent and severity of distresses along the roadway. The Surface Distress Index (SDI) is used to represent the observed pavement defects on a scale from 0 to 100. However, not all surface distresses are given equal weight. Load-associated distresses (LAD), such as rutting or alligator cracking on asphalt streets, and divided slabs on concrete streets, have a greater impact on the SDI than non-load associated distresses (NLAD), such as raveling or longitudinal and transverse cracking. Even when present in low extents and moderate severity, LAD can significantly decrease the SDI. The SDI inputs are shown in **Figure 8**.

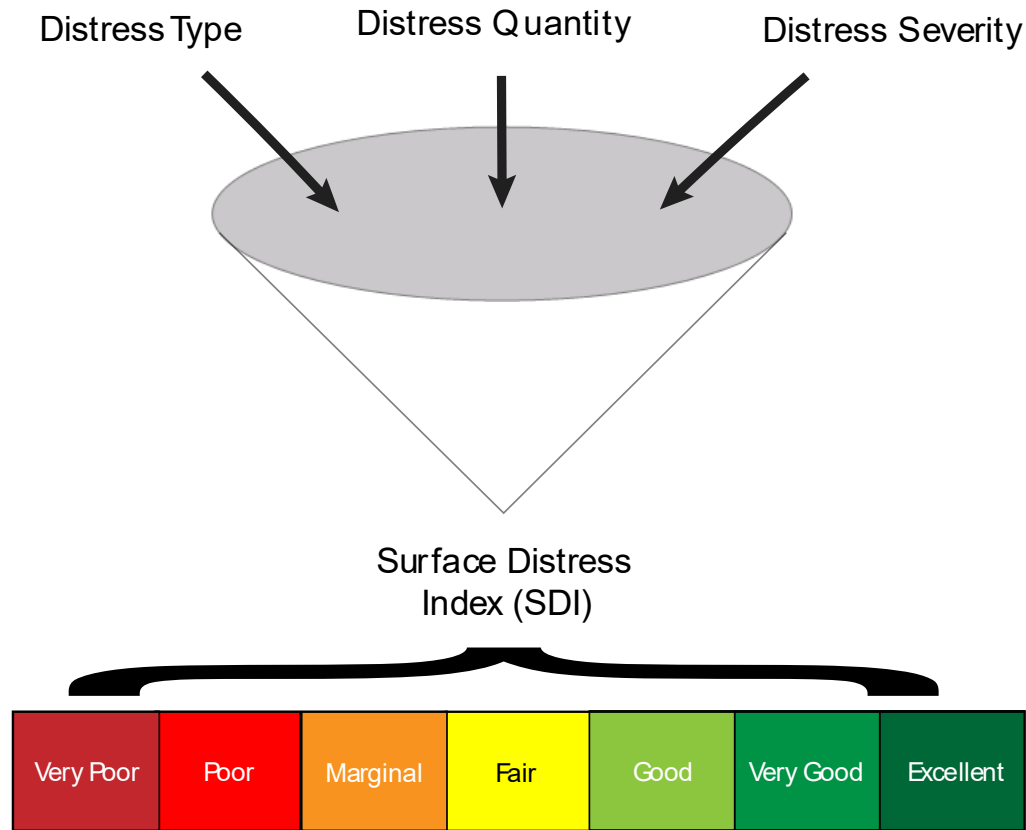


Figure 8 - SDI Inputs and Detailed Scale

ASTM D6433 covers nearly forty unique distress types that may or may not be present in an agency's road network. For that reason, IMS uses a modified approach that collects the most common and relevant distresses. The descriptions in **Table 1** outline some of the distresses collected for the City:

Table 1 - Distress Descriptions

Distress Type	Pavement Type	Description	Example
Alligator Cracking	Asphalt	• Quantified by severity and square footage • Caused by the repeated bending from vehicle loads • Propagate from the bottom, meaning that structural failure has occurred • An LAD with significant impact on the condition score, even at low extents	
Rutting	Asphalt	• Caused by the permanent deformation of the pavement and/or subgrade layers • Low densities can have a large impact on the final condition score due to their implication of possible structural failure	
Longitudinal & Transverse Cracking	Asphalt	• Quantified by their length and width • Results from pavement shrinkage due to natural daily and seasonal temperature cycles, construction issues, or other factors	

Block Cracking	Asphalt	• Quantified by their width and square footage • Form interconnected longitudinal and transverse cracks • Divides the pavement into rectangular pieces • Results from aging and environmental factors	
Patching	Asphalt	• Quantified by the square footage and severity • Always considered a surface defect • Affects ride quality and condition of a pavement	
Raveling	Asphalt	• Measured by severity and square footage affected • Loss of coarse aggregate on pavement surface	
Bleeding	Asphalt	• Measured by severity and square footage • Presence of free asphalt binder on the roadway surface • Results in a pavement surface with reduced skid resistance • Caused by either an excess of asphalt in the pavement or insufficient voids in the matrix	

Edge Cracking	Asphalt	• Measured in linear feet • Caused by traffic loading and weakened base conditions resulting from poor drainage • Run parallel to the road, usually within 1 to 2 feet of the outer edge of the pavement	
Distortion	Asphalt	• Bumps and sags, depressions, swell, corrugation, and shoving • Caused by several factors, such as construction issues, subgrade mixture failure, environmental influence, etc.	
Weathering	Asphalt	• Wearing away of asphalt binder and fine aggregate matrix • Quantified by severity and square footage	
Divided Slab	Concrete	• Slab divided by cracks into four or more pieces • Caused by overloading, inadequate support, or both • Categorized as a severe corner break if all pieces or cracks are contained within a corner break	
Corner Breaks	Concrete	• Crack that intersects with a joint at less than $\frac{1}{2}$ the slab length • Caused by repeated load on a surface with a failing base	

Joint Spalling	Concrete	• A breakdown of the edges of a slab within 2ft of a joint • The depth of the cracking and area affected determine the severity	
Faulting	Concrete	• Identified by a difference in elevation across a joint • Severe faults have a >3/4 inch elevation difference between two adjacent concrete slabs	
Durability Cracking	Concrete	• Caused by the freeze-thaw expansion of the large aggregate • Breaks down concrete over-time • Typically runs parallel to a joint or linear crack • A high severity "D" crack covers more than 15% of the overall slab	
Scaling	Concrete	• A result of the surface layer of concrete being worn away over time by weathering • Measured by severity and total area affected	
Punchouts	Concrete	• Caused by heavy and repeat loads, inadequate slab thickness, and a deterioration of the base foundation • Measured by severity and number of individual cracks within the distress	

Roughness Index (RI)

The Roughness Index (RI) provides a quantifiable measure of ride quality, which is determined using the industry-standard ASTM E1926 for calculating the IRI. This value is derived from the longitudinal profile captured by the LCMS as it records the change in elevation over a distance. Once calculated, it is expressed as a slope and reported in millimeters per meter (mm/m). Typical IRI levels for new, older, and damaged pavements are displayed in **Figure 9**. The IRI is lower on average for roads or pavements that are normally used for higher speed travel.

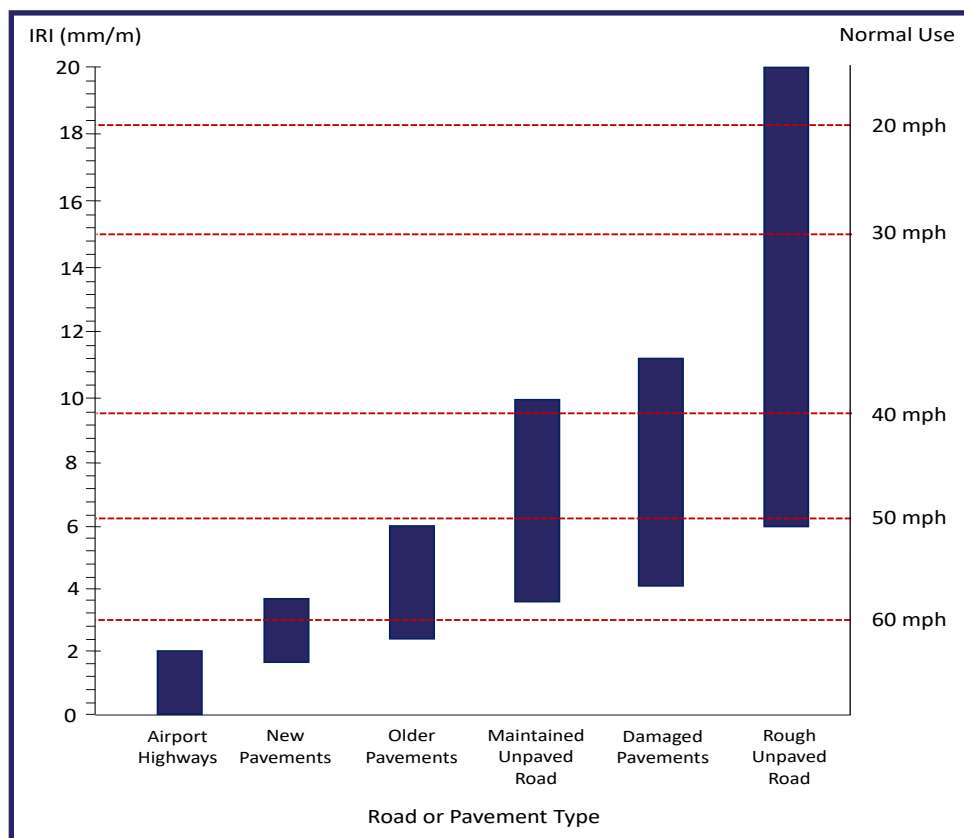


Figure 9 - IRI Scale Definitions

To enable the use of a blended condition score that incorporates both PCI and IRI scores, the IRI value is converted to an equivalent scale for analysis purposes. This is achieved by converting the IRI value into a score on a scale from 0 to 100 and reporting it as the RI using the following formula:

$$RI = (11 - 3.5 \times \ln(IRI)) \times 10$$

$\ln(IRI)$ is the natural logarithm of IRI.

Structural Index (SI)

Structural adequacy testing was not requested by the City. Instead, IMS investigated the relationship between the PCI and the number of LAD observed in each pavement section to generate structural indices. Based on this analysis, each section was assigned a rating of *Weak*, *Moderate*, or *Strong* in terms of its strength. These ratings were represented by an SI of 30, 60, or 80, respectively. The established SI was not used in calculating the overall pavement condition score but rather to help determine appropriate rehabilitation strategies based on the pavement strength rating.

Pavement condition index (PCI) – Following the field surveys, the condition data was imported to ESA for calculating the overall PCI. The PCI for each segment was calculated using the following percentages of weighing factors:

$$\text{PCI} = 67\% \text{ SDI} + 33\% \text{ RI}$$

Table 2 presents each PCI category along with a brief description of the typical distresses and recommended treatments for each.

Table 2 – Pavement Condition Categories

Category	Typical Distresses and M&R Recommendations	PCI Range
Excellent	Like new condition – little to no maintenance required. Monitor condition or preventive maintenance.	85<PCI≤100
Very Good	Minor cracking, raveling, and other NLAD Routine or preventive maintenance. <i>E.g., Crack sealing, surface treatment</i>	70<PCI≤85
Good	Minor to moderate cracking and low severity LAD such as alligator cracking and rutting. Surface treatments with localized repairs and overlays <i>E.g., Surface treatments, localized surface patching, thin overlay</i>	60<PCI≤70
Fair	More extensive and severe longitudinal and transverse cracking, as well as moderate severity LAD Localized repairs or major rehabilitation. <i>E.g., Localized surface and/or full-depth patching, moderate overlays</i>	50<PCI≤60
Marginal	Localized high-severity alligator cracking, and rutting Major rehabilitation. <i>E.g., Localized full-depth patching, mill and overlay, traditional overlay</i>	40<PCI≤50
Poor	A greater extent of severe alligator cracking, rutting Major rehabilitation. <i>E.g., More extensive full-depth patching, mill and overlay, traditional overlay</i>	25<PCI≤40
Very Poor	Extensive and severe alligator cracking, more extensive and deeper rutting, and potholes. Major rehabilitation. <i>E.g., Full-depth reclamation, reconstruction</i>	0<PCI≤25

3.4 ESA Pavement Management System

The ESA software provides all the functionalities of a standalone software package while being user-friendly. It provides the City with a tool that can effectively catalog, classify, assess, track, and analyze condition data to aid in the processes of budget planning and pavement rehabilitation.



More specifically the program helps the City streamline its pavement management by giving structure to the basic information required for a management system:

- Pavement Section Inventory
- Pavement Deterioration Modeling
- Prioritization
- Funding Analysis
- Inspection Data
- Rehabilitation Selections & History
- Work Planning
- Reporting

Pavement Section Inventory

An accurate inventory of all City-owned streets is necessary to make any determinations, assumptions, or projections within a management system. Individual attributes such as length, width, location, traffic use, surface type, condition, and other factors may be tracked and tied back to a single management segment within ESA. Thereafter, they are given a unique ID within the program. These attributes are critical in determining appropriate rehabilitation activities, prioritizing the management segments within the system, and facilitating placement and sorting during reporting.

Inspection Data

ESA provides the City with the flexibility to use a blended condition index that can be tailored to meet specific goals and requirements. The inputs for this index rely on inspection data from the field survey. This custom reporting value is built based on various aspects considered while ranking the condition of a pavement. The inputs for this index are derived from inspection data collected during the field survey, including PCI and IRI data. Details on the individual components of the inspection are available earlier in Section 3.0.

Pavement Deterioration Modeling

Inspection data by itself is only capable of representing conditions at the time of collection. Nevertheless, within ESA there are customizable curves that can predict the rate of pavement deterioration based on a street's functional class, pavement type, and strength rating. These deterioration curves are critical in predicting future pavement conditions and determining appropriate rehabilitation strategies. The model assumes that pavements with similar attributes and usage will deteriorate at similar rates. For instance, high volume asphalt arterials that are already in poor condition are expected to deteriorate faster and are represented in **Figure 10** by a purple line. In contrast, low volume concrete local streets are expected to deteriorate slowly and are represented by a blue dashed line.

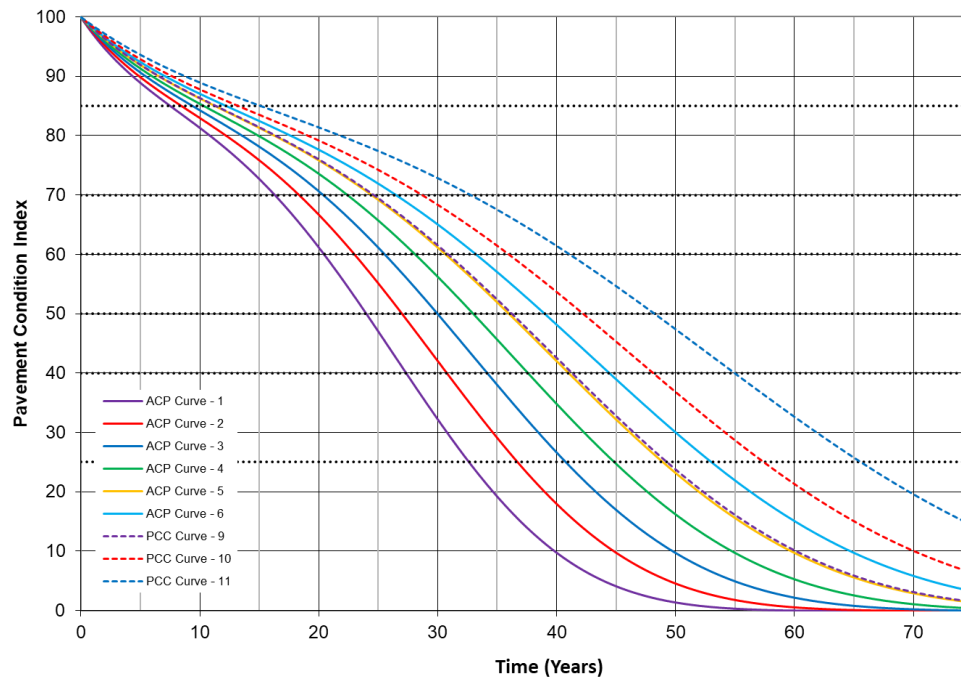


Figure 10 - Asphalt Concrete Pavement (ACP) and Portland Cement Concrete (PCC) Deterioration Curves

Rehabilitation Work Selections & History

ESA uses a set of protocols that allow for activities to be assigned to PCI ranges based on filter criteria that give the City the ability to create detailed rehabilitation strategy sets for each functional class and pavement type according to the best practices determined for that pavement.

As planned rehabilitation work is completed, a record of the work should be added to the pavement management system. This ensures that conditions are up to date for future selections and creates a repository of information to aid in planning.

Prioritization

Within ESA, the option is available to prioritize pavement projects for rehabilitation based on six main criteria: PCI, Cost of Deferral, Pavement Strength, Pavement Type, Functional Class, and the Area of a segment. Depending on the goals set forth at the beginning of the project, these criteria can be weighted differently based on their definition to create an overall priority factor for a project. Additional details on these factors are available in Section 5.

Project planning

The ability to plan work as needed allows the management program to better reflect the realities of a paving program. Certain constraints may be applied to funds that require their use within a certain year and activities relating to other assets may dictate the time and type of work to be performed. ESA allows for predefined projects to be entered into the management plan to account for work that is known. This ensures that the outcome is consistent with overall City planning and accurately reflects current funding allocations.

In terms of pavement management efficiency, a program based on worst-first, that is starting at the lowest-rated street and working up towards the highest, does not achieve an optimal expenditure of funds. Generally, under this scenario, agencies cannot sufficiently fund pavement rehabilitation and lose ground despite injecting large amounts of capital into the network.

The preferred basis of rehabilitation candidate selection is to examine the cost of deferral of a street against increased life expectancy.

Funding analysis

The actual process of determining where and when to spend funds is a function of the inputs mentioned in this section. Information from the street section inventory, condition survey, deterioration modeling, rehabilitation activity protocols, prioritization, and project planner are all assessed to predict the potential outcomes of funding scenarios. These can either be goal-based or budget-based. A more detailed description is available in Section 5.0.

Reporting

ESA has the ability to generate basic reports for common data requests through a set of predefined layouts. This allows for quick access to section condition summaries, inspection data, budget scenario summaries, and data charts. The GIS data used to generate this report is also linked to the section summary information to allow for quick and easy visualizations of the data if imported into a GIS utility. An example of data, as presented in ESA, can be seen in **Figure 11**.

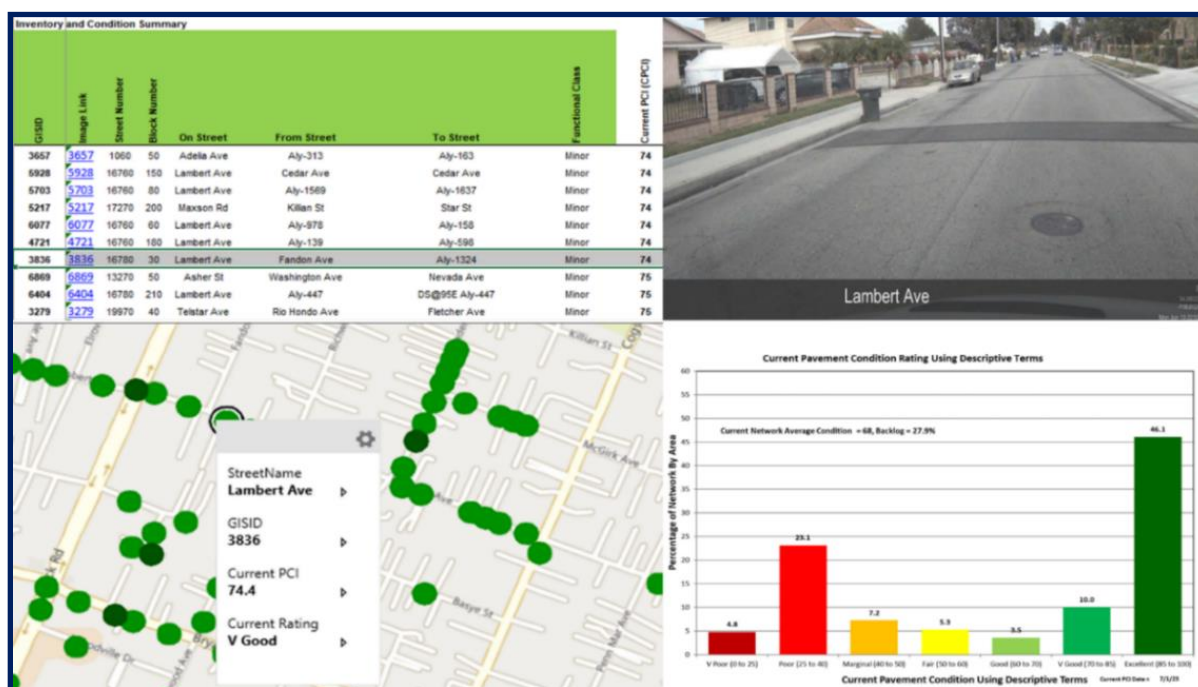


Figure 11 - Example of ESA City Data

3.5 ICC Inform Pavement Network Condition Viewer

Included with every IMS pavement management project is an out-of-the-box, user friendly, browser-based image and condition viewer tool called ICC Inform. Inform provides a convenient medium through which the City may view the imagery collected during the pavement survey. This includes a forward view of the pavement, the downward LCMS view, and a panoramic 360-degree view allowing the City to view each pavement observation from several perspectives. Lastly, a complete map of the City will track the location of every pavement image, providing additional context to the individual pavement segments. An example of Inform can be seen in **Figure 12** below.

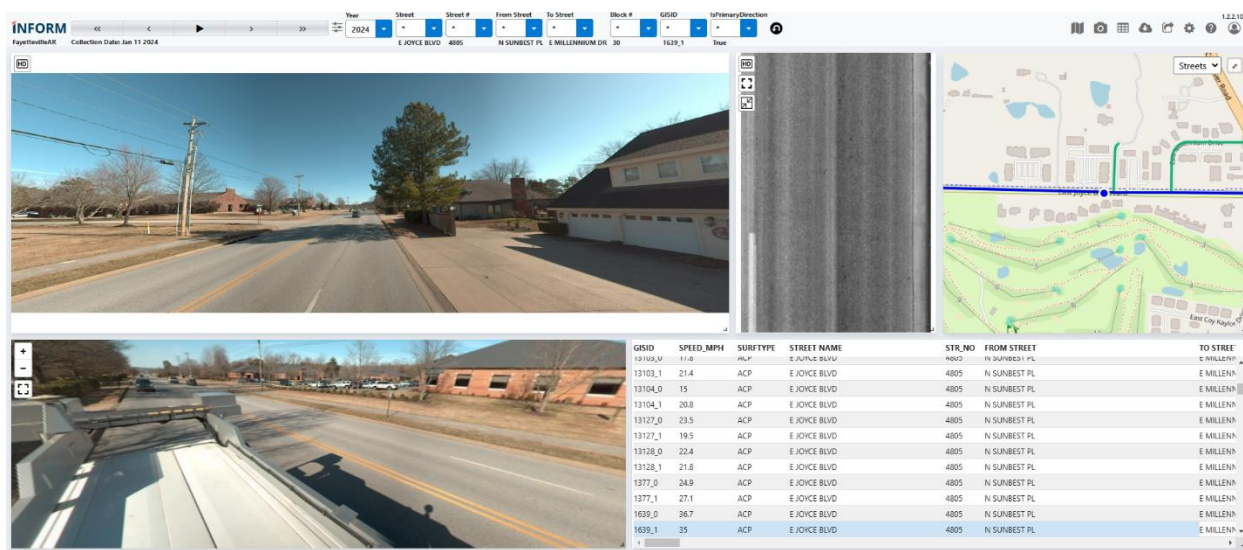


Figure 12 – ICC Inform Image Viewer

The “play” button in the top left of the Inform application provides the user a means to follow the RST as it drives the City streets. The drop-down menus in the top-center portion of the screen allow the user to quickly search for a particular street segment by GISID, and to even compare images from multiple years of surveys (if data is available from previous survey years).

The entirety of this proprietary image-viewing application can be accessed through a web browser by following a link that has been provided to the City staff.

3.6 Summary

This section outlined the fundamental concepts of pavement management and described the implementation process for the City’s pavement management system. The operating parameters of ESA were reviewed, and the inputs provided by the LCMS-2 technology were explained to provide context for calculating PCI, Roughness Index, and Pavement Strength.

4.0 PAVEMENT CONDITION SURVEY RESULTS

This section will review the results of the pavement condition survey performed in July 2024. The segments were deteriorated using the defined pavement deterioration models to reflect the conditions of the roadways at the time of analysis (January 2025). This section includes a summary of conditions in the functional classes used in the City's analysis, followed by a review of network photos taken from the survey vehicle. A series of charts will then summarize the findings of the condition survey and provide an overview of the PCI distribution across the City's pavement network.

4.1 City Street Inventory and Condition Summary

The City of Tukwila is currently responsible for approximately 82 centerline miles of pavement with an overall PCI of 67 and a backlog of 6%. The following **Table 3** presents the City's inventory and pavement condition breakdown across different functional classes. Detailed information for each pavement segment is available in **Appendix A**.

Table 3 - Network Inventory Summary by Functional Class and Pavement Type

	Pavement Type	Network	Principal Arterial	Minor Arterial	Collector	Local
Segment (Block) Count	All Streets	803	96	114	121	472
	Asphalt	783	89	108	118	468
	Concrete	20	7	6	3	4
Network Length (mi):	All Streets	82	14	15	13	41
	Asphalt	81	13	14	12	41
	Concrete	2	1	1	0	0
Network Area (yd2):	All Streets	1652585	441300	358634	249533	603118
	Asphalt	1612013	424962	346514	243111	597426
	Concrete	40572	16338	12120	6422	5692
Current Pavement Condition Index (CPCI) 1/1/2025	All Streets	67	70	66	67	66
	Asphalt	67	69	65	66	66
	Concrete	84	84	84	81	86
Current Backlog (%) 1/1/25	All Streets	6	Percentage of Network with a PCI < 40			

4.2 City Network Condition Imagery

The images presented in this section provide a sampling of the City's streets that fall into various condition categories. A discussion of potential rehabilitation strategies is included for each category.

Very Poor (PCI = 0 to 25) – Complete Reconstruction



South 141st Street from 56th Avenue to 56th Place (GISID 1591, PCI = 22) – Rated as Very Poor, this street displays a large quantity of alligator and edge cracking severe enough to suggest that the pavement structure is inadequate for current traffic loads. The rehabilitation of roads in this condition through a mill and overlay is generally ineffective, as the failures usually extend to the bottom of the pavement layer. Streets in this condition require rehabilitation that involves removal and replacement of the asphalt layer, base stabilization, or complete reconstruction based on design requirements.

Deferral of reconstruction of streets rated as Very Poor will not cause a substantial decrease in overall pavement quality. The streets have passed the opportunity for overlay-based strategies, meaning that reconstruction, which can be expensive, is the most suitable solution. Thus, Very Poor streets are often deferred in favor of rehabilitating more streets at lower costs, resulting in a greater net benefit to the City. This strategy, however, must be sensitive to citizen complaints that may demand the prioritization of these street repairs. In addition, this type of street can pose a safety hazard for motorists since severe potholes and distortions may develop. It is important to consistently monitor these streets and check for potholes or other structural deficiencies until the street is eventually rebuilt.

Poor (PCI = 25 to 40) – Last Opportunity for Surface and Base Rehabilitation



West Marginal Place from City Limit to South 102nd Street (GISID 1518, PCI = 26) – Rated as Poor, this segment still has some remaining life before it becomes a critical reconstruction need. As evident in the imagery, a fair amount of the segment contains alligator cracking. There are also deep longitudinal and transverse cracks, particularly along the edges of the pavement. If left untreated, a partial to full reconstruction would be required within a short period of time.

On heavily trafficked roadways, Poor streets often require partial to full reconstruction. On local roadways, they generally require removal of the pavement surface through grinding or excavation, base repairs, restoration of the curb line and drainage, and then placement of a new surface.

Marginal (PCI = 40 to 50) – Thick Overlay



Orillia Road from South 188th Street to South 200th Street (GISID 1371, PCI = 47) – This street displays transverse and longitudinal cracking across the middle and edges of the pavement. There are sections of alligator cracking dispersed along the segment as well.

Marginal streets that display high amounts of load associated distresses (LAD) are selected as a high priority for rehabilitation as they generally provide the best cost/benefit ratio to the City. If left untreated, Marginal streets with high amounts of LAD will deteriorate to become partial reconstruction candidates. Marginal streets that are failing due to materials issues or non-load associated failures may become suitable candidates for thick overlays if deferred, without a significant cost increase.

Fair (PCI = 50 to 60) – Moderate Overlay



East Marginal Way from Tukwila Boulevard to Boeing Access Road (GISID 1423, PCI = 55) – Fair streets have similar characteristics to Marginal streets in that the distresses present tend to be localized and moderate in severity; however, the distresses will predominately be non-load related (i.e., caused by environmental or other factors). This street displays block cracking towards the middle of the pavement. There are moderate amounts of longitudinal and transverse cracking, with some cracks being deep but localized.

Like Marginal streets, Fair streets can provide a good cost/benefit ratio to an agency if addressed with an adequate rehabilitation technique. Stretching the application for surface treatments into this range can pose a cheap alternative to overlays but does not provide the appropriate renewal to the structural capacity of the pavement and may allow load related deterioration to continue unabated.

Good (PCI = 60 to 70) – Surface Treatments



Southcenter Parkway from Strander Boulevard to South 168th Street (GISID 1775, PCI = 66) – Rated as Good, the primary cause of deterioration for this street is the longitudinal and transverse cracking. The pavement surface could be restored with spot patching to remedy the more heavily distressed areas.

Preventive measures on streets considered Good can have a positive impact on the City's funding needs. While the expected life of a slurry seal is not as long as that of an overlay, its ability to slow deterioration and relatively low cost can free up funding for streets in worse condition.

Very Good (PCI = 70 to 85) – Surface Treatments and Localized Rehabilitation



Klickitat Drive from 51st Avenue to 53rd Avenue (GISID 1397, PCI = 77) – Rated as Very Good, this street displays minor amounts of longitudinal cracking. It is an example of a candidate for preventive maintenance to extend the life of the roadway.

Also, routine maintenance prevents water intrusion by sealing and slowing crack growth. By keeping water out of the base layers, the pavement life is extended without the need for heavier rehabilitations.

Excellent (PCI = 85 to 100)



Inerurban Avenue from 143rd Place to 144th Street (GISID 1424, PCI = 91) – Rated as Excellent, this pavement displays little to no surface distresses. The ride is smooth, and the surface and the base are intact. Excellent roads should be periodically assessed for crack development that would trigger routine maintenance activities.

4.3 City Network Condition Distribution

Figure 13 shows the distribution of pavement condition for the roadway network in Tukwila.

- Approximately ten percent (9.5%) of the network can be considered in *Excellent* condition and should be closely monitored to ensure timely application of early localized preventive measures.
- Approximately forty percent (39.5%) of the network falls into the PCI range considered *Very Good*. These are roads that benefit most from preventive maintenance techniques, such as spot patching and slurry seals.
- Twenty-three percent (23.3%) of the streets are rated as *Good* and may still be candidates for slurry seals or thin overlays.
- Approximately twenty-one percent (21.3%) of the network can be considered in *Fair* to *Marginal* condition and represents candidates for progressively thicker overlay-based rehabilitation. If left untreated, they will decline rapidly into reconstruction candidates.
- Less than six percent (6.4%) of the network is rated as *Poor* or *Very Poor*, meaning these roadways have deteriorated to the point where surface rehabilitation can no longer restore the pavement to a point of structural adequacy. Rehabilitation of the entire pavement structure is required for these segments.

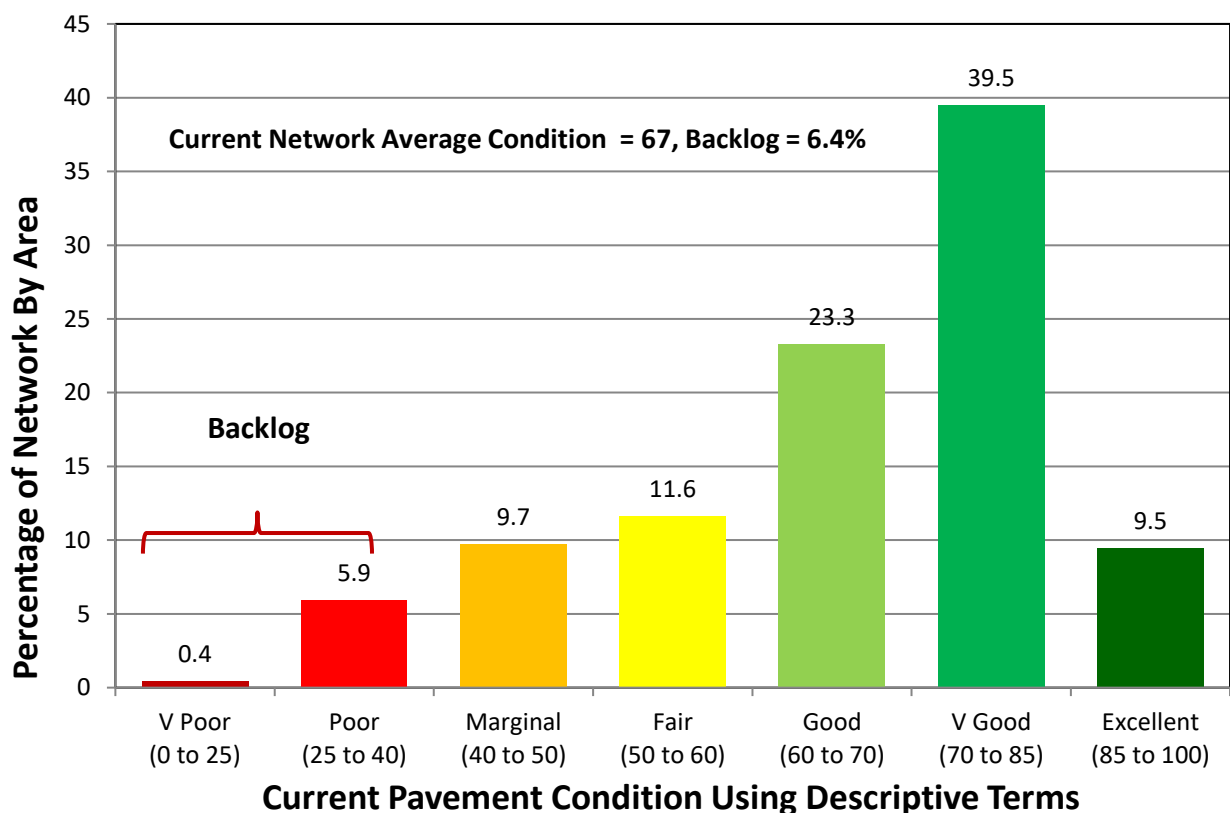


Figure 13 - Roadway Network Present Status Using Descriptive Terms

4.4 Condition By Functional Classification

Analyzing subsets of data in addition to the overall pavement condition can provide a better understanding of where an agency should focus its resources. **Figure 14** displays the distribution of pavement conditions for each functional class.

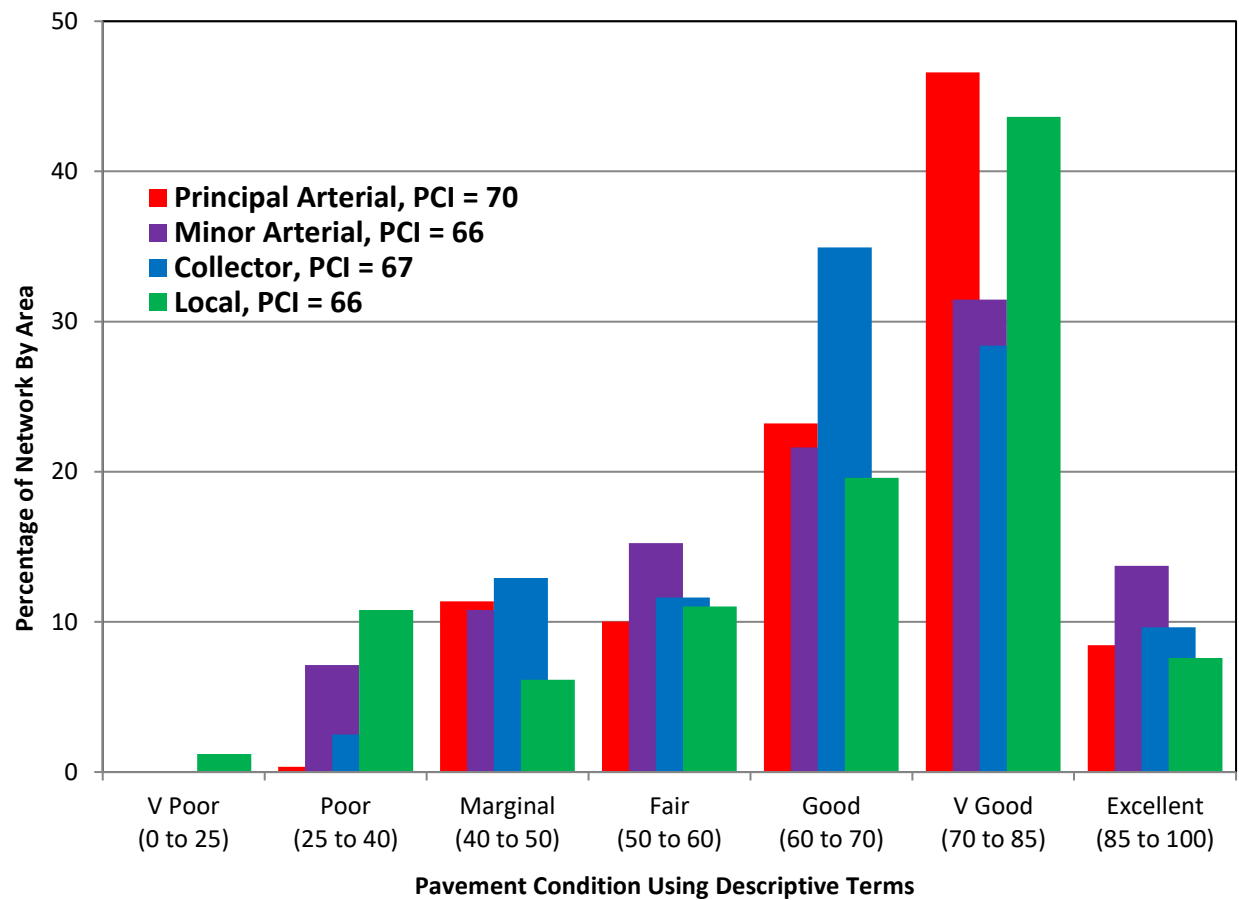


Figure 14 - Condition Rating by Functional Classification

When evaluating the condition of pavement based on the percentage of network it covers, the proportion of each class in the overall network must also be considered. This distribution is illustrated in **Figure 15**.

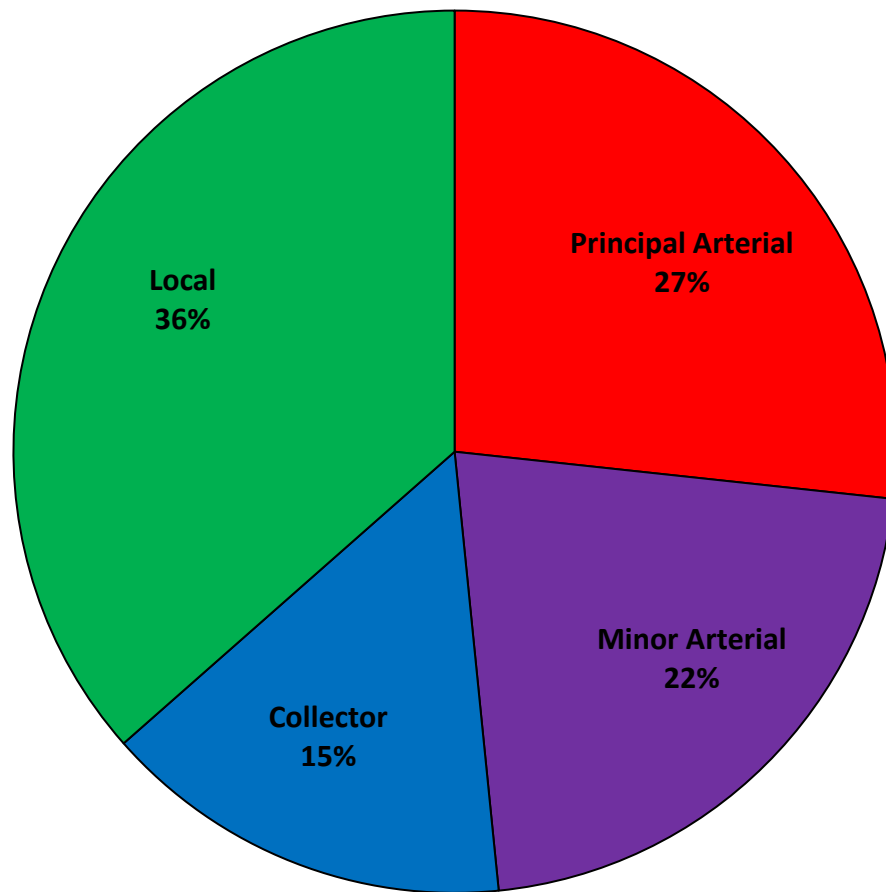


Figure 15 - Functional Classification Distribution By Area

4.5 Summary

Section 4.0 of the report provided a detailed analysis of the results obtained from the pavement condition survey conducted in the City of Tukwila. The section covered the functional classifications in the City and their respective PCI values, which were further illustrated with pavement photographs taken during the survey. Additionally, the section provided a breakdown of the pavement condition distribution for each functional class and pavement type. **Overall, the network average PCI for Tukwila was found to be 67 with a backlog of 6%.**

5.0 REHABILITATION PLAN & BUDGET DEVELOPMENT

This section discusses the results of the pavement management analysis that was performed using the ESA pavement management system, starting with an overview of the assumptions that were used when implementing the system, such as the unit rates and the selection methodology for rehabilitation candidates. The subsequent section, **5.2**, details the results of each of the various budget runs, along with their predicted conditions. This is highlighted further through a series of charts that are used to demonstrate the advantages and disadvantages of various funding models.

5.1 Key Analysis Set Points and Assumptions

Pavement management analysis requires user input to complete its condition forecasting and prioritization. A series of operating parameters were developed to create an efficient program that is tailored to the City's needs.

Selecting Segments for Rehabilitation

The selection of rehabilitation candidates through a worst-first approach or subjective committee input is neither efficient nor cost effective. It is important to establish a set of criteria and determine their importance in the selection process. ESA has defined commonly used criteria within the program that allows different weighting factors to be applied depending on the City's goals. This approach can lead to more objective and effective selection of rehabilitation candidates.

- **PCI** – As mentioned earlier in this section, the results of the pavement condition survey are used to generate a PCI that ranges from 0-100 where 0 is considered the worst and 100 the best. This factor can be given a higher weight to give greater priority to poor condition streets.
- **Cost of Deferral** – As time passes a pavement will deteriorate and require more costly repairs as it ages. ESA can be configured to prioritize streets nearing the point where this cost increase occurs.
- **Pavement Strength** – Through the use of deflection testing or the prevalence of LAD, the relative strength of a pavement can be determined. A prioritization factor can be applied that gives preference to streets that may deteriorate faster in order to apply more cost-effective rehabilitation early in the life cycle.
- **Pavement Type** – Depending on costs, design life, and the City's goals, a weighting factor can be applied based on the materials used to construct the pavement.
- **Functional Class** – Generally higher volume streets are given the greatest priority within a program since they serve the most vehicles.
- **Planned or Committed Projects** – When developing the rehabilitation plan, projects that are already scheduled to be completed are taken into consideration. This is done by adjusting the PCI scores to reflect the expected improvement resulting from these projects.

For the City, the weighting factors for these categories were established with the aim of maximizing the cost savings associated with the concept of deferred maintenance and addressing Weak pavements with lower PCI scores. The goal is to minimize the growth of the backlog.

Rehabilitation Strategies and Unit Rates

The funding requirements for the City are mainly determined by the rehabilitation strategies and unit rates used in the budget analysis. **Table 4** presents a breakdown of the costs associated with different pavement rehabilitation activities and their application. The table also suggests a recommended rehabilitation funding sequence based on the cost of deferral. A lower number in this column indicates a higher priority for rehabilitation based on the cost of deferral.

The parameters to consider when forming rehabilitation strategies include:

- **Rehab Activity** – This includes the assigned identifier and name of each rehabilitation strategy. Various degrees of slurry sealing are outlined to highlight the increasing cost associated with additional patching requirements for lower PCI streets.
- **Min, Max, and Critical PCI** – The PCI range for the application of a specific rehabilitation activity is determined by the Min and Max values that set the upper and lower limits, while the Critical PCI indicates the threshold at which rehabilitation becomes a higher priority to leverage the cost of deferral factor. There can be overlap in the PCI range to allow for further differentiation based on pavement strength.
- **Unit Rates** – The cost of rehabilitation is presented per square yard for each combination of pavement type, functional class, and rehabilitation activity. A base unit rate is set for the lowest assumed cost of a work type, and it is adjusted for each functional class to account for additional work such as traffic control, intersection improvements, landscaping, utility adjustments, and right-of-way (ROW) infrastructure. IMS worked closely with the City to determine rates that accurately represent the cost of work.

Table 4 – Rehabilitation Rates

Pavement Type		Critical PCI (Need Year)			Base Unit Rate	Principal Arterial Unit Rate	Minor Arterial Unit Rate	Collector Unit Rate	Local Unit Rate	
					(\$/yd2)	(\$/yd2)	(\$/yd2)	(\$/yd2)	(\$/yd2)	
Rehab Activity					Min PCI	Max PCI				
FunCL Rate Premium							110	108	105	103
All	Routine Maintenance	85	100	100	0.00	0.00	0.00	0.00	0.00	
Asphalt	Slurry Seal / Seal Coat	80	82	85	4.95	5.40	5.30	5.20	5.10	
Asphalt	MicroSurface / Chip Seal	70	73	80	7.37	8.00	8.00	7.75	7.50	
Asphalt	Edge Mill + Thin Overlay (1.5 - 2.0)	60	63	70	24.48	27.00	26.25	25.75	25.00	
Asphalt	EW/FWM + Moderate Overlay (2.0 - 3.0)	50	54	60	32.73	38.00	36.50	35.00	34.00	
Asphalt	FWM + Thick Overlay (> 2.0 - 3.0)	40	44	50	41.25	50.00	47.50	45.50	43.50	
Asphalt	Surf Recon + Base Rehab / FWM + Strctrl Pch + Olay	25	30	40	68.75	83.00	79.50	76.00	72.00	
Asphalt	ACP Full Depth Reconstruction	0	15	25	102.30	113.00	110.00	107.00	105.00	
Concrete	PCC Jnt Rehab & Crk Seal	80	82	100	9.63	10.50	10.25	10.00	9.75	
Concrete	PCC Localized Rehab	70	73	80	20.63	23.75	23.00	22.25	21.50	
Concrete	PCC Slight Pnl Rplcmnt (<10%)	60	63	70	42.35	51.00	49.00	46.50	44.50	
Concrete	PCC Moderate Pnl Rplcmnt (< 20%)	50	54	60	64.35	81.50	77.00	72.50	68.50	
Concrete	PCC Extensive Pnl Rplcmnt (<33%)	40	44	50	89.10	118.50	110.50	103.00	96.00	
Concrete	PCC Partial Reconstruction	25	30	40	119.90	152.00	144.00	135.00	128.00	
Concrete	PCC Full Depth Reconstruction	0	15	25	180.40	240.00	224.00	209.00	194.00	

5.2 Network Budget Analysis Models

The pavement management analysis using the ESA system involved combining the condition assessment, deterioration model, prioritization factors, and rehabilitation assignments to conduct a budget analysis. With this information, the program can predict the outcomes of different funding levels or suggest the funds necessary to achieve specific goals. To model network trends and estimate the funding levels needed to reach certain condition and distribution targets, IMS conducted an analysis using a series of budgets. The results of this analysis are detailed in this section.

Budget Targets

The following scenarios were generated to forecast the outcomes of the current estimated City budget compared to City's target PCI goals over the next five years. The models determine what level of funding may be appropriate going forward. The values for backlog and PCI have been rounded to the nearest whole number to improve legibility. Varying budget figures will have slightly different outcomes that are visible in the charts but may not be completely represented in the legend text.

Five-year Models:

- **Tukwila Budget** (Green Line) – This represents the City's current average annual budget of **\$1.4M/Yr.** dedicated to pavement preservation and rehabilitation. This level of funding will result in a network average PCI score of **63** and a backlog of around **11%** after five years.
- **Target PCI Driven** (Light-green Line) – The Target PCI model projects the anticipated annual investment needed to increase the average network PCI to **75** over 5 years. The level of funding needed to reach this goal is approximately **\$4.53M/Yr.** and will also reduce the backlog to **3%**.
- **Steady State PCI** (Red Line) – This is simply the funds required to maintain the current network average PCI at around **67**. The annual budget required to do so is approximately **\$2.65M/Yr.** Backlog will increase to **5%** of the network after five years.
- **PCI Control** (Purple Line) – The PCI Control model determines the funding required to maintain the PCI at a minimum level of **65**. This budget is **\$2M/Yr.** and will result in a backlog of **8%** after five years.
- **Backlog Control** (Purple Dashed Line) – The Backlog Control budget was developed in order to restrict the backlog at **10%**. The funding required to achieve this backlog goal is **\$1.62M/Yr.** and will also decrease the PCI to **64** after five years.

The results of the analysis are summarized in **Figure 16**. The x-axis highlights the annual budget, while the y-axis plots the five-year Post Rehab Network Average PCI values. The diagonal blue line is the network trend model developed to show estimated PCI along with a funding range up to \$4.6M/Yr.

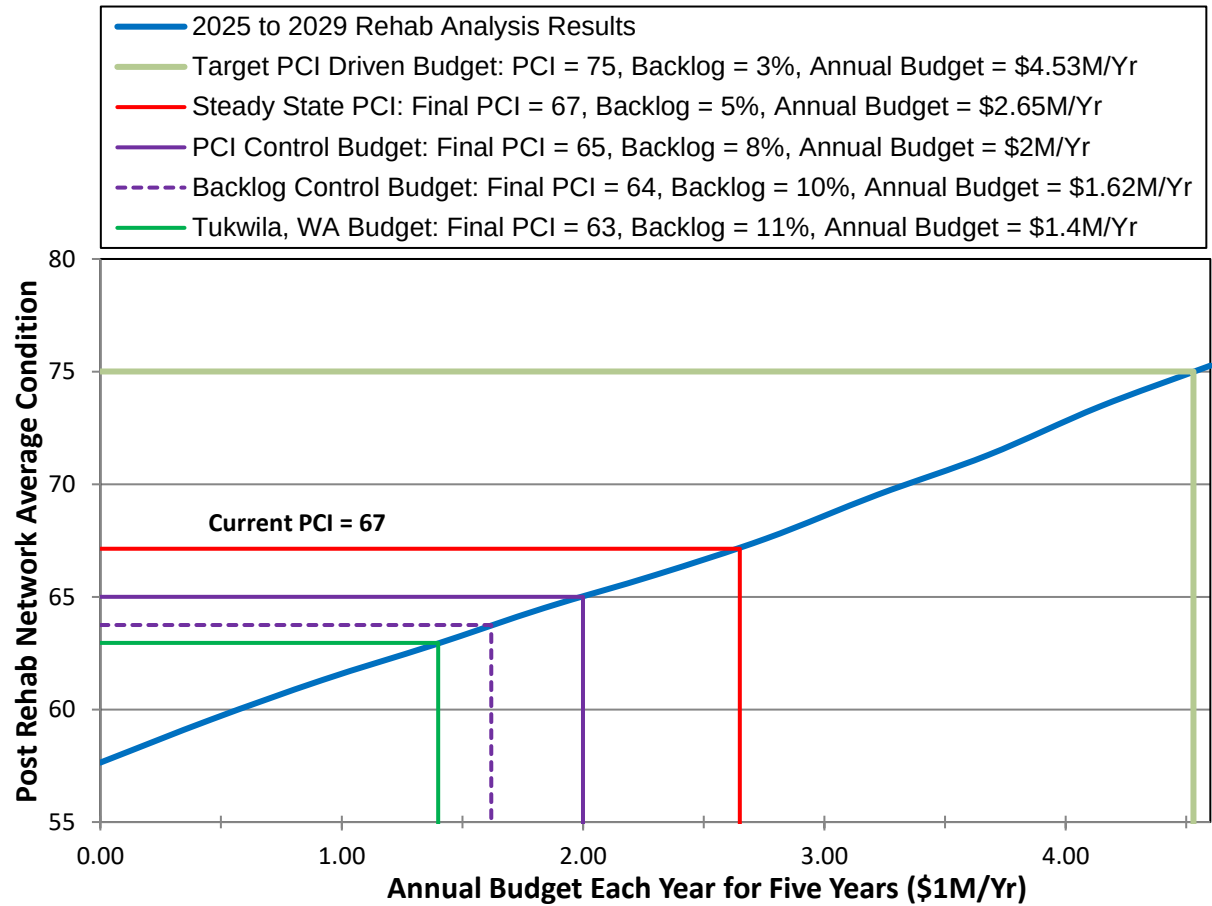


Figure 16 – Five-year Post Rehab Network PCI Analysis Results

Figure 17 presents the resultant network backlog against the annual budget. It is similar to **Figure 16**, but instead of plotting the average PCI score, it displays the total backlog after five years with a blue diagonal line. The City currently maintains a backlog of 6%. As the backlog grows, the funding required to return to the current level will increase.

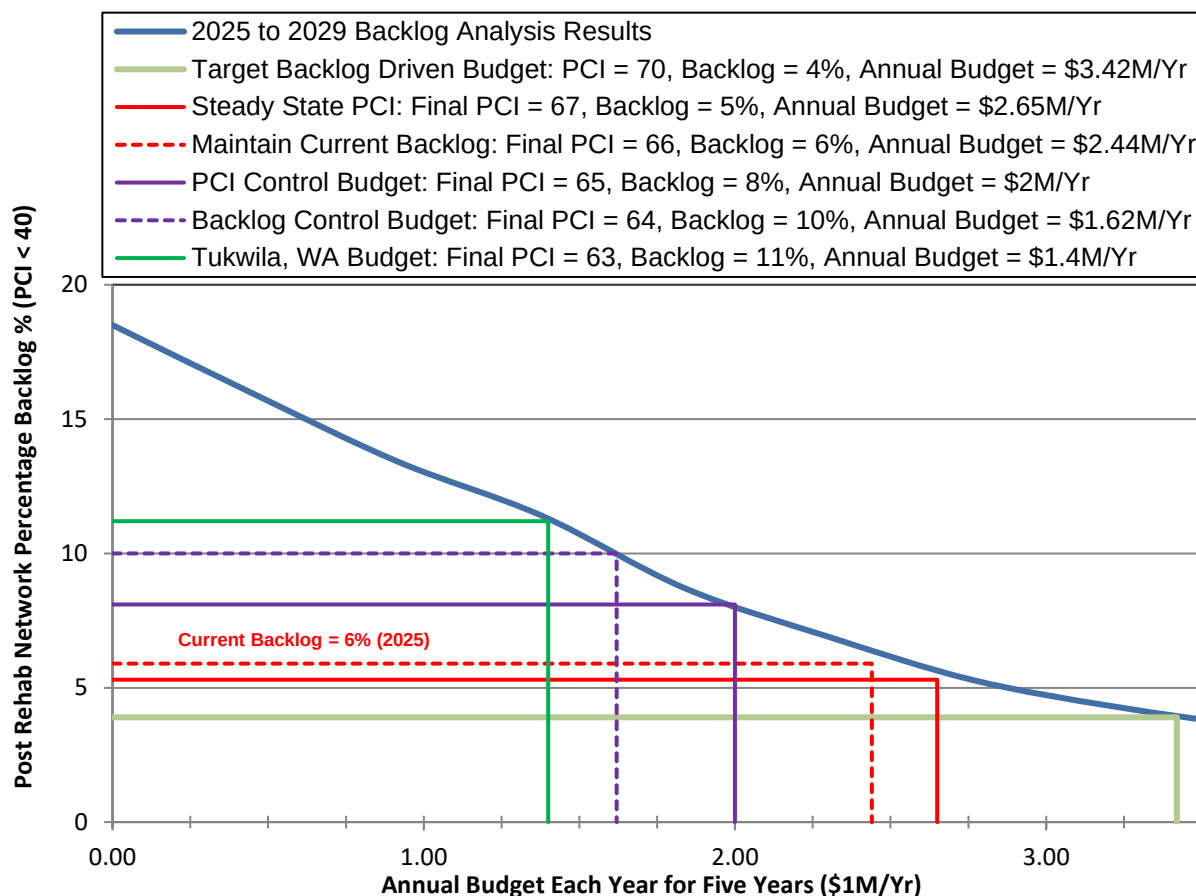


Figure 17 – Five-year Post Rehab Network Backlog Results

Figure 18 presents the analysis results on an annual basis. This shows that if the budget falls below \$2.65M/Yr. (Steady State PCI Budget), over time the overall condition of the roads is expected to deteriorate as the backlog grows.

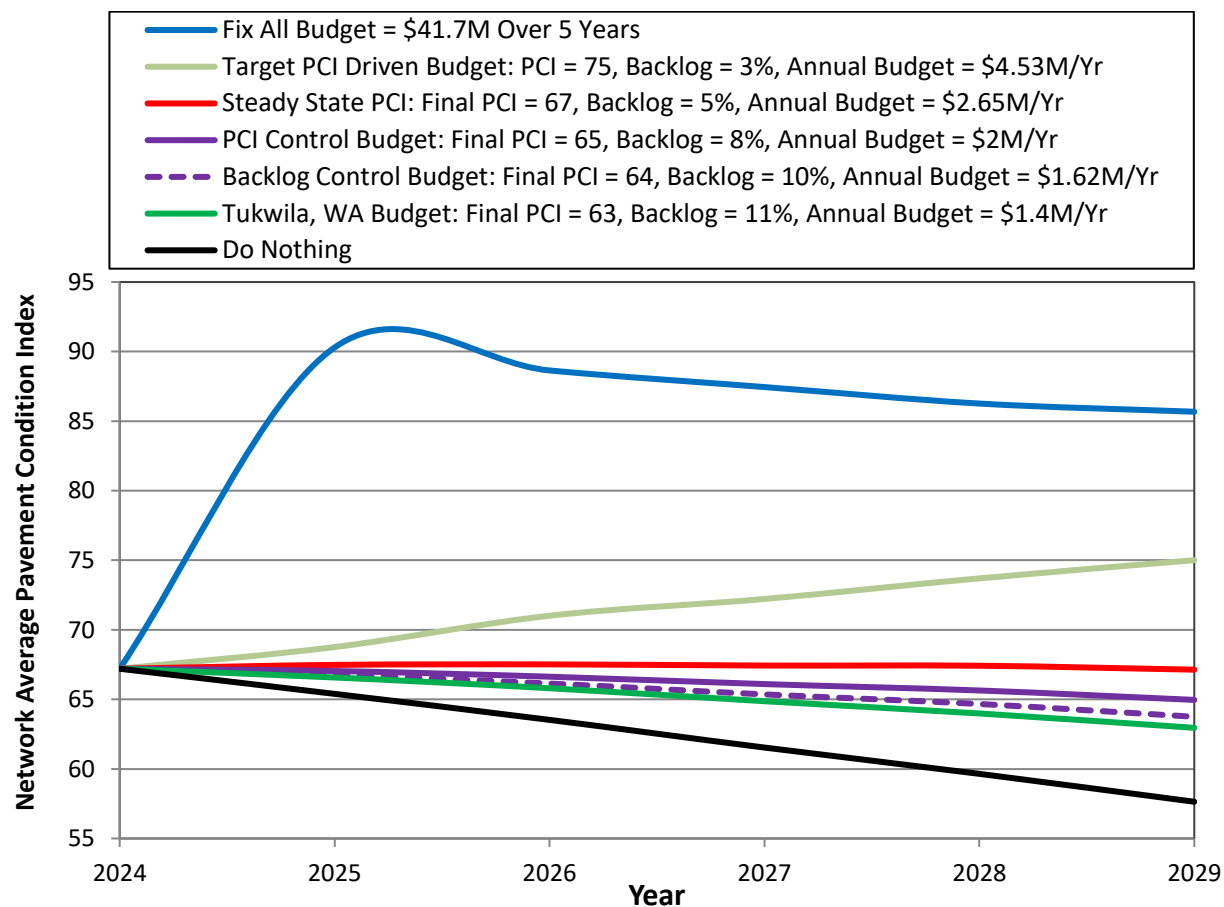


Figure 18 – Five-year Annual PCI

5.3 Post Rehabilitation Condition

Figure 19 compares the percentage of the City's network area separated into each pavement condition category for two scenarios: the current network average condition (shown in red) and the projected condition in five years with the City's budget (shown in blue). The analysis shows that if the City's current budget is maintained, the average PCI is expected to decrease to 63 by the end of the five-year analysis period, and the backlog is projected to increase to approximately 11%.

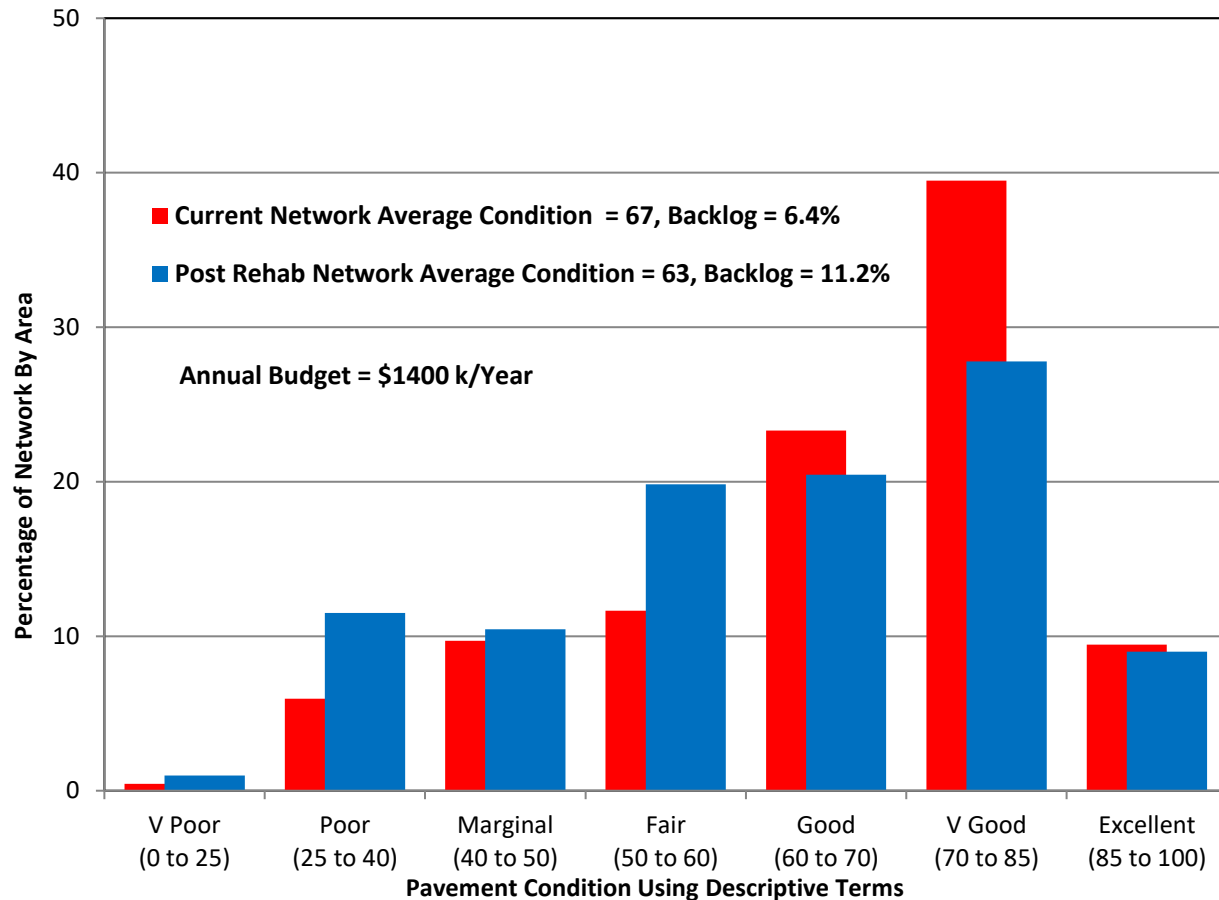


Figure 19 – Comparison of Pavement Condition (Current to 5-year Projection)

5.4 Summary

The pavement analysis models conducted using the ESA program showed that the current annual budget of \$1.4M for pavement management would result in a decrease in pavement condition over a period of five years, resulting in a five-year post rehab PCI of 63 and a backlog of 11%. Maintaining the current PCI level at 67 would require an annual budget of approximately \$2.65M and reduce the backlog to 5%.

6.0 PROJECT RECOMMENDATIONS & COMMENTS

6.1 Project Summary and Recommendations

A pavement condition survey was performed in July 2024 on the full City pavement network. The results of the condition survey were aggregated into the ESA pavement management system. This system facilitated the creation of a georeferenced pavement inventory, enabled the development of a precise model of the network's current condition and anticipated future deterioration, and provided recommendations for funding to meet various level-of-service goals.

The following broad recommendations are presented to the City as an output from the pavement analysis and must be read in conjunction with the previous sections.

- **The City should make efforts to keep the ESA spreadsheet up to date.**

By maintaining and updating the rehabilitation unit rates, work history of the segments, and accuracy of the inventory, the City will be able to reliably forecast funding needs for future years. This allows the City to be proactive in maintaining the condition of the pavement network at an acceptable level.

- **The City should periodically resurvey the pavement network.**

Pavement performance over time involves many variables, such as traffic volumes, environmental factors, maintenance timing, and design standards. As these variables change, the rate at which a pavement deteriorates will change with them. The periodic resurvey of pavement conditions allows the City to track these changes and update models accordingly, ensuring that appropriate rehabilitation measures are being planned.

- **The City should investigate new and additional rehabilitation activities.**

Advancements in pavement rehabilitation technology are constantly being made, and it is recommended that the City periodically update its planned rehabilitation activities in the ESA program to take advantage of these advances.

- **The City should strive to maintain or better its current condition if possible.**

Maintaining a pavement network in good condition is more cost-effective than restoring conditions after deterioration. The City's current pavement network has an overall PCI of 67 with a backlog value of 6%. If the current annual budget of \$1.4M is maintained, the models show the PCI will decrease to 63 and the backlog will hover around 11% after five years.

6.2 Closing

The IMS Team greatly appreciates the opportunity to work with the City on this pavement management update. Over the course of this project, the team has observed the City staff's dedication to offering the best possible service to their community. IMS stands ready to assist the City with training and technical support as necessary and welcomes the opportunity to work with the City on future pavement management projects.

Appendix A

Street Inventory and Condition Summary by Segment

City of Tukwila, WA
Street Inventory and Condition Summary - Sorted by Street Name



Street Inventory and Condition Summary - Sorted by Street Name										Condition Summary				
GISID	On Street	From Street	To Street	FunCL	Pavetype	Pavement Width (ft)	Pavement Length (ft)	Add Area (yd2)	Pavement Area (yd2)					
										Surface Distress Index (SDI)	Roughness Index (RI)	Structural Index (SI)	Condition Rating	Current Segment PCI (CPCI)
1810	16th Ave S	CITY LIMIT	CITY LIMIT	Principal Arterial	Concrete	54	892	268	5,621	90	63	60	V Good	80
1957	27th Ave S	S 102nd St	SOUTH END	Local	Asphalt	24	1,756	234	4,917	80	72	60	V Good	77
1792	32nd Ave S	S 135th St	S 136th St	Local	Asphalt	20	319	35	744	83	58	60	V Good	74
1791	32nd Ave S	S 137th St	SOUTH END	Local	Asphalt	20	135	15	315	85	62	60	V Good	77
1787	32nd Ave S	S 130th St	S 133rd St	Local	Asphalt	19	763	81	1,691	95	55	60	V Good	82
2013	32nd Ave S	S 133rd St	S 133rd Ln	Local	Asphalt	19	306	32	679	89	72	60	V Good	83
1786	32nd Ave S	S 136th St	S 137th St	Local	Asphalt	19	274	29	606	90	69	60	V Good	83
2011	32nd Ave S	S 133rd Ln	S 135th St	Local	Asphalt	19	345	36	766	87	82	60	Excellent	85
1446	33rd Ave S	S 130th St	S 132nd St	Local	Asphalt	19	755	80	1,674	69	56	60	Good	64
1447	33rd Ave S	S 140th St	34th Pl S	Local	Asphalt	19	993	105	2,202	92	70	60	V Good	84
1582	33rd Pl S	NW END	S 130th St	Local	Asphalt	20	326	36	760	56	46	60	Fair	52
1463	33rd Pl S	33rd Pl S	33rd Pl S	Local	Asphalt	19	130	14	289	99	11	80	Good	69
1474	33rd Pl S	S 140th St	S 141st St	Local	Asphalt	20	358	40	836	96	50	60	V Good	80
1205	34th Ave S	S 144th St	Military Rd S	Local	Asphalt	22	582	71	1,493	45	61	60	Fair	49
1208	34th Ave S	S 130th St	S 132nd St	Local	Asphalt	25	693	96	2,020	50	54	60	Fair	50
1207	34th Ave S	S 126th St	SOUTH END	Local	Asphalt	24	628	84	1,758	59	51	60	Fair	55
1204	34th Ave S	33rd Ave S	S 144th St	Local	Asphalt	29	511	82	1,730	87	61	60	V Good	78
1211	34th Ave S	S 132nd St	S 133rd St	Local	Asphalt	25	285	40	832	84	69	60	V Good	79
1206	34th Ave S	S 133rd St	S 135th St	Local	Asphalt	30	664	111	2,324	86	73	60	V Good	81
1203	34th Ave S	S 136th St	S 137th St	Local	Asphalt	28	286	44	933	88	69	60	V Good	82
1212	34th Ave S	S 137th St	S 140th St	Local	Asphalt	28	1,067	166	3,486	91	74	60	Excellent	85
1210	34th Ave S	S 135th St	S 136th St	Local	Asphalt	28	327	51	1,069	93	73	60	Excellent	86
1209	34th Pl S	S 141st St	33rd Ave S	Local	Asphalt	25	478	66	1,395	66	53	60	Good	61
1236	35th Ave S	S 133rd St	S 135th St	Local	Asphalt	32	663	118	2,475	31	47	60	Poor	36
1233	35th Ave S	S 146th St	SOUTH END	Local	Asphalt	30	294	49	1,029	42	50	60	Marginal	43
1099	35th Ave S	S 128th St	S 130th St	Local	Asphalt	21	636	74	1,559	50	42	60	Marginal	46
1730	35th Ave S	S 132nd St	S 133rd St	Local	Asphalt	32	441	78	1,648	62	45	60	Fair	56
1733	35th Ave S	S 126th St	S 128th St	Local	Asphalt	22	423	52	1,085	62	62	60	Good	61
1235	35th Ave S	S 140th St	S 142nd Pl	Local	Asphalt	29	833	134	2,819	84	57	60	V Good	75
1732	35th Ave S	S 124th St	S 126th St	Local	Asphalt	21	869	101	2,130	82	69	60	V Good	77
1234	35th Ave S	S 135th St	S 137th St	Local	Asphalt	28	592	92	1,934	94	69	60	Excellent	86
1741	35th Ln S	S 130th St	S 132nd St	Local	Asphalt	19	483	51	1,070	17	0	80	V Poor	11
1064	37th Ave S	S 128th St	S 130th St	Local	Asphalt	22	621	76	1,595	29	52	60	Poor	36
2008	37th Ave S	Tukwila Intl Blvd	S 135th St	Local	Asphalt	25	652	91	1,902	44	59	60	Marginal	48
1071	37th Ave S	S 135th St	S 137th St	Local	Asphalt	32	590	105	2,203	76	70	60	V Good	73
1066	37th Ave S	S 137th St	S 138th St	Local	Asphalt	32	321	57	1,200	77	68	60	V Good	73
1107	37th Ave S	S 126th St	S 128th St	Local	Asphalt	19	434	46	962	83	61	60	V Good	75
1072	37th Ave S	S 132nd St	SOUTH END	Local	Asphalt	30	347	58	1,214	91	51	60	V Good	78
1068	37th Ave S	S 138th St	S 140th St	Local	Asphalt	32	721	128	2,692	84	69	60	V Good	79
1065	37th Ave S	S 130th St	S 132nd St	Local	Asphalt	30	418	70	1,462	82	85	60	V Good	83
1069	37th Ave S	S 142nd St	S 142nd Pl	Local	Asphalt	26	156	23	473	92	70	60	V Good	84
1063	37th Ave S	S 141st St	S 142nd St	Local	Asphalt	24	461	61	1,290	96	72	60	Excellent	88
1067	37th Ave S	S 140th St	S 141st St	Local	Asphalt	32	230	41	858	97	73	60	Excellent	89

City of Tukwila, WA
Street Inventory and Condition Summary - Sorted by Street Name



GISID	On Street	From Street	To Street	FunCL	Pavetype	Pavement Width (ft)	Pavement Length (ft)	Add Area (yd2)	Pavement Area (yd2)	Condition Summary				
										Surface Distress Index (SDI)	Roughness Index (RI)	Structural Index (SI)	Condition Rating	Current Segment PCI (CPCI)
1070	37th Ave S	S 142nd Pl	S 144th St	Local	Asphalt	26	502	72	1,522	97	74	60	Excellent	89
1308	38th Ave S	S 130th St	SOUTH END	Local	Asphalt	22	603	74	1,547	31	72	30	Marginal	44
1309	38th Ave S	S 138th St	S 140th St	Local	Asphalt	30	632	105	2,213	92	66	60	V Good	82
2094	38th Ln S	S 130th St	SOUTH END	Local	Asphalt	24	169	23	474	75	49	80	Good	66
1006	38th Ln S	38th Ln S	38th Ln S	Local	Asphalt	19	162	17	360	90	20	80	Good	66
1918	38th Pl S	NORTH END	S 132nd Pl	Local	Asphalt	20	163	18	379	17	9	60	V Poor	14
1970	39th Ave S	S 116th St	S 117th St	Local	Asphalt	22	294	36	754	90	71	60	V Good	83
1842	40th Ave S	S 114th St	S 115th St	Local	Asphalt	19	310	33	686	21	18	80	V Poor	19
1379	40th Ave S	S 152nd St	Southcenter Blvd	Local	Asphalt	24	632	84	1,769	31	45	60	Poor	35
1143	40th Ave S	S 126th St	S 128th St	Local	Asphalt	25	317	44	924	65	43	60	Fair	56
1256	40th Ave S	Southcenter Blvd	S 154th Ln	Local	Asphalt	25	142	20	414	73	30	80	Fair	58
1825	40th Ave S	East Marginal Way S	S 132nd Pl	Collector	Asphalt	26	881	127	2,672	61	69	60	Good	63
1861	40th Ave S	Interurban Pl S	Interurban Ave S	Local	Asphalt	25	109	15	318	84	26	80	Good	64
2096	40th Ave S	S 132nd Pl	42nd Ave S	Collector	Asphalt	27	1,544	232	4,863	66	72	60	Good	67
1254	40th Ave S	S 154th Ln	DS@337S S 154th Ln	Local	Asphalt	25	337	47	983	96	42	60	V Good	78
1855	40th Ave S	S 117th Pl	Interurban Pl S	Local	Asphalt	24	480	64	1,345	85	70	60	V Good	79
1169	40th Ave S	NORTH END	S 116th Pl	Local	Asphalt	20	243	27	568	91	66	60	V Good	82
1831	40th Ave S	S 116th Pl	S 117th St	Local	Asphalt	24	202	27	565	92	71	60	V Good	84
1156	40th Ave S	S 117th St	S 117th Pl	Local	Asphalt	25	181	25	528	95	67	60	Excellent	85
1953	40th Pl S	NORTH END	S 119th St	Local	Asphalt	25	262	36	765	86	50	60	V Good	73
1178	41st Ave S	S 113th St	S 114th St	Local	Asphalt	26	240	35	729	69	23	80	Fair	53
1180	41st Ave S	S 130th St	S 131st Pl	Local	Asphalt	25	421	58	1,228	87	65	60	V Good	79
1181	41st Ave S	NORTH END	S 139th St	Local	Asphalt	24	588	78	1,646	90	67	60	V Good	82
1647	42nd Ave S	S 124th St	Macadam Rd S	Collector	Asphalt	28	1,063	165	3,473	32	63	30	Marginal	41
1517	42nd Ave S	S 115th St	S 116th St	Collector	Asphalt	34	152	29	604	52	59	80	Fair	53
1860	42nd Ave S	S 152nd St	Southcenter Blvd	Collector	Asphalt	29	349	56	1,180	62	65	60	Good	62
1515	42nd Ave S	S 144th St	S 146th St	Collector	Asphalt	31	666	115	2,408	63	70	60	Good	64
1859	42nd Ave S	S 151st St	S 152nd St	Collector	Asphalt	28	362	56	1,182	67	68	80	Good	66
1516	42nd Ave S	40th Ave S	S 139th St	Collector	Asphalt	25	794	110	2,315	65	74	60	Good	67
1521	42nd Ave S	S 116th St	Pedestrian Bridge S 119th St Access	Collector	Asphalt	35	1,145	223	4,677	66	76	60	Good	69
1163	42nd Ave S	S 146th St	S 148th St	Collector	Asphalt	32	661	118	2,469	65	79	60	Good	69
1523	42nd Ave S	S 150th St	S 151st St	Collector	Asphalt	29	305	49	1,031	72	67	60	V Good	70
1389	42nd Ave S	S 148th St	S 150th St	Collector	Asphalt	28	661	103	2,160	67	78	60	V Good	70
1648	42nd Ave S	Southcenter Blvd	S 158th St	Collector	Asphalt	28	1,648	256	5,383	73	69	60	V Good	71
1179	42nd Ave S	S 126th St	SE END	Local	Asphalt	25	164	23	478	81	56	60	V Good	72
1195	42nd Ave S	S 122nd St	S 124th St	Collector	Asphalt	25	713	99	2,079	74	74	60	V Good	74
1663	42nd Ave S	S 142nd St	S 144th St	Collector	Asphalt	31	646	111	2,337	81	69	60	V Good	77
1557	42nd Ave S	Pedestrian Bridge S 119th St Access	S 122nd St	Collector	Asphalt	25	987	137	2,879	78	80	60	V Good	78
1639	42nd Ave S	S 158th St	S 160th St	Collector	Asphalt	29	654	105	2,211	86	67	60	V Good	79
1388	42nd Ave S	S 140th St	S 141st St	Collector	Asphalt	30	318	53	1,113	89	64	60	V Good	80
1196	42nd Ave S	S 139th St	S 140th St	Collector	Asphalt	26	281	41	852	91	70	60	V Good	84
1530	42nd Ave S	S 141st St	S 142nd St	Collector	Asphalt	30	362	60	1,268	95	62	60	V Good	84
1524	42nd Ave S	S 139th St	S 139th St	Collector	Asphalt	32	41	7	153	97	61	60	Excellent	84

City of Tukwila, WA
Street Inventory and Condition Summary - Sorted by Street Name



GISID	On Street	From Street	To Street	FunCL	Pavetype	Pavement Width (ft)	Pavement Length (ft)	Add Area (yd2)	Pavement Area (yd2)	Condition Summary				
										Surface Distress Index (SDI)	Roughness Index (RI)	Structural Index (SI)	Condition Rating	Current Segment PCI (CPCI)
1519	42nd Ave S	S 140th St	S 140th St	Collector	Asphalt	28	38	6	123	99	69	60	Excellent	88
1963	43rd Ave S	S 140th St	S 142nd St	Local	Asphalt	27	671	101	2,113	63	47	60	Fair	57
1962	43rd Ave S	Macadam Rd S	SOUTH END	Local	Asphalt	26	814	118	2,468	66	52	60	Good	61
1961	43rd Ave S	NORTH END	S 160th St	Local	Asphalt	29	352	57	1,191	73	41	60	Good	62
1964	43rd Ave S	S 122nd St	S 124th St	Local	Asphalt	25	713	99	2,078	73	86	60	V Good	77
1972	43rd PI S	S 137th St	S 137th PI	Local	Asphalt	23	375	48	1,005	85	49	60	V Good	72
1748	43rd PI S	S 116th St	44th Ave S	Local	Asphalt	30	340	57	1,189	94	59	60	V Good	82
1795	44th Ave S	S 131st PI	S 133rd St	Local	Asphalt	23	293	37	787	55	55	60	Fair	54
1788	44th Ave S	S 137th St	S 139th St	Local	Asphalt	19	641	68	1,421	62	51	80	Fair	58
1790	44th Ave S	S 140th St	S 142nd St	Local	Asphalt	19	650	69	1,440	70	67	60	Good	69
1796	44th Ave S	43rd PI S	S 118th St	Local	Asphalt	19	535	56	1,185	72	71	60	V Good	71
1793	44th Ave S	S 118th St	S 122nd St	Local	Asphalt	20	1,407	156	3,284	72	72	60	V Good	71
1789	44th Ave S	S 122nd St	S 124th St	Local	Asphalt	23	710	91	1,904	79	74	60	V Good	77
2021	44th Ave S	S 156th St	S 158th St	Local	Asphalt	19	475	50	1,052	90	64	60	V Good	81
1260	44th PI S	S 118th St	46th Ave S	Local	Asphalt	19	705	74	1,562	82	64	60	V Good	76
1266	44th PI S	46th Ave S	S 122nd St	Local	Asphalt	19	1,145	121	2,538	83	66	60	V Good	77
1399	45th Ave S	S 137th St	S 139th St	Local	Asphalt	26	766	111	2,324	58	44	60	Fair	52
1247	45th Ave S	S 139th St	S 140th St	Local	Asphalt	23	209	27	560	63	41	80	Fair	55
1897	45th Ave S	S 122nd St	S 124th St	Local	Asphalt	26	711	103	2,157	79	64	60	V Good	74
1217	45th PI S	45th PI S	DS@65S 45th PI S	Local	Asphalt	26	65	9	198	94	0	80	Good	62
1231	45th PI S	DS@65S 45th PI S	45th PI S	Local	Asphalt	25	60	8	174	75	39	80	Good	63
1232	45th PI S	S 163rd PI	SOUTH END	Local	Asphalt	25	150	21	437	74	52	60	Good	66
1230	45th PI S	S 136th St	S 137th St	Local	Asphalt	24	277	37	776	84	49	60	V Good	72
1782	46th Ave S	S 146th St	S 148th St	Local	Asphalt	20	659	73	1,538	30	51	60	Poor	36
1277	46th Ave S	S 148th St	SOUTH END	Local	Asphalt	19	220	23	487	34	53	30	Marginal	39
1781	46th Ave S	S 144th St	S 146th St	Local	Asphalt	20	666	74	1,554	48	50	60	Marginal	47
1836	46th Ave S	S 160th St	S 162nd St	Local	Asphalt	21	603	70	1,477	59	43	60	Fair	52
1914	46th Ave S	S 163rd PI	S 162nd St	Local	Asphalt	25	132	18	384	76	29	80	Good	59
1276	46th Ave S	NORTH END	S 150th St	Local	Asphalt	19	304	32	674	73	49	80	Good	65
1783	46th Ave S	S 122nd St	S 124th St	Local	Asphalt	23	712	91	1,911	80	56	60	V Good	72
1275	46th Ave S	44th PI S	S 122nd St	Local	Asphalt	21	870	102	2,132	83	77	60	V Good	81
1274	46th Ave S	S 124th St	S 125th St	Local	Asphalt	24	176	23	493	90	71	60	V Good	83
1832	47th Ave S	S Ryan Way	S 109th St	Local	Asphalt	22	642	79	1,649	20	48	60	Poor	28
1383	47th Ave S	NE END	S 134th PI	Local	Asphalt	25	292	41	851	38	24	80	Poor	32
1385	47th Ave S	S 104th PI	S 107th St	Local	Asphalt	22	744	91	1,908	34	49	60	Poor	38
1846	47th Ave S	S 160th St	S 162nd St	Local	Asphalt	25	608	84	1,774	56	43	60	Fair	51
1828	47th Ave S	CITY LIMIT	S 104th PI	Local	Asphalt	21	229	27	560	51	62	60	Fair	54
1142	47th Ave S	S 156th St	S 158th St	Local	Asphalt	26	510	74	1,547	76	65	60	V Good	72
1840	47th Ave S	S 158th St	SOUTH END	Local	Asphalt	24	579	77	1,621	86	57	60	V Good	76
1856	47th Ave S	S 122nd St	S 124th St	Local	Asphalt	21	713	83	1,747	83	72	60	V Good	79
1448	48th Ave S	S 162nd St	SOUTH END	Local	Asphalt	19	165	17	366	43	7	80	Poor	30
1452	48th Ave S	S 160th St	S 162nd St	Local	Asphalt	19	601	63	1,332	65	50	80	Good	59
1453	48th Ave S	NORTH END	S 109th St	Local	Asphalt	19	308	33	684	60	74	30	Good	64

City of Tukwila, WA
Street Inventory and Condition Summary - Sorted by Street Name



GISID	On Street	From Street	To Street	FunCL	Pavetype	Pavement Width (ft)	Pavement Length (ft)	Add Area (yd2)	Pavement Area (yd2)	Condition Summary				
										Surface Distress Index (SDI)	Roughness Index (RI)	Structural Index (SI)	Condition Rating	Current Segment PCI (CPCI)
1109	48th Ave S	NE END	S 134th Pl	Local	Asphalt	23	118	15	317	79	48	60	Good	68
1451	48th Ave S	S 122nd St	S 124th St	Local	Asphalt	19	714	75	1,583	74	62	60	Good	69
1110	48th Ave S	NE END	Interurban Ave S	Local	Asphalt	25	2,049	285	5,975	75	70	60	V Good	73
1111	48th Ave S	S 134th Pl	48th Pl S	Local	Asphalt	19	222	23	492	86	50	60	V Good	73
1449	48th Ave S	48th Pl S	Macadam Rd S	Local	Asphalt	19	437	46	968	86	65	60	V Good	78
1050	48th Pl S	48th Pl S	DS@85N 48th Pl S	Local	Asphalt	25	85	12	247	69	0	80	Marginal	45
1049	48th Pl S	DS@85N 48th Pl S	48th Pl S	Local	Asphalt	24	89	12	248	80	13	80	Fair	57
1047	48th Pl S	S 145th St	NW END	Local	Asphalt	24	191	25	534	85	33	80	Good	67
1051	48th Pl S	48th Ave S	S 136th St	Local	Asphalt	19	291	31	645	90	47	60	V Good	76
1048	48th Pl S	S 146th St	S 145th St	Local	Asphalt	19	240	25	532	88	63	60	V Good	79
1666	49th Ave S	NORTH END	S 164th St	Local	Asphalt	27	405	61	1,276	50	35	80	Marginal	44
1667	49th Ave S	S 122nd St	S 124th St	Local	Asphalt	26	714	103	2,166	82	69	60	V Good	77
1699	49th Ave S	S 107th St	S 114th St	Local	Asphalt	25	2,254	313	6,574	94	70	60	Excellent	86
1808	50th Ave S	NORTH END	S 112th St	Local	Asphalt	19	273	29	605	78	60	60	V Good	71
1809	50th Ave S	51st Pl S	S 122nd Ln	Local	Asphalt	20	499	55	1,165	89	54	60	V Good	76
1146	50th Pl S	S 125th St	S 130th Pl	Collector	Asphalt	35	977	190	3,989	23	61	60	Poor	34
1386	50th Pl S	S 124th St	S 125th St	Collector	Asphalt	35	257	50	1,051	43	61	60	Marginal	47
2058	51st Ave S	SR 518 Ramp	I-5 Ramp	Minor Arterial	Asphalt	30	279	46	976	36	67	60	Marginal	45
1044	51st Ave S	S 144th St	S 151st St	Collector	Asphalt	35	2,319	451	9,469	41	61	60	Marginal	46
1951	51st Ave S	S 151st St	S 152nd St	Collector	Asphalt	35	329	64	1,344	50	91	30	Good	63
1200	51st Ave S	S 139th St	SOUTH END	Local	Asphalt	21	487	57	1,193	69	54	60	Good	64
1046	51st Ave S	NORTH END	S 159th St	Local	Asphalt	25	424	59	1,236	69	55	80	Good	64
1045	51st Ave S	S 160th St	S 161st St	Collector	Asphalt	35	284	55	1,158	70	64	60	Good	67
1201	51st Ave S	S 163rd Pl	S 164th St	Collector	Asphalt	35	200	39	817	76	74	60	V Good	75
1949	51st Ave S	S 161st St	S 163rd Pl	Collector	Asphalt	35	702	137	2,867	76	80	60	V Good	77
1952	51st Ave S	S 152nd St	Southcenter Blvd	Collector	Asphalt	34	569	108	2,258	76	81	60	V Good	77
1202	51st Ave S	S 164th St	S 166th St	Collector	Asphalt	35	621	121	2,535	78	79	60	V Good	78
1950	51st Ave S	NORTH END	S 138th St	Local	Asphalt	22	722	88	1,852	91	77	60	Excellent	86
1199	51st Ave S	S 138th St	S 139th St	Local	Asphalt	20	338	38	789	100	60	60	Excellent	86
2051	51st Ave S	SR 518	SR 518 Ramp	Minor Arterial	Concrete	30	192	32	673	100	67	60	Excellent	89
1653	51st Ave S	Southcenter Blvd	SR 518 Ramp	Minor Arterial	Concrete	30	291	48	1,017	100	71	60	Excellent	90
2099	51st Pl S	S 122nd Ln	S 124th St	Local	Asphalt	20	128	14	300	56	66	60	Fair	58
1060	51st Pl S	S 124th St	SE END	Local	Asphalt	20	815	91	1,903	80	65	60	V Good	75
1670	51st Pl S	50th Ave S	S 122nd Ln	Local	Asphalt	20	586	65	1,367	84	63	60	V Good	76
1700	51st Pl S	S 122nd St	50th Ave S	Local	Asphalt	20	199	22	464	87	58	60	V Good	77
1325	52nd Ave S	NORTH END	S 142nd St	Local	Asphalt	22	269	33	692	64	32	80	Fair	52
1324	52nd Ave S	53rd Ave S	S 136th St	Local	Asphalt	22	268	33	687	72	59	60	Good	67
1331	52nd Ave S	S 136th St	S 137th St	Local	Asphalt	22	294	36	756	77	49	60	Good	67
1326	52nd Ave S	Interurban Ave S	53rd Ave S	Local	Asphalt	20	288	32	673	94	37	60	V Good	75
1329	52nd Ave S	NORTH END	S 164th St	Local	Asphalt	21	173	20	424	86	59	60	V Good	77
1327	52nd Ave S	S 151st St	Southcenter Blvd	Local	Asphalt	21	914	107	2,240	84	67	60	V Good	78
1328	52nd Ave S	S 137th St	S 138th St	Local	Asphalt	22	261	32	669	93	53	60	V Good	79
1330	52nd Ave S	S 142nd St	SOUTH END	Local	Asphalt	22	333	41	856	97	67	60	Excellent	87

City of Tukwila, WA
Street Inventory and Condition Summary - Sorted by Street Name



GISID	On Street	From Street	To Street	FunCL	Pavetype	Pavement Width (ft)	Pavement Length (ft)	Add Area (yd2)	Pavement Area (yd2)	Condition Summary				
										Surface Distress Index (SDI)	Roughness Index (RI)	Structural Index (SI)	Condition Rating	Current Segment PCI (CPCI)
1594	52nd Pl S	52nd Ave S	S 137th St	Local	Asphalt	21	261	31	641	69	70	60	Good	69
1113	53rd Ave S	S 170th St	S 172nd Ln	Local	Asphalt	22	863	105	2,215	45	56	60	Marginal	47
1112	53rd Ave S	Klickitat Dr	S 159th St	Collector	Asphalt	27	519	78	1,635	62	73	60	Good	65
1114	53rd Ave S	S 159th St	S 160th St	Collector	Asphalt	28	552	86	1,802	66	70	60	Good	66
1116	53rd Ave S	S 166th St	S 170th St	Local	Asphalt	22	1,112	136	2,854	70	68	60	Good	68
2163	53rd Ave S	Southcenter Blvd	DS@355S Southcenter Blvd	Local	Asphalt	22	355	43	912	76	72	60	V Good	74
1890	53rd Ave S	S 139th St	S 140th St	Collector	Asphalt	35	303	59	1,237	94	63	60	V Good	83
1174	53rd Ave S	S 140th St	S 142nd St	Collector	Asphalt	34	621	117	2,464	89	75	60	V Good	84
1891	53rd Ave S	S 142nd St	S 144th St	Collector	Asphalt	33	787	144	3,028	90	77	60	Excellent	85
1115	53rd Ave S	52nd Ave S	S 136th St	Local	Asphalt	21	274	32	672	100	57	60	Excellent	85
1117	53rd Ave S	S 137th St	S 139th St	Collector	Asphalt	35	484	94	1,977	96	73	60	Excellent	87
1889	53rd Ave S	S 136th St	S 137th St	Local	Asphalt	21	213	25	522	95	100	60	Excellent	95
1684	53rd Pl S	53rd Pl S SPUR	53rd Pl S SPUR	Local	Asphalt	36	48	10	200	33	46	60	Poor	37
1250	53rd Pl S	53rd Pl S	53rd Pl S	Local	Asphalt	21	151	18	371	59	22	80	Marginal	45
1736	53rd Pl S	Slade Way	53rd Pl S SPUR	Local	Asphalt	22	410	50	1,053	74	57	60	Good	68
1683	53rd Pl S	53rd Pl S SPUR	SW END	Local	Asphalt	21	168	20	413	87	59	60	V Good	77
1971	53rd Pl S SPUR	53rd Pl S	53rd Pl S	Local	Asphalt	21	176	20	430	77	20	80	Fair	58
1487	54th Ave S	Slade Way	S 166th St	Local	Asphalt	22	965	118	2,477	91	55	60	V Good	78
1475	55th Ave S	S 140th St	S 144th St	Local	Asphalt	20	1,418	158	3,308	37	48	60	Marginal	40
1411	56th Ave S	S 139th St	S 141st St	Local	Asphalt	20	712	79	1,662	55	47	60	Fair	51
1408	56th Ave S	S 137th St	56th Pl S	Local	Asphalt	20	761	85	1,776	57	71	60	Good	61
1407	56th Ave S	S 130th Pl	S 133rd St	Local	Asphalt	20	784	87	1,829	75	57	60	Good	68
1410	56th Ave S	S 141st St	S 144th St	Local	Asphalt	21	1,048	122	2,568	77	57	60	V Good	69
1409	56th Ave S	S 133rd St	Interurban Ave S	Local	Asphalt	20	1,195	133	2,789	79	55	60	V Good	71
1406	56th Ave S	S 144th St	S 147th St	Local	Asphalt	21	1,016	119	2,489	83	56	60	V Good	73
1992	56th Ave S	56th Pl S	S 141st St	Local	Asphalt	21	768	90	1,882	86	52	60	V Good	75
1403	57th Ave S	S 144th St	S 147th St	Local	Asphalt	23	975	125	2,617	14	60	60	Poor	29
1568	57th Ave S	S 141st St	S 142nd St	Local	Asphalt	22	319	39	819	33	59	60	Marginal	41
1566	57th Ave S	S 150th Pl	SOUTH END	Local	Asphalt	23	232	30	622	41	50	60	Marginal	43
1571	57th Ave S	S 152nd St	S 152nd Pl	Local	Asphalt	23	320	41	859	49	50	60	Marginal	48
2162	57th Ave S	SW END	Interurban Ave S	Local	Asphalt	22	199	24	512	69	28	80	Fair	55
1402	57th Ave S	S 142nd St	S 144th St	Local	Asphalt	22	668	82	1,716	55	67	60	Fair	59
1570	57th Ave S	Pamela Dr	S 133rd St	Local	Asphalt	21	335	39	820	80	60	60	V Good	73
1567	57th Ave S	S 149th St	S 150th Pl	Local	Asphalt	23	533	68	1,429	84	54	60	V Good	74
1569	57th Ave S	S 130th Pl	Pamela Dr	Local	Asphalt	21	378	44	927	80	66	60	V Good	75
1572	57th Ave S	S 147th St	S 149th St	Local	Asphalt	23	518	66	1,389	95	69	60	Excellent	86
1227	58th Ave S	59th Ave S	S 144th St	Collector	Asphalt	35	668	130	2,726	65	69	60	Good	65
1226	58th Ave S	Interurban Ave S	59th Ave S	Collector	Asphalt	35	577	112	2,354	77	51	60	Good	68
1224	58th Ave S	S 144th St	S 147th St	Collector	Asphalt	35	975	190	3,981	70	71	60	V Good	70
1362	59th Aly S	S 147th St	SOUTH END	Local	Asphalt	19	643	68	1,426	38	31	60	Poor	35
1644	59th Ave S	S 144th St	S 147th St	Local	Asphalt	21	997	116	2,442	60	46	60	Fair	55
1738	59th Ave S	S 142nd St	S 144th St	Local	Asphalt	20	928	103	2,165	64	50	60	Fair	58
1824	59th Ave S	S 147th St	S 149th St	Local	Asphalt	22	611	75	1,567	82	66	60	V Good	77

City of Tukwila, WA
Street Inventory and Condition Summary - Sorted by Street Name



GISID	On Street	From Street	To Street	FunCL	Pavetype	Pavement Width (ft)	Pavement Length (ft)	Add Area (yd2)	Pavement Area (yd2)	Condition Summary				
										Surface Distress Index (SDI)	Roughness Index (RI)	Structural Index (SI)	Condition Rating	Current Segment PCI (CPCI)
1969	61st Ave S	Southcenter Blvd	Tukwila Pkwy	Minor Arterial	Asphalt	40	587	130	2,738	15	59	30	Poor	28
1004	62nd Ave S	S 151st St	DS@131S S 151st St	Local	Asphalt	20	131	15	305	6	37	60	V Poor	16
1093	62nd Ave S	S 149th St	S 149th Pl	Collector	Asphalt	35	278	54	1,136	70	62	60	Good	66
1094	62nd Ave S	S 149th Pl	S 151st St	Collector	Asphalt	34	416	79	1,652	66	71	60	Good	67
1096	62nd Ave S	S 153rd St	Sunwood Blvd	Local	Asphalt	20	158	18	369	80	47	80	Good	68
1091	62nd Ave S	Sunwood Blvd	Southcenter Blvd	Local	Asphalt	20	750	83	1,749	77	52	60	Good	68
1095	62nd Ave S	59th Ave S	S 149th St	Collector	Asphalt	33	816	150	3,140	69	71	60	Good	69
1558	63rd Pl S	S 151st St	S 151st Pl	Local	Asphalt	22	174	21	447	81	66	60	V Good	76
1216	64th Ave S	S 153rd St	SOUTH END	Local	Asphalt	22	321	39	825	81	65	60	V Good	75
1040	65th Ave S	S 153rd St	Southcenter Blvd	Collector	Asphalt	35	951	185	3,885	61	63	60	Good	61
1041	65th Ave S	S 151st St	S 153rd St	Collector	Asphalt	35	916	178	3,738	76	72	60	V Good	74
1198	65th Ave S	S 153rd St	S 153rd St	Collector	Asphalt	34	128	24	506	84	69	60	V Good	78
1955	66th Ave S	Southcenter Blvd	I-405 Ramp	Minor Arterial	Concrete	35	246	48	1,003	100	53	60	V Good	84
1651	Airport Way S	DS@581E Boeing Access Rd	Boeing Access Rd	Minor Arterial	Asphalt	32	641	114	2,392	9	67	60	Poor	27
1640	Airport Way S	Boeing Access Rd	Airport Way S	Minor Arterial	Asphalt	32	625	111	2,334	20	61	60	Poor	33
1641	Airport Way S	DS@355S CITY LIMIT	Boeing Access Rd	Minor Arterial	Asphalt	30	584	97	2,044	56	60	60	Fair	56
1514	Airport Way S	CITY LIMIT	Boeing Access Rd	Minor Arterial	Asphalt	30	1,068	178	3,737	53	71	60	Fair	58
1848	Airport Way S	Airport Way S	Boeing Access Rd	Minor Arterial	Concrete	30	982	164	3,436	84	67	60	V Good	78
1560	Airport Way S	Boeing Access Rd	DS@581E Boeing Access Rd	Minor Arterial	Concrete	32	581	103	2,168	88	65	60	V Good	80
1166	Airport Way S	CITY LIMIT	DS@355S CITY LIMIT	Principal Arterial	Concrete	44	355	87	1,824	85	70	60	V Good	80
1713	Andover Park E	Costco Dr	S 180th St	Minor Arterial	Asphalt	32	1,022	182	3,816	56	75	60	Good	62
1710	Andover Park E	Strander Blvd	Treck Dr	Minor Arterial	Asphalt	30	715	119	2,504	68	61	60	Good	65
1712	Andover Park E	Evans Black Dr	Baker Blvd	Minor Arterial	Asphalt	30	465	78	1,628	69	67	60	Good	67
1711	Andover Park E	Treck Dr	Minkler Blvd	Minor Arterial	Asphalt	32	1,934	344	7,221	68	75	60	V Good	69
1714	Andover Park E	Minkler Blvd	Costco Dr	Minor Arterial	Asphalt	32	1,473	262	5,499	71	81	60	V Good	74
1708	Andover Park E	Baker Blvd	Strander Blvd	Minor Arterial	Asphalt	30	876	146	3,067	81	63	60	V Good	74
1709	Andover Park E	Tukwila Pkwy	Evans Black Dr	Minor Arterial	Asphalt	30	782	130	2,738	81	70	60	V Good	77
1901	Andover Park W	Strander Blvd	Corporate Dr N	Minor Arterial	Asphalt	33	1,852	340	7,132	42	62	60	Marginal	47
1240	Andover Park W	Corporate Dr N	Corporate Dr S	Minor Arterial	Asphalt	33	518	95	1,993	46	62	60	Fair	50
1983	Andover Park W	Corporate Dr S	Minkler Blvd	Minor Arterial	Asphalt	33	235	43	903	54	60	60	Fair	55
1237	Andover Park W	Upland Dr	Midland Dr	Collector	Asphalt	35	756	147	3,087	54	73	60	Good	60
1980	Andover Park W	Minkler Blvd	Upland Dr	Minor Arterial	Asphalt	33	421	77	1,622	62	61	60	Good	61
1979	Andover Park W	Minkler Blvd	Minkler Blvd	Minor Arterial	Asphalt	33	51	9	196	78	43	60	Good	66
1238	Andover Park W	Triland Dr	S 180th St	Minor Arterial	Asphalt	30	620	103	2,169	67	68	60	Good	66
1902	Andover Park W	Baker Blvd	Strander Blvd	Minor Arterial	Asphalt	32	871	155	3,253	72	63	60	Good	68
1982	Andover Park W	Midland Dr	Triland Dr	Minor Arterial	Asphalt	30	845	141	2,957	73	72	60	V Good	72
2062	Andover Park W	Tukwila Pkwy	Southcenter Mall	Minor Arterial	Asphalt	32	327	58	1,222	75	71	60	V Good	73
1984	Andover Park W	Southcenter Mall	Baker Blvd	Minor Arterial	Asphalt	32	843	150	3,149	86	71	60	V Good	80
1694	B Line	Southcenter Pkwy	C Line	Local	Asphalt	20	271	30	633	69	70	60	Good	69
1042	Baker Blvd	Andover Park W	Andover Park E	Local	Asphalt	20	1,080	120	2,521	58	71	60	Good	61
1102	Baker Blvd	Andover Park E	Christensen Rd	Local	Asphalt	20	343	38	801	74	63	80	V Good	69
1632	Beacon Ave S	S Ryan Way	S 107th St	Local	Asphalt	22	943	115	2,420	58	59	60	Fair	57
1630	Beacon Ave S	CITY LIMIT	S Ryan Way	Local	Asphalt	20	60	7	140	83	32	80	Good	65

City of Tukwila, WA
Street Inventory and Condition Summary - Sorted by Street Name



GISID	On Street	From Street	To Street	FunCL	Pavetype	Pavement Width (ft)	Pavement Length (ft)	Add Area (yd2)	Pavement Area (yd2)	Condition Summary				
										Surface Distress Index (SDI)	Roughness Index (RI)	Structural Index (SI)	Condition Rating	Current Segment PCI (CPCI)
1975	Boeing Access Rd	Martin L King Jr Ramp	Martin L King Jr Way S	Principal Arterial	Asphalt	44	292	71	1,498	31	48	60	Poor	36
1753	Boeing Access Rd	DS@220E East Marginal Way S	Airport Way S	Principal Arterial	Asphalt	44	113	28	581	29	67	60	Marginal	40
1977	Boeing Access Rd	Airport Way S	Airport Way S	Principal Arterial	Asphalt	44	330	81	1,695	30	72	60	Marginal	42
1752	Boeing Access Rd	East Marginal Way S	DS@220E East Marginal Way S	Principal Arterial	Asphalt	44	220	54	1,132	35	75	30	Marginal	47
1978	Boeing Access Rd	Airport Way S	Airport Way S	Principal Arterial	Asphalt	44	377	92	1,933	39	75	30	Fair	49
1755	Boeing Access Rd	I-5 Ramp	Martin L King Jr Ramp	Principal Arterial	Asphalt	42	395	92	1,937	44	80	60	Fair	54
1754	Boeing Access Rd	I-5 Ramp	Airport Way S	Principal Arterial	Asphalt	44	168	41	862	55	63	60	Fair	56
1749	Boeing Access Rd	Airport Way S	Airport Way S	Principal Arterial	Asphalt	44	224	55	1,151	53	76	60	Good	59
1976	Boeing Access Rd	East Marginal Way S	East Marginal Way S	Principal Arterial	Asphalt	44	176	43	902	79	62	60	V Good	73
1751	Boeing Access Rd	East Marginal Way S	Boeing Access Rd	Principal Arterial	Asphalt	44	592	145	3,038	78	70	60	V Good	75
1974	Boeing Access Rd	East Marginal Way S	East Marginal Way S	Principal Arterial	Asphalt	44	173	42	886	87	67	60	V Good	79
1973	Boeing Access Rd	I-5 Ramp	I-5 Ramp	Principal Arterial	Concrete	44	492	120	2,526	100	61	60	Excellent	86
1750	Boeing Access Rd	I-5 Ramp	I-5 Ramp	Principal Arterial	Concrete	44	371	91	1,905	100	64	60	Excellent	88
1772	C Line	UnNamed-01534	Southcenter Pkwy	Local	Asphalt	20	730	81	1,703	21	61	30	Poor	33
1698	Cascade Ave S	Riverside Dr	Todd Blvd	Local	Asphalt	20	864	96	2,017	62	71	60	Good	64
1697	Cascade Ave S	Todd Blvd	S Glacier St	Local	Asphalt	20	738	82	1,722	75	79	60	V Good	76
1176	Christensen Rd	Strander Blvd	Christensen Rd	Local	Asphalt	19	802	85	1,777	48	57	60	Fair	50
1734	Christensen Rd	NORTH END	Baker Blvd	Local	Asphalt	20	1,253	139	2,924	64	66	80	Good	64
1395	Christensen Rd	Christensen Rd	Christensen Rd	Local	Asphalt	19	82	9	183	94	34	80	V Good	74
1177	Christensen Rd	Christensen Rd	Christensen Rd	Local	Asphalt	19	82	9	182	97	31	60	V Good	75
1175	Christensen Rd	Baker Blvd	Christensen Rd	Local	Asphalt	19	249	26	552	84	72	60	V Good	79
1149	Corporate Dr N	Corporate Dr N	Corporate Dr N	Local	Asphalt	19	206	22	457	91	40	80	V Good	73
1150	Corporate Dr N	WEST END	Andover Park W	Local	Asphalt	19	424	45	939	87	70	60	V Good	81
1577	Corporate Dr S	Corporate Dr S	Corporate Dr S	Local	Asphalt	20	203	23	474	44	27	60	Poor	38
1249	Corporate Dr S	WEST END	Andover Park W	Local	Asphalt	20	427	47	997	51	66	60	Fair	56
1001	Costco Dr	Andover Park E	DS@280E Andover Park E	Local	Asphalt	20	280	31	652	62	67	60	Good	63
1010	East Marginal Way S	Tukwila Intl Blvd	S 112th St	Minor Arterial	Asphalt	30	1,358	226	4,752	28	61	60	Poor	38
2092	East Marginal Way S	Interurban Ave S	SR 599	Minor Arterial	Asphalt	30	312	52	1,090	32	52	60	Poor	38
1869	East Marginal Way S	S 115th St	S 116th St	Minor Arterial	Asphalt	30	671	112	2,349	36	64	60	Marginal	44
1882	East Marginal Way S	S 96th Pl	S Norfolk St	Principal Arterial	Asphalt	44	1,742	426	8,944	41	67	60	Marginal	48
1687	East Marginal Way S	S 116th St	Interurban Ave S	Minor Arterial	Asphalt	30	392	65	1,370	39	70	60	Marginal	48
1868	East Marginal Way S	S 128th St	S 128th St	Minor Arterial	Asphalt	30	170	28	596	42	66	60	Marginal	48
1427	East Marginal Way S	S 112th St	S 115th St	Minor Arterial	Asphalt	30	713	119	2,494	40	71	60	Fair	49
1864	East Marginal Way S	East Marginal Way S	Tukwila Intl Blvd	Local	Asphalt	19	747	79	1,656	47	71	60	Fair	54
1866	East Marginal Way S	S 128th St	S 130th St	Minor Arterial	Asphalt	30	519	86	1,816	50	66	60	Fair	54
1423	East Marginal Way S	Tukwila Intl Blvd	Boeing Access Rd	Principal Arterial	Asphalt	44	52	13	268	55	57	60	Fair	55
1528	East Marginal Way S	S Norfolk St	S 102nd St	Principal Arterial	Asphalt	44	386	94	1,980	50	75	60	Fair	57
1877	East Marginal Way S	Boeing Access Rd	Tukwila Intl Blvd	Principal Arterial	Asphalt	43	242	58	1,212	49	77	30	Fair	57
1162	East Marginal Way S	CITY LIMIT	S 81st Pl	Principal Arterial	Asphalt	44	723	177	3,711	53	72	60	Fair	58
1158	East Marginal Way S	S 130th St	40th Ave S	Minor Arterial	Asphalt	30	113	19	396	53	72	60	Fair	58
1874	East Marginal Way S	S 102nd St	S 104th St	Principal Arterial	Asphalt	44	587	144	3,014	51	78	60	Good	59
1008	East Marginal Way S	Boeing Access Rd	Tukwila Intl Blvd	Minor Arterial	Asphalt	30	197	33	690	60	65	60	Good	61
2086	East Marginal Way S	SR 599	S 120th Pl	Minor Arterial	Asphalt	30	603	100	2,109	58	73	60	Good	62

City of Tukwila, WA
Street Inventory and Condition Summary - Sorted by Street Name



GISID	On Street	From Street	To Street	FunCL	Pavetype	Pavement Width (ft)	Pavement Length (ft)	Add Area (yd2)	Pavement Area (yd2)	Condition Summary				
										Surface Distress Index (SDI)	Roughness Index (RI)	Structural Index (SI)	Condition Rating	Current Segment PCI (CPCI)
1165	East Marginal Way S	S 104th St	DS@507S S 104th St	Principal Arterial	Asphalt	44	507	124	2,600	58	76	60	Good	63
1160	East Marginal Way S	S 126th St	S 128th St	Minor Arterial	Asphalt	30	353	59	1,235	64	69	60	Good	65
1881	East Marginal Way S	DS@507S S 104th St	Boeing Access Rd	Principal Arterial	Asphalt	44	314	77	1,609	62	74	60	Good	65
1426	East Marginal Way S	40th Ave S	S 133rd St	Minor Arterial	Asphalt	30	893	149	3,127	62	76	60	Good	66
1428	East Marginal Way S	S 81st Pl	S 87th Pl	Principal Arterial	Asphalt	44	2,601	636	13,350	65	73	60	Good	67
1157	East Marginal Way S	S 90th St	S 94th Pl	Principal Arterial	Asphalt	44	1,667	408	8,560	68	72	60	Good	68
1883	East Marginal Way S	Tukwila Intl Blvd	Boeing Access Rd	Local	Asphalt	30	309	52	1,082	74	60	60	Good	69
1875	East Marginal Way S	S 124th St	S 126th St	Minor Arterial	Asphalt	30	899	150	3,147	68	76	60	V Good	70
1997	East Marginal Way S	S 87th Pl	S 90th St	Principal Arterial	Asphalt	44	524	128	2,688	72	74	60	V Good	72
1391	East Marginal Way S	S 120th Pl	S 124th St	Minor Arterial	Asphalt	30	1,254	209	4,390	75	68	60	V Good	72
1009	East Marginal Way S	Tukwila Intl Blvd	Tukwila Intl Blvd	Principal Arterial	Asphalt	44	82	20	421	87	46	80	V Good	73
1531	East Marginal Way S	S 94th Pl	S 96th Pl	Principal Arterial	Asphalt	44	718	176	3,688	79	70	60	V Good	75
1508	Evans Black Dr	WEST END	Andover Park E	Local	Asphalt	30	567	94	1,984	93	66	60	V Good	84
1954	Fort Dent Way	Interurban Ave S	Starfire Way	Local	Asphalt	29	688	111	2,329	92	72	60	Excellent	85
1341	Frager Rd	S 204th St	S 204th St	Collector	Asphalt	32	3	1	11	77	0	80	Fair	50
1364	Fun Center Way	DS@447E Interurban Ave S	SW Grady Way	Local	Asphalt	20	112	12	261	45	11	60	Poor	33
1510	Fun Center Way	Interurban Ave S	DS@447E Interurban Ave S	Local	Asphalt	22	447	55	1,148	86	69	60	V Good	80
1696	Gateway Dr	Interurban Ave S	S 133rd St	Local	Asphalt	21	2,527	295	6,192	91	70	60	V Good	84
1002	Industry Dr	Andover Park E	DS@355E Andover Park E	Local	Asphalt	22	355	43	911	70	69	60	Good	69
1998	Interurban Ave S	Macadam Rd S	Gateway Dr	Minor Arterial	Asphalt	30	997	166	3,488	32	64	60	Marginal	41
1872	Interurban Ave S	SW Grady Way	West Valley Hwy	Principal Arterial	Asphalt	55	141	43	906	37	61	60	Marginal	43
1167	Interurban Ave S	58th Ave S	S 143rd St	Principal Arterial	Asphalt	56	615	191	4,015	46	57	60	Marginal	48
1562	Interurban Ave S	Fun Center Way	SW Grady Way	Principal Arterial	Asphalt	55	231	70	1,480	48	53	60	Marginal	48
1159	Interurban Ave S	40th Ave S	Macadam Rd S	Minor Arterial	Asphalt	30	2,868	478	10,037	37	83	60	Fair	51
1559	Interurban Ave S	48th Ave S	I-5 Ramp	Principal Arterial	Asphalt	55	127	39	817	53	56	60	Fair	53
1880	Interurban Ave S	S 140th St	58th Ave S	Principal Arterial	Asphalt	55	829	253	5,322	52	62	60	Fair	54
1876	Interurban Ave S	West Valley Hwy	SW Grady Way	Local	Asphalt	22	164	20	421	59	55	60	Fair	57
1878	Interurban Ave S	I-5 Ramp	56th Ave S	Principal Arterial	Asphalt	55	607	186	3,897	59	65	60	Good	60
1871	Interurban Ave S	56th Ave S	S 140th St	Principal Arterial	Asphalt	55	2,142	655	13,745	58	69	60	Good	60
1392	Interurban Ave S	I-405 Ramp	DS@490E I-405 Ramp	Principal Arterial	Asphalt	56	490	152	3,198	60	67	60	Good	61
1994	Interurban Ave S	East Marginal Way S	40th Ave S	Minor Arterial	Asphalt	30	1,013	169	3,544	58	77	60	Good	63
1999	Interurban Ave S	S 149th St	I-405 Ramp	Principal Arterial	Asphalt	56	1,953	608	12,761	65	65	60	Good	64
1873	Interurban Ave S	I-5 Ramp	I-5 Ramp	Principal Arterial	Asphalt	55	573	175	3,675	66	64	60	Good	64
1879	Interurban Ave S	S 133rd St	SR 599 Ramp	Minor Arterial	Asphalt	30	276	46	966	73	65	60	V Good	70
1867	Interurban Ave S	DS@490E I-405 Ramp	Fun Center Way	Principal Arterial	Asphalt	56	125	39	815	77	60	60	V Good	70
1161	Interurban Ave S	SR 599 Ramp	48th Ave S	Minor Arterial	Asphalt	30	767	128	2,683	71	72	60	V Good	71
1011	Interurban Ave S	S 143rd St	S 143rd Pl	Principal Arterial	Asphalt	56	339	106	2,218	72	70	60	V Good	71
1996	Interurban Ave S	Interurban Ave S	Southcenter Blvd	Local	Asphalt	22	387	47	992	82	57	80	V Good	73
1865	Interurban Ave S	S 147th St	S 149th St	Principal Arterial	Asphalt	56	604	188	3,946	79	65	60	V Good	74
1164	Interurban Ave S	SR 599 Ramp	S 133rd St	Minor Arterial	Asphalt	30	284	47	993	76	75	60	V Good	75
1218	Interurban Ave S	Gateway Dr	SR 599 Ramp	Minor Arterial	Asphalt	30	500	83	1,749	73	83	60	V Good	76
1870	Interurban Ave S	S 144th St	S 147th St	Principal Arterial	Asphalt	56	916	285	5,983	86	77	60	V Good	82
1424	Interurban Ave S	S 143rd Pl	S 144th St	Principal Arterial	Asphalt	56	344	107	2,248	95	87	60	Excellent	91

City of Tukwila, WA
Street Inventory and Condition Summary - Sorted by Street Name



Street Inventory and Condition Summary - Sorted by Street Name										Condition Summary				
GISID	On Street	From Street	To Street	FunCL	Pavetype	Pavement Width (ft)	Pavement Length (ft)	Add Area (yd2)	Pavement Area (yd2)	Surface Distress Index (SDI)	Roughness Index (RI)	Structural Index (SI)	Condition Rating	Current Segment PCI (CPCI)
1839	Interurban Pl S	40th Ave S	SE END	Local	Asphalt	22	478	58	1,226	62	43	60	Fair	55
1398	Klickitat Dr	I-5 Ramp	Southcenter Pkwy	Minor Arterial	Asphalt	30	1,052	175	3,682	51	71	60	Fair	56
1248	Klickitat Dr	53rd Ave S	I-5 Ramp	Minor Arterial	Asphalt	30	1,089	181	3,811	72	87	60	V Good	76
1397	Klickitat Dr	51st Ave S	53rd Ave S	Minor Arterial	Asphalt	30	877	146	3,068	79	73	60	V Good	77
1375	Longacres Way	West Valley Hwy	Nelsen Pl	Local	Asphalt	22	400	49	1,028	70	72	60	V Good	70
1944	Macadam Rd S	S 136th St	S 137th St	Collector	Asphalt	34	308	58	1,222	38	53	60	Marginal	41
1948	Macadam Rd S	Interurban Ave S	SR 599	Collector	Asphalt	35	123	24	502	36	66	60	Marginal	44
1317	Macadam Rd S	43rd Ave S	S 136th St	Collector	Asphalt	35	1,710	333	6,984	41	58	60	Marginal	45
1945	Macadam Rd S	S 138th St	S 144th St	Collector	Asphalt	34	1,997	377	7,922	46	64	60	Fair	51
1315	Macadam Rd S	S 137th St	S 138th St	Collector	Asphalt	34	783	148	3,105	49	58	60	Fair	51
1947	Macadam Rd S	SR 599	S 128th St	Collector	Asphalt	35	192	37	784	80	53	80	V Good	71
1316	Macadam Rd S	SR 599	SR 599	Collector	Asphalt	35	104	20	426	80	73	60	V Good	77
1495	Macadam Rd S	S 130th St	S 131st Pl	Collector	Asphalt	35	531	103	2,170	86	65	60	V Good	78
1946	Macadam Rd S	S 133rd St	43rd Ave S	Collector	Asphalt	35	338	66	1,379	86	65	60	V Good	79
1314	Macadam Rd S	S 131st Pl	S 133rd St	Collector	Asphalt	35	534	104	2,180	89	65	60	V Good	80
1312	Macadam Rd S	S 128th St	S 130th St	Collector	Asphalt	35	271	53	1,107	89	68	60	V Good	82
1098	Macadam Rd S	S 144th St	S 149th Ln	Collector	Asphalt	34	1,662	314	6,592	90	77	60	Excellent	85
2064	Macadam Rd S	S 149th Ln	S 150th St	Collector	Asphalt	34	195	37	773	99	67	60	Excellent	87
1943	Macadam Rd S	S 150th St	S 152nd St	Collector	Asphalt	34	867	164	3,439	97	77	60	Excellent	89
1313	Macadam Rd S	S 152nd St	Southcenter Blvd	Collector	Asphalt	34	1,451	274	5,754	99	85	60	Excellent	93
1319	Martin L King Jr Way S	I-5 Ramp	I-5 Ramp	Principal Arterial	Asphalt	56	1,943	604	12,692	57	80	60	Good	63
1812	Martin L King Jr Way S	Boeing Access Rd	I-5 Ramp	Principal Arterial	Asphalt	56	163	51	1,062	71	59	60	Good	66
1813	Martin L King Jr Way S	I-5 Ramp	I-5 Ramp	Principal Arterial	Asphalt	56	586	182	3,831	70	82	80	V Good	74
1148	Martin L King Jr Way S	I-5 Ramp	CITY LIMIT	Principal Arterial	Asphalt	56	1,935	602	12,643	73	89	60	V Good	77
1811	Martin L King Jr Way S	DS@413S S 104th Pl	Boeing Access Rd	Principal Arterial	Concrete	55	158	48	1,017	93	56	60	V Good	81
1318	Martin L King Jr Way S	CITY LIMIT	S 104th Pl	Principal Arterial	Concrete	56	114	35	744	97	65	60	Excellent	86
1332	Martin L King Jr Way S	S 104th Pl	DS@413S S 104th Pl	Principal Arterial	Concrete	56	413	129	2,701	100	71	60	Excellent	90
1323	Martin L King Jr Way S	CITY LIMIT	Martin L King Jr Way S	Local	Concrete	25	526	73	1,535	100	80	60	Excellent	93
1593	Midland Dr	WEST END	Andover Park W	Local	Asphalt	22	900	110	2,311	8	69	60	Poor	28
1614	Military Rd S	S 158th St	EAST END	Local	Asphalt	25	187	26	546	73	52	80	Good	66
1355	Minkler Blvd	Southcenter Pkwy	Bauch Dr	Collector	Asphalt	35	1,314	255	5,365	68	63	60	Good	65
1365	Minkler Blvd	Andover Park W	Andover Park E	Collector	Asphalt	33	903	165	3,475	75	69	60	V Good	73
2019	Minkler Blvd	Bauch Dr	Andover Park W	Collector	Asphalt	35	672	131	2,743	80	66	60	V Good	75
1357	Minkler Blvd	Andover Park E	Industry Dr	Local	Asphalt	22	585	72	1,503	87	57	60	V Good	77
1378	Nelsen Pl	S 156th St	Longacres Way	Local	Asphalt	24	571	76	1,599	31	45	60	Poor	35
1633	Olympic Ave S	Todd Blvd	S Glacier St	Local	Asphalt	22	853	104	2,190	64	83	60	Good	69
1834	Olympic Ave S	Riverside Dr	Todd Blvd	Local	Asphalt	25	865	120	2,524	75	80	60	V Good	76
1371	Orillia Rd S	S 188th St	S 200th St	Principal Arterial	Asphalt	56	3,525	1,097	23,031	31	84	60	Marginal	47
1645	Orillia Rd S	S 200th St	S 204th St	Principal Arterial	Asphalt	56	1,602	498	10,465	69	87	60	V Good	74
1823	Pamela Dr	57th Ave S	NE END	Local	Asphalt	19	405	43	898	73	61	60	Good	68
1664	Pamela Dr	Pamela Dr	Pamela Dr	Local	Asphalt	19	178	19	395	89	52	60	V Good	76
1213	Riverside Dr	Olympic Ave S	Cascade Ave S	Local	Asphalt	19	480	51	1,064	74	90	60	V Good	79
2161	S 102nd St	27th Ave S	DS@644E 27th Ave S	Local	Asphalt	19	644	68	1,427	88	74	60	V Good	83

City of Tukwila, WA
Street Inventory and Condition Summary - Sorted by Street Name



GISID	On Street	From Street	To Street	FunCL	Pavetype	Pavement Width (ft)	Pavement Length (ft)	Add Area (yd2)	Pavement Area (yd2)	Condition Summary				
										Surface Distress Index (SDI)	Roughness Index (RI)	Structural Index (SI)	Condition Rating	Current Segment PCI (CPCI)
1457	S 104th Pl	WEST END	Martin L King Jr Way S	Local	Asphalt	19	751	79	1,665	54	57	60	Fair	54
1014	S 104th Pl	DS@258E 47th Ave S	S 104th Pl	Local	Asphalt	20	61	7	142	86	2	80	Fair	57
1015	S 104th Pl	DS@188E 47th Ave S	DS@258E 47th Ave S	Local	Asphalt	20	69	8	162	80	14	80	Fair	57
1013	S 104th Pl	47th Ave S	DS@188E 47th Ave S	Local	Asphalt	20	188	21	440	85	63	60	V Good	77
1425	S 104th St	27th Ave S	East Marginal Way S	Local	Asphalt	20	977	109	2,279	64	61	60	Good	62
1118	S 107th St	S Ryan Way	EAST END	Local	Asphalt	20	302	34	705	30	38	60	Poor	31
1119	S 107th St	Beacon Ave S	51st Ave S	Local	Asphalt	22	130	16	333	89	37	80	V Good	71
1278	S 107th St	49th Ave S	Beacon Ave S	Local	Asphalt	22	471	58	1,210	95	63	60	V Good	84
1799	S 109th St	Beacon Ave S	Beacon Ave S	Local	Asphalt	24	1	0	3	62	22	80	Marginal	48
1940	S 109th St	50th Ave S	Beacon Ave S	Local	Asphalt	22	217	26	556	51	52	60	Fair	50
2128	S 109th St	Beacon Ave S	51st Ave S	Local	Asphalt	24	30	4	82	75	18	80	Fair	56
1800	S 109th St	47th Ave S	48th Ave S	Local	Asphalt	22	283	35	727	70	60	60	Good	66
1284	S 112th St	50th Ave S	51st Ave S	Local	Asphalt	20	294	33	686	52	43	60	Marginal	48
1286	S 112th St	Tukwila Intl Blvd	East Marginal Way S	Collector	Asphalt	35	995	193	4,063	62	75	60	Good	66
1285	S 112th St	WEST END	Tukwila Intl Blvd	Local	Asphalt	22	778	95	1,997	64	72	60	Good	66
1039	S 113th St	WEST END	41st Ave S	Local	Asphalt	20	475	53	1,109	48	31	60	Marginal	41
1988	S 113th St	WEST END	51st Ave S	Local	Asphalt	20	345	38	805	61	44	60	Fair	54
1444	S 114th St	40th Ave S	41st Ave S	Local	Asphalt	22	219	27	562	39	27	80	Poor	35
1443	S 114th St	WEST END	40th Ave S	Local	Asphalt	20	211	23	493	78	9	80	Fair	55
1442	S 114th St	41st Ave S	EAST END	Local	Asphalt	22	148	18	380	83	0	80	Fair	55
1441	S 114th St	49th Ave S	51st Ave S	Local	Asphalt	22	918	112	2,356	80	58	60	V Good	72
1057	S 115th St	East Marginal Way S	40th Ave S	Collector	Asphalt	33	1,096	201	4,219	51	73	60	Fair	57
1059	S 115th St	42nd Ave S	NE END	Local	Asphalt	19	209	22	462	89	32	80	Good	69
1058	S 115th St	40th Ave S	42nd Ave S	Collector	Asphalt	32	764	136	2,852	71	71	60	V Good	70
1338	S 116th St	WEST END	East Marginal Way S	Local	Asphalt	19	1,114	118	2,469	62	56	60	Fair	59
2100	S 116th St	East Marginal Way S	35th Ln S	Local	Asphalt	19	226	24	501	73	44	80	Good	63
1628	S 116th St	43rd Pl S	42nd Ave S	Local	Asphalt	19	363	38	806	74	54	60	Good	67
2102	S 116th St	35th Ln S	39th Ave S	Local	Asphalt	19	488	52	1,082	90	72	60	V Good	83
1596	S 117th St	39th Ave S	40th Ave S	Local	Asphalt	20	315	35	736	87	77	60	V Good	83
1690	S 118th St	44th Pl S	EAST END	Local	Asphalt	20	201	22	469	17	28	60	V Poor	20
2098	S 118th St	44th Ave S	44th Pl S	Local	Asphalt	20	94	10	220	84	91	60	Excellent	86
1360	S 119th St	40th Ave S	40th Pl S	Local	Concrete	20	240	27	560	100	47	60	V Good	83
1370	S 119th St	40th Pl S	EAST END	Local	Concrete	21	224	26	549	100	55	60	Excellent	85
1987	S 120th Pl	WEST END	East Marginal Way S	Local	Concrete	21	1,244	145	3,048	95	59	60	V Good	83
1229	S 122nd Ln	50th Ave S	51st Pl S	Local	Asphalt	21	338	39	828	78	54	60	V Good	69
1430	S 122nd St	44th Ave S	44th Ave S	Local	Asphalt	22	98	12	251	63	57	60	Good	60
1432	S 122nd St	43rd Ave S	44th Ave S	Local	Asphalt	21	152	18	373	69	62	60	Good	66
1440	S 122nd St	42nd Ave S	43rd Ave S	Local	Asphalt	21	334	39	819	76	54	80	Good	68
1671	S 122nd St	46th Ave S	46th Ave S	Local	Asphalt	22	54	7	138	75	55	80	Good	68
1061	S 122nd St	45th Ave S	46th Ave S	Local	Asphalt	22	190	23	488	80	72	60	V Good	77
1436	S 122nd St	48th Ave S	44th Pl S	Local	Asphalt	19	187	20	415	86	60	60	V Good	77
1433	S 122nd St	44th Pl S	49th Ave S	Local	Asphalt	19	63	7	139	94	49	60	V Good	79
1431	S 122nd St	46th Ave S	47th Ave S	Local	Asphalt	22	248	30	638	88	72	60	V Good	82

City of Tukwila, WA
Street Inventory and Condition Summary - Sorted by Street Name



GISID	On Street	From Street	To Street	FunCL	Pavetype	Pavement Width (ft)	Pavement Length (ft)	Add Area (yd2)	Pavement Area (yd2)	Condition Summary				
										Surface Distress Index (SDI)	Roughness Index (RI)	Structural Index (SI)	Condition Rating	Current Segment PCI (CPCI)
1434	S 122nd St	47th Ave S	48th Ave S	Local	Asphalt	19	255	27	565	88	74	60	V Good	83
1106	S 122nd St	49th Ave S	51st Pl S	Local	Asphalt	19	130	14	287	95	65	60	Excellent	84
1435	S 122nd St	44th Ave S	45th Ave S	Local	Asphalt	22	252	31	646	93	70	60	Excellent	85
1336	S 124th St	50th Pl S	51st Pl S	Local	Asphalt	20	409	45	954	66	60	60	Good	63
1417	S 124th St	35th Ave S	East Marginal Way S	Local	Asphalt	19	718	76	1,591	73	54	80	Good	66
1553	S 124th St	49th Ave S	50th Pl S	Collector	Asphalt	34	253	48	1,002	74	64	30	V Good	70
1502	S 124th St	42nd Ave S	43rd Ave S	Collector	Asphalt	35	273	53	1,115	83	75	60	V Good	80
1990	S 124th St	44th Ave S	45th Ave S	Collector	Asphalt	35	257	50	1,050	84	74	60	V Good	80
1993	S 124th St	45th Ave S	46th Ave S	Collector	Asphalt	35	243	47	994	92	70	60	V Good	84
1816	S 124th St	48th Ave S	49th Ave S	Collector	Asphalt	34	253	48	1,005	89	77	60	V Good	84
1505	S 124th St	43rd Ave S	44th Ave S	Collector	Asphalt	35	244	47	995	91	77	60	Excellent	86
1414	S 124th St	46th Ave S	47th Ave S	Collector	Asphalt	34	249	47	987	91	79	60	Excellent	86
1991	S 124th St	47th Ave S	48th Ave S	Collector	Asphalt	34	254	48	1,008	90	81	60	Excellent	86
1310	S 125th St	46th Ave S	50th Pl S	Local	Asphalt	20	1,156	128	2,697	88	79	60	V Good	84
1366	S 126th St	40th Ave S	42nd Ave S	Local	Asphalt	20	317	35	741	66	37	80	Fair	56
1512	S 126th St	35th Ave S	37th Ave S	Local	Asphalt	20	419	47	977	94	58	60	V Good	81
1643	S 126th St	37th Ave S	East Marginal Way S	Local	Asphalt	20	549	61	1,282	93	66	60	V Good	83
1373	S 126th St	34th Ave S	35th Ave S	Local	Asphalt	20	405	45	944	94	70	60	Excellent	86
1241	S 128th St	East Marginal Way S	40th Ave S	Local	Asphalt	19	87	9	192	70	44	80	Good	60
1906	S 128th St	WEST END	35th Ave S	Local	Asphalt	22	218	27	560	84	18	80	Good	61
1455	S 128th St	40th Ave S	Macadam Rd S	Local	Asphalt	19	854	90	1,892	73	58	60	Good	67
1904	S 128th St	CITY LIMIT	CITY LIMIT	Local	Asphalt	24	1	0	3	100	28	60	V Good	76
1903	S 128th St	35th Ave S	37th Ave S	Local	Asphalt	22	409	50	1,049	96	48	60	V Good	79
1905	S 128th St	Military Rd S	CITY LIMIT	Local	Asphalt	22	653	80	1,675	92	69	60	V Good	84
1242	S 128th St	37th Ave S	East Marginal Way S	Local	Asphalt	22	786	96	2,017	98	59	60	Excellent	85
1103	S 129th St	S 130th Pl	CITY LIMIT	Collector	Concrete	32	1,139	203	4,253	100	64	60	Excellent	88
1595	S 130th Pl	57th Ave S	SE END	Local	Asphalt	22	1,478	181	3,795	50	50	60	Fair	50
1549	S 130th Pl	50th Pl S	56th Ave S	Local	Asphalt	22	1,828	223	4,691	64	64	60	Good	64
1280	S 130th Pl	56th Ave S	57th Ave S	Local	Asphalt	22	270	33	694	73	61	80	Good	69
1141	S 130th St	33rd Pl S	34th Ave S	Local	Asphalt	22	99	12	254	62	4	80	Marginal	42
2095	S 130th St	38th Ln S	East Marginal Way S	Local	Asphalt	25	282	39	823	61	59	60	Good	60
1635	S 130th St	35th Ave S	35th Ln S	Local	Asphalt	25	284	39	828	73	51	60	Good	65
1853	S 130th St	37th Ave S	37th Ave S	Local	Asphalt	24	21	3	57	83	30	80	Good	65
1140	S 130th St	41st Ave S	Macadam Rd S	Local	Asphalt	25	493	68	1,438	80	52	80	V Good	70
1837	S 130th St	33rd Ave S	33rd Pl S	Local	Asphalt	22	55	7	141	87	49	60	V Good	74
1857	S 130th St	Tukwila Intl Blvd	35th Ave S	Local	Asphalt	22	215	26	551	82	58	80	V Good	74
1170	S 130th St	32nd Ave S	33rd Ave S	Local	Asphalt	22	335	41	860	95	39	60	V Good	76
1381	S 130th St	East Marginal Way S	41st Ave S	Local	Asphalt	25	285	40	831	85	66	60	V Good	78
1387	S 130th St	35th Ln S	37th Ave S	Local	Asphalt	25	121	17	352	89	60	60	V Good	79
1155	S 130th St	37th Ave S	38th Ave S	Local	Asphalt	25	237	33	691	90	74	60	V Good	84
2093	S 130th St	38th Ave S	38th Ln S	Local	Asphalt	25	261	36	762	99	76	60	Excellent	91
1185	S 131st Pl	44th Ave S	44th Ave S	Local	Asphalt	20	133	15	311	55	40	60	Fair	49
1186	S 131st Pl	Macadam Rd S	44th Ave S	Local	Asphalt	20	336	37	784	88	57	60	V Good	77

City of Tukwila, WA
Street Inventory and Condition Summary - Sorted by Street Name



Street Inventory and Condition Summary - Sorted by Street Name										Condition Summary				
														
GISID	On Street	From Street	To Street	FunCL	Pavetype	Pavement Width (ft)	Pavement Length (ft)	Add Area (yd2)	Pavement Area (yd2)	Surface Distress Index (SDI)	Roughness Index (RI)	Structural Index (SI)	Condition Rating	Current Segment PCI (CPCI)
1893	S 131st Pl	41st Ave S	Macadam Rd S	Local	Asphalt	20	527	59	1,229	86	61	60	V Good	77
1007	S 132nd Pl	S 132nd Pl	S 132nd Pl	Local	Asphalt	19	214	23	475	29	5	80	V Poor	20
1917	S 132nd Pl	NW END	38th Pl S	Local	Asphalt	19	180	19	400	69	43	60	Good	60
2097	S 132nd Pl	38th Pl S	40th Ave S	Local	Asphalt	19	285	30	632	86	58	60	V Good	76
1618	S 132nd St	35th Ln S	37th Ave S	Local	Asphalt	22	132	16	340	25	10	80	V Poor	19
2005	S 132nd St	34th Ave S	34th Ln S	Collector	Asphalt	34	248	47	983	18	66	60	Poor	33
1615	S 132nd St	35th Ave S	Tukwila Intl Blvd	Collector	Asphalt	35	98	19	402	47	16	80	Poor	36
1616	S 132nd St	33rd Ave S	34th Ave S	Collector	Asphalt	35	332	65	1,355	33	71	30	Marginal	45
2006	S 132nd St	34th Ln S	35th Ave S	Collector	Asphalt	33	96	18	368	42	73	60	Fair	51
1172	S 133rd St	31st Ave S	32nd Ave S	Collector	Asphalt	25	303	42	883	23	76	60	Marginal	39
1520	S 133rd St	34th Ave S	35th Ave S	Local	Asphalt	22	309	38	793	36	49	60	Marginal	39
1529	S 133rd St	Military Rd S	30th Pl S	Collector	Asphalt	25	449	62	1,311	29	68	60	Marginal	41
1642	S 133rd St	35th Ave S	EAST END	Local	Asphalt	22	262	32	672	41	46	60	Marginal	41
1153	S 133rd St	30th Pl S	31st Ave S	Collector	Asphalt	25	208	29	608	24	82	60	Marginal	42
1154	S 133rd St	32nd Ave S	S 132nd St	Collector	Asphalt	25	388	54	1,131	56	64	60	Fair	58
1926	S 133rd St	SR 599	Interurban Ave S	Minor Arterial	Asphalt	35	210	41	856	69	53	60	Good	63
1858	S 133rd St	56th Ave S	57th Ave S	Local	Asphalt	27	259	39	817	89	36	60	V Good	71
1919	S 133rd St	S 134th Pl	SR 599 Ramp	Minor Arterial	Asphalt	35	388	75	1,583	75	90	60	V Good	80
1862	S 133rd St	44th Ave S	S 134th Pl	Minor Arterial	Asphalt	34	481	91	1,909	90	63	60	V Good	81
1851	S 133rd St	East Marginal Way S	Macadam Rd S	Minor Arterial	Asphalt	34	488	92	1,936	86	76	60	V Good	82
2001	S 133rd St	57th Ave S	57th Ave S	Local	Asphalt	24	12	2	33	100	49	60	V Good	83
1555	S 133rd St	Macadam Rd S	44th Ave S	Minor Arterial	Asphalt	34	334	63	1,326	93	75	60	Excellent	87
1923	S 133rd St	SR 599	SR 599	Minor Arterial	Asphalt	35	60	12	244	82	100	60	Excellent	87
1921	S 133rd St	SR 599 Ramp	SR 599	Minor Arterial	Asphalt	45	22	6	117	89	96	60	Excellent	90
1829	S 134th Pl	S 133rd St	47th Ave S	Local	Asphalt	26	977	141	2,964	72	54	60	Good	65
1638	S 134th Pl	47th Ave S	48th Ave S	Local	Asphalt	26	215	31	653	83	67	60	V Good	78
1703	S 135th St	Military Rd S	32nd Ave S	Local	Asphalt	26	835	121	2,532	65	64	60	Good	63
1701	S 135th St	34th Ave S	35th Ave S	Local	Asphalt	27	320	48	1,006	85	70	60	V Good	79
1702	S 135th St	32nd Ave S	34th Ave S	Local	Asphalt	27	637	96	2,007	90	68	60	V Good	82
1214	S 135th St	35th Ave S	37th Ave S	Local	Asphalt	27	309	46	973	92	68	60	V Good	84
2084	S 136th St	WEST END	52nd Pl S	Local	Asphalt	28	80	12	262	54	19	80	Marginal	41
2083	S 136th St	52nd Pl S	52nd Ave S	Local	Asphalt	28	284	44	927	43	45	60	Marginal	43
1900	S 136th St	Macadam Rd S	48th Pl S	Local	Asphalt	28	302	47	986	64	45	60	Fair	57
1675	S 136th St	48th Pl S	EAST END	Local	Asphalt	28	250	39	817	76	52	60	Good	67
1676	S 136th St	WEST END	45th Pl S	Local	Asphalt	28	410	64	1,340	84	53	80	V Good	73
1899	S 136th St	32nd Ave S	34th Ave S	Local	Asphalt	27	670	100	2,110	96	63	60	V Good	84
1896	S 137th Pl	S 137th Pl	S 137th Pl	Local	Asphalt	26	188	27	571	92	38	80	V Good	74
1898	S 137th Pl	43rd Pl S	NORTH END	Local	Asphalt	28	136	21	445	88	50	60	V Good	75
1637	S 137th St	53rd Ave S	56th Ave S	Local	Asphalt	27	224	34	705	71	42	60	Good	61
1849	S 137th St	45th Pl S	Macadam Rd S	Local	Asphalt	25	163	23	475	66	73	30	Good	67
1139	S 137th St	40th Ave S	43rd Pl S	Local	Asphalt	26	150	22	455	88	41	80	V Good	72
1636	S 137th St	53rd Ave S	53rd Ave S	Local	Asphalt	27	152	23	480	89	39	80	V Good	72
1847	S 137th St	52nd Pl S	53rd Ave S	Local	Asphalt	27	127	19	400	97	33	60	V Good	76

City of Tukwila, WA
Street Inventory and Condition Summary - Sorted by Street Name



Street Inventory and Condition Summary - Sorted by Street Name										Condition Summary				
														
GISID	On Street	From Street	To Street	FunCL	Pavetype	Pavement Width (ft)	Pavement Length (ft)	Add Area (yd2)	Pavement Area (yd2)	Surface Distress Index (SDI)	Roughness Index (RI)	Structural Index (SI)	Condition Rating	Current Segment PCI (CPCI)
1171	S 137th St	43rd Pl S	43rd Pl S	Local	Asphalt	25	285	40	833	82	69	60	V Good	77
1850	S 137th St	44th Ave S	45th Ave S	Local	Asphalt	25	387	54	1,129	95	53	60	V Good	81
1835	S 137th St	43rd Pl S	44th Ave S	Local	Asphalt	25	420	58	1,225	90	64	60	V Good	81
1830	S 137th St	34th Ave S	35th Ave S	Local	Asphalt	26	206	30	626	96	61	60	V Good	84
1173	S 137th St	45th Ave S	45th Pl S	Local	Asphalt	25	248	34	724	99	58	60	Excellent	85
1145	S 137th St	35th Ave S	37th Ave S	Local	Asphalt	26	300	43	910	96	69	60	Excellent	87
1634	S 137th St	32nd Ave S	34th Ave S	Local	Asphalt	26	767	111	2,327	95	78	60	Excellent	89
1854	S 137th St	52nd Ave S	52nd Pl S	Local	Asphalt	27	208	31	654	100	75	60	Excellent	91
1959	S 138th St	Macadam Rd S	NE END	Local	Asphalt	27	268	40	846	24	34	60	Poor	26
2085	S 138th St	51st Ave S	51st Ave S	Local	Asphalt	27	114	17	359	98	61	60	Excellent	85
1958	S 138th St	37th Ave S	38th Ave S	Local	Asphalt	27	340	51	1,070	93	77	60	Excellent	87
1127	S 139th St	53rd Ave S	55th Ave S	Local	Asphalt	26	374	54	1,134	32	49	60	Poor	37
1122	S 139th St	56th Ave S	56th Pl S	Local	Asphalt	26	183	26	556	38	46	60	Marginal	40
1125	S 139th St	42nd Ave S	44th Ave S	Local	Asphalt	24	620	83	1,737	55	54	60	Fair	54
1123	S 139th St	45th Ave S	EAST END	Local	Asphalt	24	295	39	827	65	48	60	Fair	58
1126	S 139th St	WEST END	45th Ave S	Local	Asphalt	24	113	15	316	93	40	60	V Good	75
1121	S 139th St	Tukwila Intl Blvd	41st Ave S	Local	Asphalt	24	382	51	1,068	84	67	60	V Good	78
1128	S 139th St	51st Ave S	53rd Ave S	Local	Asphalt	26	546	79	1,657	98	41	60	V Good	78
1124	S 139th St	41st Ave S	42nd Ave S	Local	Asphalt	24	348	46	975	90	66	60	V Good	82
1605	S 140th St	44th Ave S	45th Ave S	Local	Asphalt	26	364	53	1,105	59	50	60	Fair	55
1486	S 140th St	42nd Ave S	43rd Ave S	Local	Asphalt	26	326	47	990	59	68	60	Good	61
1482	S 140th St	Interurban Ave S	NE END	Local	Asphalt	24	207	28	581	80	39	80	Good	66
1599	S 140th St	43rd Ave S	44th Ave S	Local	Asphalt	26	329	48	999	74	60	60	Good	69
1603	S 140th St	Tukwila Intl Blvd	42nd Ave S	Local	Asphalt	26	646	93	1,959	75	60	60	Good	69
1484	S 140th St	38th Ave S	Tukwila Intl Blvd	Local	Asphalt	27	336	50	1,057	71	69	60	V Good	70
1600	S 140th St	Military Rd S	33rd Ave S	Local	Asphalt	26	358	52	1,086	75	62	60	V Good	70
1483	S 140th St	35th Ave S	34th Ave S	Local	Asphalt	27	59	9	185	94	37	60	V Good	74
1598	S 140th St	53rd Ave S	55th Ave S	Local	Asphalt	24	540	72	1,512	87	60	60	V Good	78
1485	S 140th St	33rd Pl S	35th Ave S	Local	Asphalt	27	537	81	1,693	84	71	30	V Good	79
1604	S 140th St	37th Ave S	38th Ave S	Local	Asphalt	27	307	46	966	97	53	60	V Good	82
1602	S 140th St	33rd Ave S	33rd Pl S	Local	Asphalt	26	426	61	1,291	94	75	60	Excellent	87
1601	S 140th St	34th Ave S	37th Ave S	Local	Asphalt	27	369	55	1,163	100	77	60	Excellent	91
1591	S 141st St	56th Ave S	56th Pl S	Local	Asphalt	24	239	32	670	24	22	60	V Poor	23
1587	S 141st St	Tukwila Intl Blvd	42nd Ave S	Local	Asphalt	24	589	79	1,649	40	52	60	Marginal	43
1590	S 141st St	56th Pl S	57th Ave S	Local	Asphalt	25	167	23	486	60	48	60	Fair	55
1589	S 141st St	37th Ave S	Tukwila Intl Blvd	Local	Asphalt	24	690	92	1,933	82	69	60	V Good	77
1588	S 141st St	33rd Pl S	34th Pl S	Local	Asphalt	24	178	24	498	99	61	60	Excellent	86
1279	S 142nd Pl	35th Ave S	37th Ave S	Local	Asphalt	25	436	60	1,270	81	71	30	V Good	77
1089	S 142nd Pl	Military Rd S	EAST END	Local	Asphalt	25	208	29	607	91	74	60	Excellent	85
1090	S 142nd Pl	S 142nd Pl	S 142nd Pl	Local	Asphalt	25	146	20	427	98	100	60	Excellent	98
1737	S 142nd St	57th Ave S	59th Ave S	Local	Asphalt	26	426	62	1,292	38	46	60	Marginal	40
1744	S 142nd St	52nd Ave S	53rd Ave S	Local	Asphalt	26	272	39	825	49	46	60	Marginal	47
1743	S 142nd St	42nd Ave S	43rd Ave S	Local	Asphalt	26	318	46	965	50	55	60	Fair	51

City of Tukwila, WA
Street Inventory and Condition Summary - Sorted by Street Name



Street Inventory and Condition Summary - Sorted by Street Name										Condition Summary				
										Surface Distress Index (SDI)	Roughness Index (RI)	Structural Index (SI)	Condition Rating	Current Segment PCI (CPCI)
GISID	On Street	From Street	To Street	FunCL	Pavetype	Pavement Width (ft)	Pavement Length (ft)	Add Area (yd2)	Pavement Area (yd2)					
1739	S 142nd St	WEST END	52nd Ave S	Local	Asphalt	26	85	12	258	82	53	60	V Good	72
1742	S 142nd St	37th Ave S	Tukwila Intl Blvd	Local	Asphalt	25	700	97	2,040	95	87	60	Excellent	92
1353	S 143rd Pl	Interurban Ave S	EAST END	Local	Asphalt	26	839	121	2,545	75	54	60	Good	67
1138	S 143rd St	Interurban Ave S	EAST END	Local	Asphalt	26	1,107	160	3,357	11	57	60	Poor	25
1188	S 144th St	59th Ave S	EAST END	Local	Asphalt	27	218	33	687	45	18	80	Poor	36
1194	S 144th St	46th Ave S	48th Ave S	Collector	Asphalt	29	653	105	2,210	30	70	30	Marginal	42
2073	S 144th St	44th Ln S	46th Ave S	Collector	Asphalt	29	545	88	1,843	31	69	30	Marginal	42
1190	S 144th St	48th Ave S	Macadam Rd S	Collector	Asphalt	29	654	105	2,213	38	70	60	Marginal	47
1193	S 144th St	57th Ave S	58th Ave S	Collector	Asphalt	31	427	74	1,544	57	44	60	Fair	52
1243	S 144th St	58th Ave S	59th Ave S	Local	Asphalt	27	420	63	1,322	59	52	60	Fair	56
2074	S 144th St	42nd Ave S	44th Ln S	Collector	Asphalt	29	777	125	2,630	52	70	60	Fair	57
1187	S 144th St	37th Ave S	Tukwila Intl Blvd	Collector	Asphalt	30	540	90	1,891	59	63	60	Good	59
1677	S 144th St	Military Rd S	34th Ave S	Collector	Asphalt	30	319	53	1,117	51	80	60	Good	60
1192	S 144th St	56th Ave S	57th Ave S	Collector	Concrete	31	425	73	1,538	69	46	60	Good	61
1244	S 144th St	54th Pl S	55th Ave S	Collector	Asphalt	31	129	22	466	63	61	80	Good	62
1678	S 144th St	Tukwila Intl Blvd	41st Ave S	Collector	Asphalt	30	392	65	1,372	73	43	60	Good	62
2015	S 144th St	34th Ln S	37th Ave S	Collector	Asphalt	30	495	82	1,732	61	71	60	Good	64
1245	S 144th St	Macadam Rd S	54th Pl S	Collector	Asphalt	31	343	59	1,241	68	61	60	Good	65
1679	S 144th St	55th Ave S	56th Ave S	Collector	Asphalt	31	421	73	1,523	66	75	60	Good	68
1246	S 144th St	Interurban Ave S	EAST END	Local	Asphalt	27	651	98	2,049	81	56	60	V Good	72
2016	S 144th St	34th Ave S	34th Ln S	Collector	Asphalt	30	289	48	1,012	78	74	60	V Good	76
2079	S 144th St	Macadam Rd S	I-5 Fwy	Collector	Concrete	29	187	30	631	100	51	60	V Good	84
1189	S 144th St	53rd Ave S	Macadam Rd S	Collector	Asphalt	31	106	18	385	94	65	60	V Good	84
1191	S 144th St	41st Ave S	42nd Ave S	Collector	Asphalt	30	390	65	1,365	92	71	60	V Good	84
2076	S 144th St	I-5 Fwy	53rd Ave S	Collector	Asphalt	29	254	41	860	100	68	60	Excellent	89
1361	S 145th St	DS@63E S 145th St	S 145th St	Local	Asphalt	27	95	14	300	90	11	80	Good	63
1367	S 145th St	S 145th St	DS@63E S 145th St	Local	Asphalt	27	63	9	198	98	9	80	Good	68
1509	S 145th St	48th Pl S	EAST END	Local	Asphalt	27	231	35	727	97	48	60	V Good	80
1942	S 146th St	Tukwila Intl Blvd	41st Ave S	Local	Asphalt	25	659	92	1,922	39	48	60	Marginal	41
1803	S 146th St	46th Ave S	48th Pl S	Local	Asphalt	25	793	110	2,312	37	54	60	Marginal	42
1802	S 146th St	48th Pl S	EAST END	Local	Asphalt	26	316	46	958	51	49	60	Fair	49
1801	S 146th St	41st Ave S	42nd Ave S	Local	Asphalt	25	347	48	1,013	48	65	60	Fair	53
1804	S 146th St	35th Ave S	Tukwila Intl Blvd	Local	Asphalt	25	681	95	1,986	63	76	60	Good	66
1805	S 146th St	Military Rd S	35th Ave S	Local	Asphalt	25	435	60	1,267	73	66	60	V Good	70
1806	S 146th St	42nd Ave S	46th Ave S	Local	Asphalt	25	1,318	183	3,845	82	78	60	V Good	80
1757	S 147th St	Interurban Ave S	EAST END	Local	Asphalt	32	120	21	449	78	10	80	Fair	55
1759	S 147th St	59th Ave S	59th Ave S	Collector	Asphalt	35	131	25	535	68	48	60	Good	61
1251	S 147th St	57th Ave S	58th Ave S	Local	Asphalt	26	427	62	1,296	91	55	60	V Good	79
1756	S 147th St	59th Aly S	59th Ave S	Collector	Asphalt	35	99	19	404	94	68	60	Excellent	85
1252	S 147th St	58th Ave S	59th Aly S	Collector	Asphalt	35	205	40	838	93	70	60	Excellent	85
1758	S 147th St	56th Ave S	57th Ave S	Local	Asphalt	26	377	54	1,143	97	65	60	Excellent	86
1272	S 148th St	Tukwila Intl Blvd	42nd Ave S	Local	Asphalt	32	1,233	219	4,604	54	54	60	Fair	53
2071	S 148th St	46th Ave S	46th Ln S	Local	Asphalt	32	255	45	951	69	60	60	Good	65

City of Tukwila, WA
Street Inventory and Condition Summary - Sorted by Street Name



Street Inventory and Condition Summary - Sorted by Street Name

EA

Easy Street Analysis

by IMIS

GISID	On Street	From Street	To Street	FunCL	Pavetype	Pavement Width (ft)	Pavement Length (ft)	Add Area (yd2)	Pavement Area (yd2)	Condition Summary				
										Surface Distress Index (SDI)	Roughness Index (RI)	Structural Index (SI)	Condition Rating	Current Segment PCI (CPCI)
1578	S 148th St	Military Rd S	Tukwila Intl Blvd	Local	Asphalt	32	817	145	3,051	83	70	60	V Good	78
1273	S 148th St	42nd Ave S	46th Ave S	Local	Asphalt	32	1,314	234	4,907	85	73	60	V Good	80
2070	S 148th St	46th Ln S	46th Ln S	Local	Asphalt	32	153	27	572	92	61	60	V Good	81
1345	S 149th St	DS@480E NW END	Interurban Ave S	Local	Asphalt	32	537	95	2,005	37	28	60	Poor	34
1335	S 149th St	WEST END	57th Ave S	Local	Asphalt	32	656	117	2,447	78	38	60	Good	64
1506	S 149th St	59th Ave S	62nd Ave S	Local	Asphalt	32	674	120	2,518	86	64	60	V Good	78
1501	S 150th Pl	WEST END	57th Ave S	Local	Asphalt	32	767	136	2,864	88	63	60	V Good	79
1350	S 150th St	42nd Ave S	43rd Pl S	Local	Asphalt	32	527	94	1,966	70	52	60	Good	63
1354	S 150th St	Macadam Rd S	EAST END	Local	Asphalt	32	767	136	2,865	79	48	60	Good	68
1369	S 150th St	Tukwila Intl Blvd	38th Ave S	Local	Asphalt	32	530	94	1,977	85	55	60	V Good	74
1349	S 150th St	43rd Pl S	46th Ave S	Local	Asphalt	32	788	140	2,941	84	64	60	V Good	77
1376	S 150th St	41st Pl S	42nd Ave S	Local	Asphalt	32	242	43	903	84	64	60	V Good	77
1358	S 150th St	46th Ave S	EAST END	Local	Asphalt	32	898	160	3,353	87	60	60	V Good	77
1359	S 150th St	Military Rd S	Tukwila Intl Blvd	Local	Asphalt	32	523	93	1,951	93	64	60	V Good	83
1374	S 150th St	38th Ave S	41st Pl S	Local	Asphalt	32	688	122	2,570	97	75	60	Excellent	89
1662	S 151st Pl	EAST END	EAST END	Local	Asphalt	32	183	32	682	48	29	80	Marginal	41
1607	S 151st Pl	WEST END	63rd Pl S	Local	Asphalt	32	98	17	365	47	41	60	Marginal	44
1546	S 151st Pl	63rd Pl S	EAST END	Local	Asphalt	32	161	29	600	69	65	60	Good	67
1606	S 151st Pl	EAST END	EAST END	Local	Asphalt	32	182	32	680	69	83	60	V Good	73
1299	S 151st St	DS@90E S 151st St	S 151st St	Local	Asphalt	32	44	8	164	74	9	80	Fair	52
1544	S 151st St	S 151st St	DS@90E S 151st St	Local	Asphalt	32	90	16	334	80	32	80	Good	63
1542	S 151st St	51st Ave S	52nd Ave S	Local	Asphalt	32	375	67	1,401	71	50	60	Good	63
1543	S 151st St	WEST END	42nd Ave S	Local	Asphalt	32	220	39	822	85	52	60	V Good	74
1298	S 151st St	62nd Ave S	63rd Pl S	Collector	Asphalt	35	310	60	1,266	75	76	60	V Good	75
1300	S 151st St	63rd Pl S	65th Ave S	Collector	Asphalt	35	332	65	1,357	75	77	60	V Good	75
1995	S 152nd Pl	57th Ave S	EAST END	Local	Asphalt	26	458	66	1,391	60	47	60	Fair	55
1718	S 152nd St	International Blvd	37th Pl S	Local	Asphalt	26	717	104	2,176	26	50	60	Poor	33
1720	S 152nd St	WEST END	51st Ave S	Local	Asphalt	25	271	38	791	59	59	80	Fair	58
1108	S 152nd St	40th Ave S	42nd Ave S	Local	Asphalt	25	315	44	919	79	50	80	Good	69
1716	S 152nd St	57th Ave S	EAST END	Local	Asphalt	26	537	78	1,628	93	34	80	V Good	73
1717	S 152nd St	Macadam Rd S	57th Ave S	Local	Asphalt	26	895	129	2,714	92	60	60	V Good	81
1719	S 152nd St	37th Pl S	40th Ave S	Local	Asphalt	26	656	95	1,989	96	63	60	Excellent	85
1661	S 153rd St	65th Ave S	EAST END	Local	Asphalt	27	659	99	2,075	72	43	60	Good	62
1585	S 153rd St	64th Ave S	65th Ave S	Local	Asphalt	26	410	59	1,245	66	61	60	Good	63
1584	S 153rd St	62nd Ave S	64th Ave S	Local	Asphalt	26	590	85	1,789	76	50	60	Good	67
2023	S 156th St	44th Ave S	44th Pl S	Local	Asphalt	27	407	61	1,283	72	63	60	Good	69
1197	S 156th St	I-405 Ramp	Nelsen Pl	Local	Asphalt	26	431	62	1,306	85	77	60	V Good	82
2022	S 156th St	44th Pl S	47th Ave S	Local	Asphalt	25	415	58	1,210	98	76	60	Excellent	90
1525	S 158th St	42nd Ave S	44th Ave S	Local	Asphalt	25	740	103	2,160	80	60	60	V Good	73
1526	S 158th St	Military Rd S	38th Pl S	Local	Asphalt	27	870	131	2,741	85	62	60	V Good	77
1556	S 158th St	40th Ln S	42nd Ave S	Local	Asphalt	26	350	51	1,062	90	62	60	V Good	81
1650	S 158th St	38th Pl S	39th Pl S	Local	Asphalt	25	100	14	290	94	62	60	V Good	83
1852	S 158th St	S 160th St	Military Rd S	Local	Asphalt	27	135	20	425	79	94	60	V Good	84

City of Tukwila, WA
Street Inventory and Condition Summary - Sorted by Street Name



GISID	On Street	From Street	To Street	FunCL	Pavetype	Pavement Width (ft)	Pavement Length (ft)	Add Area (yd2)	Pavement Area (yd2)	Condition Summary				
										Surface Distress Index (SDI)	Roughness Index (RI)	Structural Index (SI)	Condition Rating	Current Segment PCI (CPCI)
1527	S 158th St	44th Ave S	47th Ave S	Local	Asphalt	25	856	119	2,497	93	71	60	Excellent	85
1649	S 158th St	38th Pl S	38th Pl S	Local	Asphalt	28	38	6	125	95	81	60	Excellent	90
1646	S 158th St	40th Pl S	40th Ln S	Local	Asphalt	27	184	28	581	100	72	60	Excellent	90
1522	S 158th St	39th Pl S	40th Pl S	Local	Asphalt	25	277	38	807	100	79	60	Excellent	92
1807	S 159th St	51st Ave S	53rd Ave S	Local	Asphalt	25	721	100	2,103	76	60	80	V Good	70
1907	S 160th St	42nd Ave S	43rd Ave S	Collector	Asphalt	29	348	56	1,178	69	53	60	Good	63
1476	S 160th St	43rd Ave S	46th Ave S	Collector	Asphalt	29	1,029	166	3,482	63	74	60	Good	66
1909	S 160th St	51st Ave S	Slade Way	Collector	Asphalt	28	802	125	2,620	65	74	60	Good	67
1468	S 160th St	48th Ave S	51st Ave S	Collector	Asphalt	28	689	107	2,251	71	66	60	Good	68
1469	S 160th St	46th Ave S	47th Ave S	Collector	Asphalt	29	302	49	1,023	70	69	60	Good	69
1908	S 160th St	47th Ave S	48th Ave S	Collector	Asphalt	28	300	47	979	73	64	60	V Good	69
1545	S 161st St	S 161st St	DS@78W S 161st St	Local	Asphalt	24	78	10	219	69	15	80	Fair	50
1797	S 161st St	DS@78W S 161st St	S 161st St	Local	Asphalt	24	79	11	221	82	22	80	Good	61
1798	S 161st St	WEST END	51st Ave S	Local	Asphalt	24	364	49	1,020	84	70	60	V Good	79
1219	S 162nd St	48th Ave S	EAST END	Local	Asphalt	25	301	42	879	29	14	60	V Poor	23
1220	S 162nd St	46th Ave S	EAST END	Local	Asphalt	24	125	17	350	64	11	80	Marginal	45
1261	S 163rd Pl	S 163rd Pl	S 163rd Pl	Local	Asphalt	26	139	20	421	34	0	80	V Poor	22
1263	S 163rd Pl	51st Ave S	EAST END	Local	Asphalt	26	483	70	1,465	41	41	60	Marginal	40
1262	S 163rd Pl	45th Pl S	46th Ave S	Local	Asphalt	25	140	19	409	79	25	80	Good	60
1264	S 163rd Pl	45th Ave S	45th Pl S	Local	Asphalt	25	142	20	413	72	63	60	Good	68
1493	S 164th St	48th Pl S	49th Ave S	Collector	Asphalt	32	202	36	756	47	60	30	Fair	50
1492	S 164th St	51st Ave S	52nd Ave S	Local	Asphalt	25	545	76	1,590	63	45	60	Fair	56
1490	S 164th St	42nd Ave S	47th Ave S	Collector	Asphalt	31	1,551	267	5,609	60	68	30	Good	62
1491	S 164th St	49th Ave S	51st Ave S	Collector	Asphalt	32	379	67	1,413	75	58	60	Good	69
1404	S 164th St	47th Ave S	47th Pl S	Collector	Asphalt	31	121	21	436	85	57	60	V Good	75
1489	S 164th St	47th Pl S	48th Pl S	Collector	Asphalt	31	389	67	1,406	84	69	60	V Good	79
1565	S 166th St	53rd Ave S	54th Ave S	Local	Asphalt	26	270	39	820	56	51	60	Fair	54
2155	S 166th St	S 166th St	51st Ave S	Collector	Asphalt	35	152	30	622	44	79	30	Fair	54
1215	S 166th St	CITY LIMIT	53rd Ave S	Local	Asphalt	25	190	26	554	64	54	60	Good	60
1910	S 168th St	WEST END	Southcenter Pkwy	Local	Asphalt	27	276	41	869	26	3	80	V Poor	18
1003	S 168th St	Southcenter Pkwy	DS@359E Southcenter Pkwy	Local	Asphalt	25	359	50	1,047	81	66	60	V Good	76
1101	S 180th St	West Valley Hwy	S 180th St	Principal Arterial	Asphalt	45	1,234	308	6,478	42	55	60	Marginal	45
1723	S 180th St	Andover Park W	Andover Park E	Minor Arterial	Asphalt	45	918	229	4,818	44	62	60	Fair	49
1223	S 180th St	Andover Park E	Sperry Dr	Minor Arterial	Asphalt	45	881	220	4,624	46	63	60	Fair	51
1222	S 180th St	Sperry Dr	West Valley Hwy	Minor Arterial	Asphalt	45	528	132	2,775	55	60	60	Fair	56
1100	S 180th St	Southcenter Pkwy	Andover Park W	Minor Arterial	Asphalt	45	1,434	358	7,526	68	69	60	Good	67
1465	S 184th Pl	54th Pl S	Southcenter Pkwy	Minor Arterial	Asphalt	45	2,072	518	10,880	75	71	60	V Good	73
1097	S 200th St	46th Ave S	Southcenter Pkwy	Principal Arterial	Asphalt	56	1,315	409	8,593	95	81	60	Excellent	89
1888	S 200th St	Orillia Rd S	46th Ave S	Principal Arterial	Asphalt	56	247	77	1,617	99	75	60	Excellent	90
1454	S 200th St	Southcenter Pkwy	CITY LIMIT	Principal Arterial	Asphalt	56	1,439	448	9,399	93	91	60	Excellent	91
1120	S 204th St	Orillia Rd S	Frager Rd	Local	Asphalt	25	3,339	464	9,737	20	57	60	Poor	31
1494	S Glacier St	WEST END	Olympic Ave S	Local	Asphalt	27	250	38	788	86	66	60	V Good	79
1405	S Glacier St	Olympic Ave S	Cascade Ave S	Local	Asphalt	26	609	88	1,848	78	87	60	V Good	81

City of Tukwila, WA
Street Inventory and Condition Summary - Sorted by Street Name



GISID	On Street	From Street	To Street	FunCL	Pavetype	Pavement Width (ft)	Pavement Length (ft)	Add Area (yd2)	Pavement Area (yd2)	Condition Summary				
										Surface Distress Index (SDI)	Roughness Index (RI)	Structural Index (SI)	Condition Rating	Current Segment PCI (CPCI)
1707	S Norfolk St	East Marginal Way S	CITY LIMIT	Local	Asphalt	25	737	102	2,150	64	78	60	Good	68
1420	S Ryan St	Beacon Ave S	51st Ave S	Minor Arterial	Asphalt	45	349	87	1,832	30	67	60	Marginal	41
1377	S Ryan Way	47th Ave S	S 107th St	Minor Arterial	Asphalt	45	227	57	1,189	15	56	60	Poor	28
1826	S Ryan Way	S 107th St	Beacon Ave S	Minor Arterial	Asphalt	45	1,126	281	5,910	13	60	60	Poor	28
1827	S Ryan Way	Martin L King Jr Way S	47th Ave S	Minor Arterial	Asphalt	45	978	244	5,132	21	54	60	Poor	31
1394	S Wallace St	NW END	CITY LIMIT	Local	Asphalt	26	328	47	996	54	31	80	Marginal	45
1621	Slade Way	53rd Pl S	54th Ave S	Local	Asphalt	25	314	44	915	54	59	60	Fair	55
1622	Slade Way	S 160th St	53rd Pl S	Local	Asphalt	26	837	121	2,539	65	54	80	Good	61
1168	Southcenter Blvd	40th Ave S	42nd Ave S	Minor Arterial	Asphalt	44	566	138	2,906	44	58	60	Marginal	48
1342	Southcenter Blvd	38th Ln S	40th Ave S	Minor Arterial	Asphalt	42	432	101	2,118	52	57	60	Fair	53
1413	Southcenter Blvd	40th Ave S	40th Ave S	Minor Arterial	Asphalt	42	145	34	711	54	64	60	Fair	56
1340	Southcenter Blvd	42nd Ave S	51st Ave S	Minor Arterial	Asphalt	44	2,694	658	13,828	62	72	30	Good	64
1818	Southcenter Blvd	International Blvd	38th Ln S	Minor Arterial	Asphalt	45	838	210	4,402	70	66	60	Good	68
2043	Southcenter Blvd	53rd Ave S	I-5 Ramp	Minor Arterial	Asphalt	45	171	43	898	69	67	60	Good	68
1507	Southcenter Blvd	Interurban Ave S	Interurban Ave S	Local	Asphalt	25	261	36	761	72	62	60	Good	68
2031	Southcenter Blvd	I-5 Ramp	I-405 Ramp	Minor Arterial	Asphalt	40	362	80	1,688	68	73	60	Good	69
1348	Southcenter Blvd	I-405 Ramp	I-405 Ramp	Principal Arterial	Asphalt	45	452	113	2,374	71	71	60	V Good	70
1337	Southcenter Blvd	52nd Ave S	53rd Ave S	Minor Arterial	Asphalt	45	301	75	1,582	75	63	60	V Good	70
1820	Southcenter Blvd	62nd Ave S	65th Ave S	Principal Arterial	Asphalt	44	1,142	279	5,860	70	78	30	V Good	72
2025	Southcenter Blvd	51st Ave S	52nd Ave S	Minor Arterial	Asphalt	45	371	93	1,948	76	71	60	V Good	74
1416	Southcenter Blvd	61st Ave S	62nd Ave S	Principal Arterial	Asphalt	44	469	115	2,406	81	65	60	V Good	75
2039	Southcenter Blvd	I-5 Fwy	I-5 Fwy	Minor Arterial	Asphalt	41	99	23	474	71	88	60	V Good	76
1629	Southcenter Blvd	65th Ave S	66th Ave S	Principal Arterial	Asphalt	44	587	144	3,015	78	77	60	V Good	77
2042	Southcenter Blvd	I-5 Ramp	I-5 Fwy	Minor Arterial	Asphalt	45	69	17	360	81	78	60	V Good	79
2033	Southcenter Blvd	I-5 Fwy	I-5 Ramp	Minor Arterial	Asphalt	39	29	6	131	83	77	60	V Good	81
2035	Southcenter Blvd	I-5 Ramp	I-5 Fwy	Minor Arterial	Asphalt	41	76	17	365	86	75	60	V Good	82
1686	Southcenter Blvd	66th Ave S	I-405 Ramp	Local	Asphalt	25	649	90	1,894	87	74	60	V Good	82
2037	Southcenter Blvd	I-5 Fwy	I-5 Ramp	Minor Arterial	Asphalt	41	68	16	326	83	86	60	V Good	84
1347	Southcenter Blvd	I-405 Ramp	DS@398E I-405 Ramp	Principal Arterial	Asphalt	45	398	99	2,088	90	77	60	Excellent	85
1821	Southcenter Blvd	DS@398E I-405 Ramp	61st Ave S	Principal Arterial	Asphalt	44	779	190	3,999	90	81	60	Excellent	86
1554	Southcenter Blvd	I-405 Ramp	Interurban Ave S	Local	Asphalt	27	77	12	242	92	85	60	Excellent	89
2041	Southcenter Blvd	I-5 Fwy	I-5 Fwy	Minor Arterial	Asphalt	56	38	12	248	90	93	60	Excellent	90
1415	Southcenter Blvd	I-405 Ramp	I-405 Ramp	Local	Asphalt	26	60	9	183	98	86	60	Excellent	93
1685	Southcenter Blvd	I-5 Ramp	Southcenter Blvd	Principal Arterial	Asphalt	45	300	75	1,575	100	83	60	Excellent	93
1691	Southcenter Pkwy	Wig Blvd	Minkler Blvd	Minor Arterial	Asphalt	45	599	150	3,146	48	62	60	Fair	52
1464	Southcenter Pkwy	S 168th St	S 168th St	Minor Arterial	Asphalt	45	64	16	337	49	62	60	Fair	52
1774	Southcenter Pkwy	S 168th St	Wig Blvd	Minor Arterial	Asphalt	45	666	167	3,497	53	72	60	Fair	59
1776	Southcenter Pkwy	I-5 Ramp	Strander Blvd	Minor Arterial	Asphalt	45	218	54	1,144	61	61	60	Good	60
1775	Southcenter Pkwy	Strander Blvd	S 168th St	Minor Arterial	Asphalt	45	1,313	328	6,894	69	61	60	Good	66
1767	Southcenter Pkwy	I-5 Ramp	I-5 Ramp	Minor Arterial	Asphalt	45	162	41	851	77	63	60	V Good	72
2063	Southcenter Pkwy	Minkler Blvd	S 180th St	Minor Arterial	Asphalt	45	2,716	679	14,257	72	74	60	V Good	72
1769	Southcenter Pkwy	Southcenter Mall	I-5 Ramp	Minor Arterial	Asphalt	45	622	156	3,267	73	82	60	V Good	75
1467	Southcenter Pkwy	S 180th St	A Line	Minor Arterial	Asphalt	45	900	225	4,728	85	78	60	V Good	82

City of Tukwila, WA
Street Inventory and Condition Summary - Sorted by Street Name



GISID	On Street	From Street	To Street	FunCL	Pavetype	Pavement Width (ft)	Pavement Length (ft)	Add Area (yd2)	Pavement Area (yd2)	Condition Summary				
										Surface Distress Index (SDI)	Roughness Index (RI)	Structural Index (SI)	Condition Rating	Current Segment PCI (CPCI)
1768	Southcenter Pkwy	Klickitat Dr	I-5 Ramp	Minor Arterial	Asphalt	45	361	90	1,894	81	91	60	V Good	84
1352	Southcenter Pkwy	UnNamed-01545	S 200th St	Minor Arterial	Asphalt	45	752	188	3,945	87	81	60	Excellent	85
1770	Southcenter Pkwy	I-5 Ramp	Klickitat Dr	Minor Arterial	Asphalt	45	383	96	2,012	91	79	60	Excellent	86
1693	Southcenter Pkwy	Segale Park C Dr	B Line	Minor Arterial	Asphalt	45	977	244	5,130	88	88	60	Excellent	88
1472	Southcenter Pkwy	A Line	Segale Park C Dr	Minor Arterial	Asphalt	45	613	153	3,217	87	92	60	Excellent	88
1778	Southcenter Pkwy	S 19400 Block	UnNamed-01543	Minor Arterial	Asphalt	45	1,150	287	6,037	92	86	60	Excellent	89
1773	Southcenter Pkwy	S 19000 Block	S 19400 Block	Minor Arterial	Asphalt	45	1,030	257	5,407	91	90	60	Excellent	90
1343	Southcenter Pkwy	UnNamed-01543	UnNamed-01545	Minor Arterial	Asphalt	45	540	135	2,835	92	89	60	Excellent	90
1695	Southcenter Pkwy	B Line	C Line	Minor Arterial	Asphalt	45	650	163	3,413	93	88	60	Excellent	91
1764	Southcenter Pkwy	C Line	S 19000 Block	Minor Arterial	Asphalt	45	770	192	4,042	93	91	60	Excellent	91
1704	Starfire Way	Starfire Way	DS@1178E Starfire Way	Local	Asphalt	25	1,178	164	3,437	23	58	60	Poor	34
1705	Starfire Way	DS@1178E Starfire Way	Fort Dent Way	Local	Asphalt	27	1,353	203	4,262	86	55	60	V Good	76
1302	Strander Blvd	West Valley Hwy	EAST END	Local	Asphalt	26	239	34	724	9	29	60	V Poor	15
1304	Strander Blvd	Christensen Rd	West Valley Hwy	Minor Arterial	Asphalt	48	847	226	4,744	44	54	60	Marginal	46
1305	Strander Blvd	Andover Park W	Andover Park E	Minor Arterial	Asphalt	48	1,077	287	6,031	45	62	60	Fair	49
1306	Strander Blvd	Andover Park E	Christensen Rd	Minor Arterial	Asphalt	48	771	206	4,319	50	63	60	Fair	53
1303	Strander Blvd	Southcenter Pkwy	61st Pl S	Minor Arterial	Asphalt	47	1,350	353	7,404	58	62	60	Fair	58
1307	Strander Blvd	61st Pl S	Andover Park W	Minor Arterial	Asphalt	47	662	173	3,630	65	65	30	Good	64
1551	SW Grady Way	Interurban Ave S	Interurban Ave S	Local	Asphalt	27	154	23	485	48	52	60	Marginal	48
1346	SW Grady Way	Interurban Ave S	Fun Center Way	Minor Arterial	Asphalt	45	117	29	612	66	59	60	Good	62
1819	SW Grady Way	Fun Center Way	CITY LIMIT	Minor Arterial	Concrete	32	1,024	182	3,823	100	73	60	Excellent	91
1291	Todd Blvd	Cascade Ave S	West Valley Hwy S	Local	Asphalt	25	353	49	1,028	71	71	60	V Good	71
1290	Todd Blvd	Olympic Ave S	Cascade Ave S	Local	Asphalt	32	642	114	2,398	71	74	60	V Good	71
1845	Treck Dr	Treck Dr	Treck Dr	Local	Asphalt	27	204	31	642	30	64	60	Marginal	40
1384	Treck Dr	WEST END	Andover Park E	Local	Asphalt	25	543	75	1,584	65	73	60	Good	67
1129	Triland Dr	WEST END	Andover Park W	Local	Asphalt	27	1,174	176	3,698	29	63	60	Poor	39
1104	Tukwila International Blvd	SR 99 Ramp	Tukwila Intl Blvd	Principal Arterial	Asphalt	56	2,111	657	13,794	77	88	60	V Good	80
2002	Tukwila International Blvd	Tukwila Intl Blvd	S 132nd St	Principal Arterial	Asphalt	56	302	94	1,973	88	86	60	Excellent	86
1082	Tukwila Intl Blvd	DS@172S Boeing Access Rd	DS@608S Boeing Access Rd	Local	Asphalt	25	436	61	1,272	34	60	60	Marginal	42
1075	Tukwila Intl Blvd	DS@608S East Marginal Way S	S 112th St	Principal Arterial	Asphalt	44	1,027	251	5,271	43	73	60	Fair	51
1077	Tukwila Intl Blvd	SR 99 Ramp	SR 99	Principal Arterial	Asphalt	56	230	72	1,502	51	63	60	Fair	54
1073	Tukwila Intl Blvd	S 112th St	SR 99 Ramp	Principal Arterial	Asphalt	56	1,193	371	7,794	46	75	60	Fair	55
1081	Tukwila Intl Blvd	Tukwila Intl Blvd	East Marginal Way S	Principal Arterial	Asphalt	56	144	45	942	67	47	60	Good	59
1885	Tukwila Intl Blvd	S 144th St	S 146th St	Principal Arterial	Asphalt	56	699	218	4,569	52	79	30	Good	60
1080	Tukwila Intl Blvd	S 116th Way	SR 99	Principal Arterial	Asphalt	56	634	197	4,143	55	81	30	Good	62
2123	Tukwila Intl Blvd	DS@36W Boeing Access Rd	DS@172S Boeing Access Rd	Local	Asphalt	32	136	24	507	71	49	60	Good	63
2124	Tukwila Intl Blvd	DS@91S East Marginal Way S	DS@509S East Marginal Way S	Principal Arterial	Asphalt	56	418	130	2,734	59	80	30	Good	65
1715	Tukwila Intl Blvd	SR 599	S 116th Way	Principal Arterial	Asphalt	56	121	38	790	65	77	60	Good	68
1884	Tukwila Intl Blvd	S 146th St	S 148th St	Principal Arterial	Asphalt	56	699	217	4,567	68	73	60	Good	69
1437	Tukwila Intl Blvd	S 150th St	S 152nd St	Principal Arterial	Asphalt	56	704	219	4,600	70	71	60	V Good	69
1078	Tukwila Intl Blvd	SR 599 Ramp	SR 99 Ramp	Principal Arterial	Asphalt	56	196	61	1,281	69	75	60	V Good	70
2126	Tukwila Intl Blvd	East Marginal Way S	DS@91S East Marginal Way S	Principal Arterial	Asphalt	56	91	28	592	79	58	60	V Good	72
1886	Tukwila Intl Blvd	S 142nd St	S 144th St	Principal Arterial	Asphalt	56	679	211	4,434	69	81	60	V Good	72

City of Tukwila, WA
Street Inventory and Condition Summary - Sorted by Street Name





Street Inventory and Condition Summary - Sorted by Street Name

Condition Summary

GISID	On Street	From Street	To Street	FunCL	Pavetype	Pavement Width (ft)	Pavement Length (ft)	Add Area (yd2)	Pavement Area (yd2)	Surface Distress Index (SDI)	Roughness Index (RI)	Structural Index (SI)	Condition Rating	Current Segment PCI (CPCI)
1079	Tukwila Intl Blvd	SR 99 Ramp	SR 599 Ramp	Principal Arterial	Asphalt	56	107	33	696	74	71	60	V Good	72
2125	Tukwila Intl Blvd	East Marginal Way S	DS@36W Boeing Access Rd	Local	Asphalt	24	36	5	101	87	45	80	V Good	72
1439	Tukwila Intl Blvd	S 148th St	S 150th St	Principal Arterial	Asphalt	56	700	218	4,571	73	76	60	V Good	74
1084	Tukwila Intl Blvd	DS@193S East Marginal Way S	Tukwila Intl Blvd	Local	Asphalt	32	209	37	781	80	68	60	V Good	75
1083	Tukwila Intl Blvd	DS@509S East Marginal Way S	Tukwila Intl Blvd	Principal Arterial	Asphalt	56	146	45	955	76	78	60	V Good	76
1105	Tukwila Intl Blvd	S 141st St	S 141st St	Principal Arterial	Asphalt	56	127	39	829	76	79	60	V Good	76
1074	Tukwila Intl Blvd	East Marginal Way S	DS@193S East Marginal Way S	Local	Asphalt	22	193	24	496	87	61	60	V Good	78
1438	Tukwila Intl Blvd	S 139th St	S 140th St	Principal Arterial	Asphalt	56	340	106	2,223	77	82	60	V Good	78
2003	Tukwila Intl Blvd	S 130th St	35th Ave S	Principal Arterial	Asphalt	56	346	107	2,257	82	72	60	V Good	78
1887	Tukwila Intl Blvd	S 140th St	S 141st St	Principal Arterial	Asphalt	56	238	74	1,553	76	87	60	V Good	79
1672	Tukwila Intl Blvd	S 141st St	S 142nd St	Principal Arterial	Asphalt	56	344	107	2,247	76	86	60	V Good	79
1076	Tukwila Intl Blvd	SR 99	SR 599	Principal Arterial	Asphalt	56	192	60	1,255	78	86	60	V Good	80
2010	Tukwila Intl Blvd	S 132nd St	37th Ave S	Principal Arterial	Asphalt	56	604	188	3,947	84	79	60	V Good	82
1429	Tukwila Intl Blvd	SR 99	SR 99 Ramp	Principal Arterial	Asphalt	56	1,468	457	9,590	78	92	60	V Good	82
2009	Tukwila Intl Blvd	37th Ave S	S 139th St	Principal Arterial	Asphalt	56	2,015	627	13,167	83	87	60	V Good	83
1055	Tukwila Pkwy	61st Ave S	I-405 Ramp	Minor Arterial	Asphalt	65	506	183	3,835	81	78	60	V Good	79
1056	Tukwila Pkwy	I-405 Ramp	Andover Park W	Minor Arterial	Asphalt	66	574	210	4,418	85	75	60	V Good	81
2133	Tukwila Pkwy	Andover Park E	I-405 Ramp	Minor Arterial	Asphalt	67	458	171	3,582	91	63	60	V Good	81
1053	Tukwila Pkwy	Andover Park W	Andover Park E	Minor Arterial	Asphalt	68	1,088	411	8,632	88	76	60	V Good	83
1054	Tukwila Pkwy	Southcenter Mall	61st Ave S	Minor Arterial	Asphalt	70	1,193	464	9,740	90	82	60	Excellent	87
1746	Upland Dr	WEST END	Andover Park W	Local	Asphalt	20	919	102	2,144	81	80	60	V Good	80
1518	West Marginal PI S	CITY LIMIT	S 102nd St	Local	Asphalt	21	2,203	257	5,397	8	63	30	Poor	25
1550	West Valley Hwy	Longacres Way	Strander Blvd	Principal Arterial	Asphalt	56	1,529	476	9,991	67	74	30	Good	68
1292	West Valley Hwy	Interurban Ave S	I-405 Ramp	Principal Arterial	Asphalt	55	556	170	3,567	70	75	60	V Good	71
1295	West Valley Hwy	I-405 Ramp	Longacres Way	Principal Arterial	Asphalt	56	594	185	3,884	80	75	30	V Good	78
1293	West Valley Hwy	Strander Blvd	S 180th St	Principal Arterial	Asphalt	58	5,933	1,912	40,149	75	86	30	V Good	78
1294	West Valley Hwy	S 180th St	Todd Blvd	Principal Arterial	Asphalt	60	2,082	694	14,573	83	81	60	V Good	81
1498	West Valley Hwy S	Todd Blvd	CITY LIMIT	Principal Arterial	Asphalt	59	975	319	6,708	74	79	60	V Good	75
1665	Wig Blvd	Southcenter Pkwy	Bauch Dr	Local	Asphalt	22	1,325	162	3,401	73	62	60	Good	69

City of Tukwila, WA

Street Inventory and Five Year Rehabilitation Plan By Year



\$1400k/Year Rehabilitation Plan

GISID	On Street	From Street	To Street	Current Segment PCI (CPCI)	Year of First Rehab	Rehab Activity	Avg Unit Rate (\$/yd2)	Segment Pavement Cost (\$)	Segment Total Cost (\$)	Whole Project Cost (\$)	5 Year Post Rehab PCI
1832	47th Ave S	S Ryan Way	S 109th St	28	1	FWM + Thick Overlay (> 2.0 - 3.0) + Strctrl Ptch	47.50	78,328	78,328	78,328	89
1568	57th Ave S	S 141st St	S 142nd St	41	1	FWM + Thick Overlay (> 2.0 - 3.0)	43.50	35,627	35,627	35,627	89
1403	57th Ave S	S 144th St	S 147th St	29	1	FWM + Thick Overlay (> 2.0 - 3.0) + Strctrl Ptch	47.50	124,308	124,308	124,308	89
1651	Airport Way S	DS@581E Boeing Access Rd	Boeing Access Rd	27	1	FWM + Thick Overlay (> 2.0 - 3.0) + Strctrl Ptch	52.50	125,580	125,580	125,580	88
1341	Frager Rd	S 204th St	S 204th St	50	1	Edge Mill + Thin Overlay (1.5 - 2.0) + Strctrl Ptch	29.27	322	322	322	87
1593	Midland Dr	WEST END	Andover Park W	28	1	FWM + Thick Overlay (> 2.0 - 3.0) + Strctrl Ptch	47.50	109,773	109,773	109,773	89
1799	S 109th St	Beacon Ave S	Beacon Ave S	48	1	EM/FWM + Moderate Overlay (2.0 - 3.0) + Strctrl Ptch	37.67	113	113	113	88
1520	S 133rd St	34th Ave S	35th Ave S	39	1	FWM + Thick Overlay (> 2.0 - 3.0)	43.50	34,496	34,496	63,728	89
1642	S 133rd St	35th Ave S	EAST END	41	1	FWM + Thick Overlay (> 2.0 - 3.0)	43.50	29,232	29,232	63,728	89
1637	S 137th St	53rd Ave S	56th Ave S	61	1	Edge Mill + Thin Overlay (1.5 - 2.0)	25.00	17,625	17,625	17,625	87
1959	S 138th St	Macadam Rd S	NE END	26	1	FWM + Thick Overlay (> 2.0 - 3.0) + Strctrl Ptch	47.50	40,185	40,185	40,185	89
1739	S 142nd St	WEST END	52nd Ave S	72	1	MicroSurface / Chip Seal	7.50	1,935	1,935	1,935	83
1138	S 143rd St	Interurban Ave S	EAST END	25	1	FWM + Thick Overlay (> 2.0 - 3.0) + Strctrl Ptch	47.50	159,458	159,458	159,458	89
1827	S Ryan Way	Martin L King Jr Way S	47th Ave S	31	1	FWM + Thick Overlay (> 2.0 - 3.0) + Strctrl Ptch	52.50	269,430	269,430	642,128	88
1377	S Ryan Way	47th Ave S	S 107th St	28	1	FWM + Thick Overlay (> 2.0 - 3.0) + Strctrl Ptch	52.50	62,423	62,423	642,128	88
1826	S Ryan Way	S 107th St	Beacon Ave S	28	1	FWM + Thick Overlay (> 2.0 - 3.0) + Strctrl Ptch	52.50	310,275	310,275	642,128	88
2125	Tukwila Intl Blvd	East Marginal Way S	DS@36W Boeing Access Rd	72	1	MicroSurface / Chip Seal	7.50	758	758	758	84
1233	35th Ave S	S 146th St	SOUTH END	43	2	FWM + Thick Overlay (> 2.0 - 3.0)	44.80	46,104	46,104	46,104	91
1308	38th Ave S	S 130th St	SOUTH END	44	2	FWM + Thick Overlay (> 2.0 - 3.0) + Strctrl Ptch	46.86	72,500	72,500	72,500	90
1179	42nd Ave S	S 126th St	SE END	72	2	MicroSurface / Chip Seal	7.73	3,693	3,693	3,693	84
1217	45th Pl S	45th Pl S	DS@65S 45th Pl S	62	2	MicroSurface / Chip Seal + Strctrl Ptch	9.27	1,835	1,835	3,448	85
1231	45th Pl S	DS@65S 45th Pl S	45th Pl S	63	2	MicroSurface / Chip Seal + Strctrl Ptch	9.27	1,613	1,613	3,448	85
1448	48th Ave S	S 162nd St	SOUTH END	30	2	FWM + Thick Overlay (> 2.0 - 3.0) + Strctrl Ptch	48.93	17,907	17,907	17,907	91
1566	57th Ave S	S 150th Pl	SOUTH END	43	2	FWM + Thick Overlay (> 2.0 - 3.0)	44.81	27,869	27,869	27,869	91
1118	S 107th St	S Ryan Way	EAST END	31	2	FWM + Thick Overlay (> 2.0 - 3.0) + Strctrl Ptch	48.92	34,492	34,492	34,492	91
2100	S 116th St	East Marginal Way S	35th Ln S	63	2	MicroSurface / Chip Seal + Strctrl Ptch	9.27	4,644	4,644	4,644	85
2001	S 133rd St	57th Ave S	57th Ave S	83	2	Slurry Seal / Seal Coat	5.24	173	173	173	84
2084	S 136th St	WEST END	52nd Pl S	41	2	FWM + Thick Overlay (> 2.0 - 3.0)	44.81	11,739	11,739	53,273	91
2083	S 136th St	52nd Pl S	52nd Ave S	43	2	FWM + Thick Overlay (> 2.0 - 3.0)	44.80	41,534	41,534	53,273	91
1587	S 141st St	Tukwila Intl Blvd	42nd Ave S	43	2	FWM + Thick Overlay (> 2.0 - 3.0)	44.80	73,883	73,883	73,883	91
2073	S 144th St	44th Ln S	46th Ave S	42	2	FWM + Thick Overlay (> 2.0 - 3.0) + Strctrl Ptch	48.93	90,169	90,169	306,564	90
1194	S 144th St	46th Ave S	48th Ave S	42	2	FWM + Thick Overlay (> 2.0 - 3.0) + Strctrl Ptch	48.92	108,124	108,124	306,564	90
1190	S 144th St	48th Ave S	Macadam Rd S	47	2	FWM + Thick Overlay (> 2.0 - 3.0) + Strctrl Ptch	48.92	108,271	108,271	306,564	90
1942	S 146th St	Tukwila Intl Blvd	41st Ave S	41	2	FWM + Thick Overlay (> 2.0 - 3.0)	44.80	86,115	86,115	131,502	91
1801	S 146th St	41st Ave S	42nd Ave S	53	2	FWM + Thick Overlay (> 2.0 - 3.0)	44.80	45,387	45,387	131,502	91
1803	S 146th St	46th Ave S	48th Pl S	42	2	FWM + Thick Overlay (> 2.0 - 3.0)	44.80	103,589	103,589	146,512	91
1802	S 146th St	48th Pl S	EAST END	49	2	FWM + Thick Overlay (> 2.0 - 3.0)	44.80	42,923	42,923	146,512	91
1120	S 204th St	Orillia Rd S	Frager Rd	31	2	FWM + Thick Overlay (> 2.0 - 3.0) + Strctrl Ptch	48.93	476,383	476,383	476,383	91
2008	37th Ave S	Tukwila Intl Blvd	S 135th St	48	3	FWM + Thick Overlay (> 2.0 - 3.0)	46.15	87,776	87,776	87,776	92

City of Tukwila, WA
Street Inventory and Five Year Rehabilitation Plan By Year



\$1400k/Year Rehabilitation Plan

GISID	On Street	From Street	To Street	Current Segment PCI (CPCI)	Year of First Rehab	Rehab Activity	Avg Unit Rate (\$/yd2)	Segment Pavement Cost (\$)	Segment Total Cost (\$)	Whole Project Cost (\$)	5 Year Post Rehab PCI
1383	47th Ave S	NE END	S 134th Pl	32	3	FWM + Thick Overlay (> 2.0 - 3.0) + Strctrl Ptch	50.39	42,884	42,884	42,884	92
1386	50th Pl S	S 124th St	S 125th St	47	3	FWM + Thick Overlay (> 2.0 - 3.0)	48.27	50,733	50,733	50,733	92
1146	50th Pl S	S 125th St	S 130th Pl	34	3	FWM + Thick Overlay (> 2.0 - 3.0) + Strctrl Ptch	53.05	211,597	211,597	211,597	92
1113	53rd Ave S	S 170th St	S 172nd Ln	47	3	FWM + Thick Overlay (> 2.0 - 3.0)	46.15	102,220	102,220	102,220	92
1571	57th Ave S	S 152nd St	S 152nd Pl	48	3	FWM + Thick Overlay (> 2.0 - 3.0)	46.15	39,642	39,642	39,642	92
1004	62nd Ave S	S 151st St	DS@131S S 151st St	16	3	ACP Full Depth Reconstruction	111.39	33,975	33,975	33,975	95
1640	Airport Way S	Boeing Access Rd	Airport Way S	33	3	FWM + Thick Overlay (> 2.0 - 3.0) + Strctrl Ptch	55.70	129,997	129,997	129,997	91
1364	Fun Center Way	DS@447E Interurban Ave S	SW Grady Way	33	3	FWM + Thick Overlay (> 2.0 - 3.0) + Strctrl Ptch	50.39	13,153	13,153	13,153	92
1744	S 142nd St	52nd Ave S	53rd Ave S	47	3	FWM + Thick Overlay (> 2.0 - 3.0)	46.15	38,073	38,073	38,073	92
1345	S 149th St	DS@480E NW END	Interurban Ave S	34	3	FWM + Thick Overlay (> 2.0 - 3.0) + Strctrl Ptch	50.39	101,037	101,037	101,037	92
1718	S 152nd St	International Blvd	37th Pl S	33	3	FWM + Thick Overlay (> 2.0 - 3.0) + Strctrl Ptch	50.39	109,655	109,655	109,655	92
1723	S 180th St	Andover Park W	Andover Park E	49	3	FWM + Thick Overlay (> 2.0 - 3.0)	50.39	242,792	242,792	242,792	91
1704	Starfire Way	Starfire Way	DS@1178E Starfire Way	34	3	FWM + Thick Overlay (> 2.0 - 3.0) + Strctrl Ptch	50.39	173,200	173,200	173,200	92
1551	SW Grady Way	Interurban Ave S	Interurban Ave S	48	3	FWM + Thick Overlay (> 2.0 - 3.0)	46.15	22,382	22,382	22,382	92
1208	34th Ave S	S 130th St	S 132nd St	50	4	FWM + Thick Overlay (> 2.0 - 3.0)	47.53	96,018	96,018	96,018	94
1205	34th Ave S	S 144th St	Military Rd S	49	4	FWM + Thick Overlay (> 2.0 - 3.0)	47.53	70,968	70,968	70,968	94
1236	35th Ave S	S 133rd St	S 135th St	36	4	FWM + Thick Overlay (> 2.0 - 3.0) + Strctrl Ptch	51.90	128,464	128,464	128,464	94
1064	37th Ave S	S 128th St	S 130th St	36	4	FWM + Thick Overlay (> 2.0 - 3.0) + Strctrl Ptch	51.90	82,788	82,788	82,788	94
1379	40th Ave S	S 152nd St	Southcenter Blvd	35	4	FWM + Thick Overlay (> 2.0 - 3.0) + Strctrl Ptch	51.90	91,819	91,819	91,819	94
1362	59th Aly S	S 147th St	SOUTH END	35	4	FWM + Thick Overlay (> 2.0 - 3.0) + Strctrl Ptch	51.90	74,016	74,016	74,016	94
1630	Beacon Ave S	CITY LIMIT	S Ryan Way	65	4	MicroSurface / Chip Seal + Strctrl Ptch	9.84	1,377	1,377	1,377	87
1975	Boeing Access Rd	Martin L King Jr Ramp	Martin L King Jr Way S	36	4	FWM + Thick Overlay (> 2.0 - 3.0) + Strctrl Ptch	60.10	90,030	90,030	90,030	93
1772	C Line	Unnamed-01534	Southcenter Pkwy	33	4	Surf Recon + Base Rehab / FWM + Strctrl Ptch + Olay	78.68	133,986	133,986	133,986	95
1176	Christensen Rd	Strander Blvd	Christensen Rd	50	4	FWM + Thick Overlay (> 2.0 - 3.0)	47.53	84,467	84,467	84,467	94
1577	Corporate Dr S	Corporate Dr S	Corporate Dr S	38	4	FWM + Thick Overlay (> 2.0 - 3.0)	47.53	22,531	22,531	69,922	94
1249	Corporate Dr S	WEST END	Andover Park W	56	4	FWM + Thick Overlay (> 2.0 - 3.0)	47.53	47,391	47,391	69,922	94
1378	Nelsen Pl	S 156th St	Longacres Way	35	4	FWM + Thick Overlay (> 2.0 - 3.0) + Strctrl Ptch	51.90	82,995	82,995	82,995	94
1284	S 112th St	50th Ave S	51st Ave S	48	4	FWM + Thick Overlay (> 2.0 - 3.0)	47.53	32,608	32,608	32,608	94
1444	S 114th St	40th Ave S	41st Ave S	35	4	FWM + Thick Overlay (> 2.0 - 3.0) + Strctrl Ptch	51.90	29,170	29,170	29,170	94
2098	S 118th St	44th Ave S	44th Pl S	86	4	Slurry Seal / Seal Coat	5.57	1,226	1,226	1,226	84
1595	S 130th Pl	57th Ave S	SE END	50	4	FWM + Thick Overlay (> 2.0 - 3.0)	47.53	180,390	180,390	180,390	94
1185	S 131st Pl	44th Ave S	44th Ave S	49	4	FWM + Thick Overlay (> 2.0 - 3.0)	47.53	14,783	14,783	14,783	94
1243	S 144th St	58th Ave S	59th Ave S	56	4	FWM + Thick Overlay (> 2.0 - 3.0)	47.53	62,839	62,839	95,495	94
1188	S 144th St	59th Ave S	EAST END	36	4	FWM + Thick Overlay (> 2.0 - 3.0)	47.53	32,656	32,656	95,495	94
1493	S 164th St	48th Pl S	49th Ave S	50	4	FWM + Thick Overlay (> 2.0 - 3.0) + Strctrl Ptch	51.90	39,240	39,240	39,240	94
1582	33rd Pl S	NW END	S 130th St	52	5	FWM + Thick Overlay (> 2.0 - 3.0)	48.96	37,209	37,209	37,209	96
1385	47th Ave S	S 104th Pl	S 107th St	38	5	FWM + Thick Overlay (> 2.0 - 3.0) + Strctrl Ptch	53.46	102,005	102,005	102,005	96
1846	47th Ave S	S 160th St	S 162nd St	51	5	FWM + Thick Overlay (> 2.0 - 3.0)	48.96	86,854	86,854	86,854	96
1051	48th Pl S	48th Ave S	S 136th St	76	5	MicroSurface / Chip Seal	8.44	5,445	5,445	5,445	88

City of Tukwila, WA

Street Inventory and Five Year Rehabilitation Plan By Year



\$1400k/Year Rehabilitation Plan

GISID	On Street	From Street	To Street	Current Segment PCI (CPCI)		Rehab Activity	Avg Unit Rate (\$/yd2)	Segment Pavement Cost (\$)	Segment Total Cost (\$)	Whole Project Cost (\$)	5 Year Post Rehab PCI
				Year	Year of First Rehab						
1684	53rd Pl S	53rd Pl S SPUR	53rd Pl S SPUR	37	5	FWM + Thick Overlay (> 2.0 - 3.0) + Strctrl Ptch	53.46	10,692	10,692	10,692	96
1411	56th Ave S	S 139th St	S 141st St	51	5	FWM + Thick Overlay (> 2.0 - 3.0)	48.96	81,371	81,371	81,371	96
1423	East Marginal Way S	Tukwila Intl Blvd	Boeing Access Rd	55	5	FWM + Thick Overlay (> 2.0 - 3.0)	56.28	15,082	15,082	15,082	96
2092	East Marginal Way S	Interurban Ave S	SR 599	38	5	FWM + Thick Overlay (> 2.0 - 3.0) + Strctrl Ptch	59.09	64,407	64,407	64,407	96
1868	East Marginal Way S	S 128th St	S 128th St	48	5	FWM + Thick Overlay (> 2.0 - 3.0)	53.46	31,863	31,863	150,120	96
1866	East Marginal Way S	S 128th St	S 130th St	54	5	FWM + Thick Overlay (> 2.0 - 3.0)	53.46	97,086	97,086	150,120	96
1158	East Marginal Way S	S 130th St	40th Ave S	58	5	FWM + Thick Overlay (> 2.0 - 3.0)	53.46	21,171	21,171	150,120	96
1940	S 109th St	50th Ave S	Beacon Ave S	50	5	FWM + Thick Overlay (> 2.0 - 3.0)	48.96	27,222	27,222	27,222	96
1127	S 139th St	53rd Ave S	55th Ave S	37	5	FWM + Thick Overlay (> 2.0 - 3.0) + Strctrl Ptch	53.46	60,626	60,626	60,626	96
1743	S 142nd St	42nd Ave S	43rd Ave S	51	5	FWM + Thick Overlay (> 2.0 - 3.0)	48.96	47,246	47,246	47,246	96
1108	S 152nd St	40th Ave S	42nd Ave S	69	5	MicroSurface / Chip Seal + Strctrl Ptch	10.13	9,309	9,309	9,309	88
1223	S 180th St	Andover Park E	Sperry Dr	51	5	FWM + Thick Overlay (> 2.0 - 3.0)	53.46	247,207	247,207	395,563	96
1222	S 180th St	Sperry Dr	West Valley Hwy	56	5	FWM + Thick Overlay (> 2.0 - 3.0)	53.46	148,356	148,356	395,563	96
1342	Southcenter Blvd	38th Ln S	40th Ave S	53	5	FWM + Thick Overlay (> 2.0 - 3.0)	53.46	113,232	113,232	306,603	96
1413	Southcenter Blvd	40th Ave S	40th Ave S	56	5	FWM + Thick Overlay (> 2.0 - 3.0)	53.46	38,011	38,011	306,603	96
1168	Southcenter Blvd	40th Ave S	42nd Ave S	48	5	FWM + Thick Overlay (> 2.0 - 3.0)	53.46	155,360	155,360	306,603	96



CITY OF TUKWILA

Functional Class


Functional Class

Local

Collector

Minor Arterial

Principal Arterial

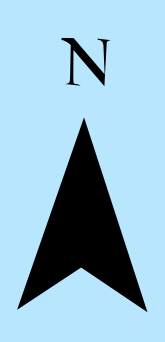



CITY OF TUKWILA

Current PCI

Current PCI

(1-25) Very Poor

(26-40) Poor


(41-50) Marginal

(51-60) Fair

(61-70) Good

(71-85) Very Good

(86-100) Excellent

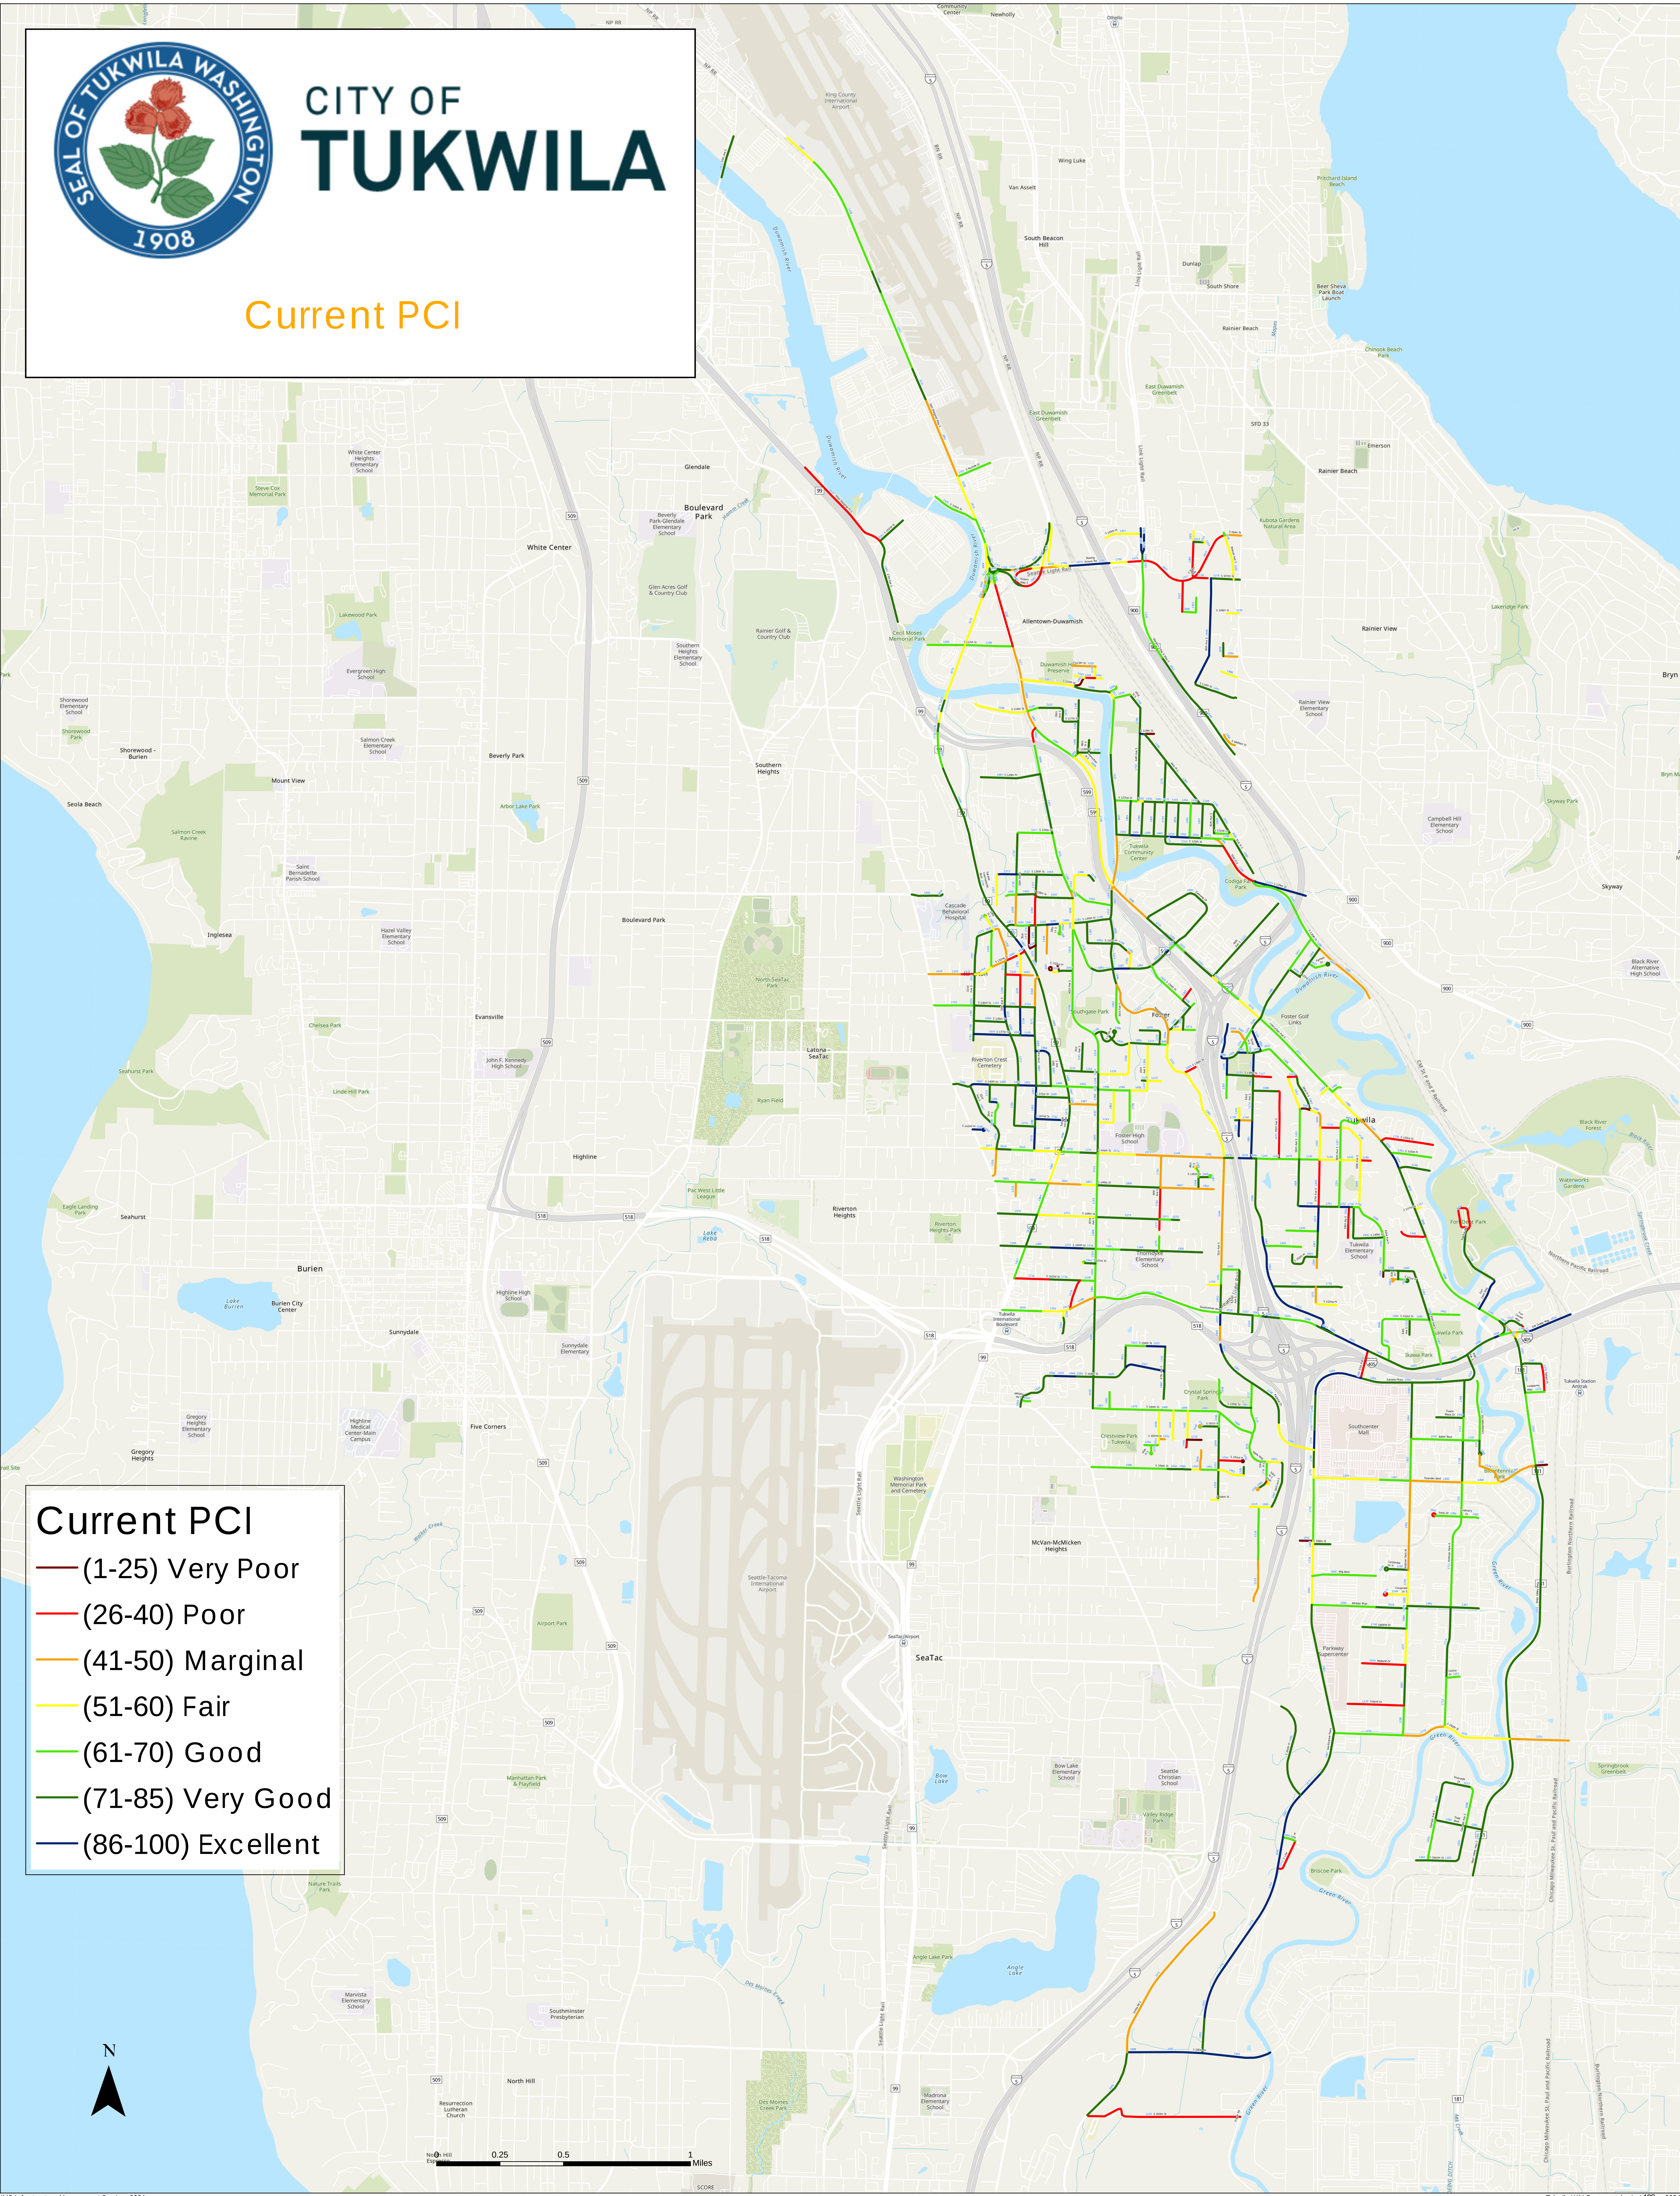



CITY OF TUKWILA


Rehab Plan by Year and Activity

Year of First Rehab

- 1
- 2
- 3
- 4
- 5

Rehab Activity

- Slurry Seal / Seal Coat
- MicroSurface / Chip Seal; MicroSurface / Chip Seal + Strctrl Ptch
- Edge Mill + Thin Overlay (1.5 - 2.0) + Strctrl Ptch; Edge Mill + Thin Overlay (1.5 - 2.0)
- EM/FWM + Moderate Overlay (2.0 - 3.0) + Strctrl Ptch
- FWM + Thick Overlay (> 2.0 - 3.0) + Strctrl Ptch; FWM + Thick Overlay (> 2.0 - 3.0)
- Surf Recon + Base Rehab / FWM + Strctrl Ptch + Olay
- ACP Full Depth Reconstruction

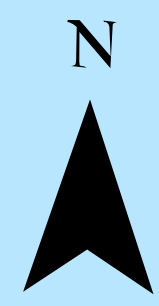

0.25 0.5 1 Miles



CITY OF TUKWILA

Projected PCI (Five Year)

Projected PCI

(1 - 25) Very Poor

(26 - 40) Poor

(40 - 50) Marginal

(50 - 60) Fair

(60 - 70) Good

(70 - 85) Very Good

(85 - 100) Excellent

